
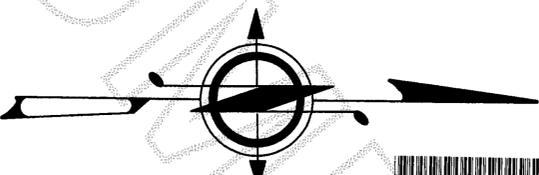


N: 523871.64
E: 1312868.11
N: 523826.21
E: 1315489.56
N: 523781.03
E: 1318111.71

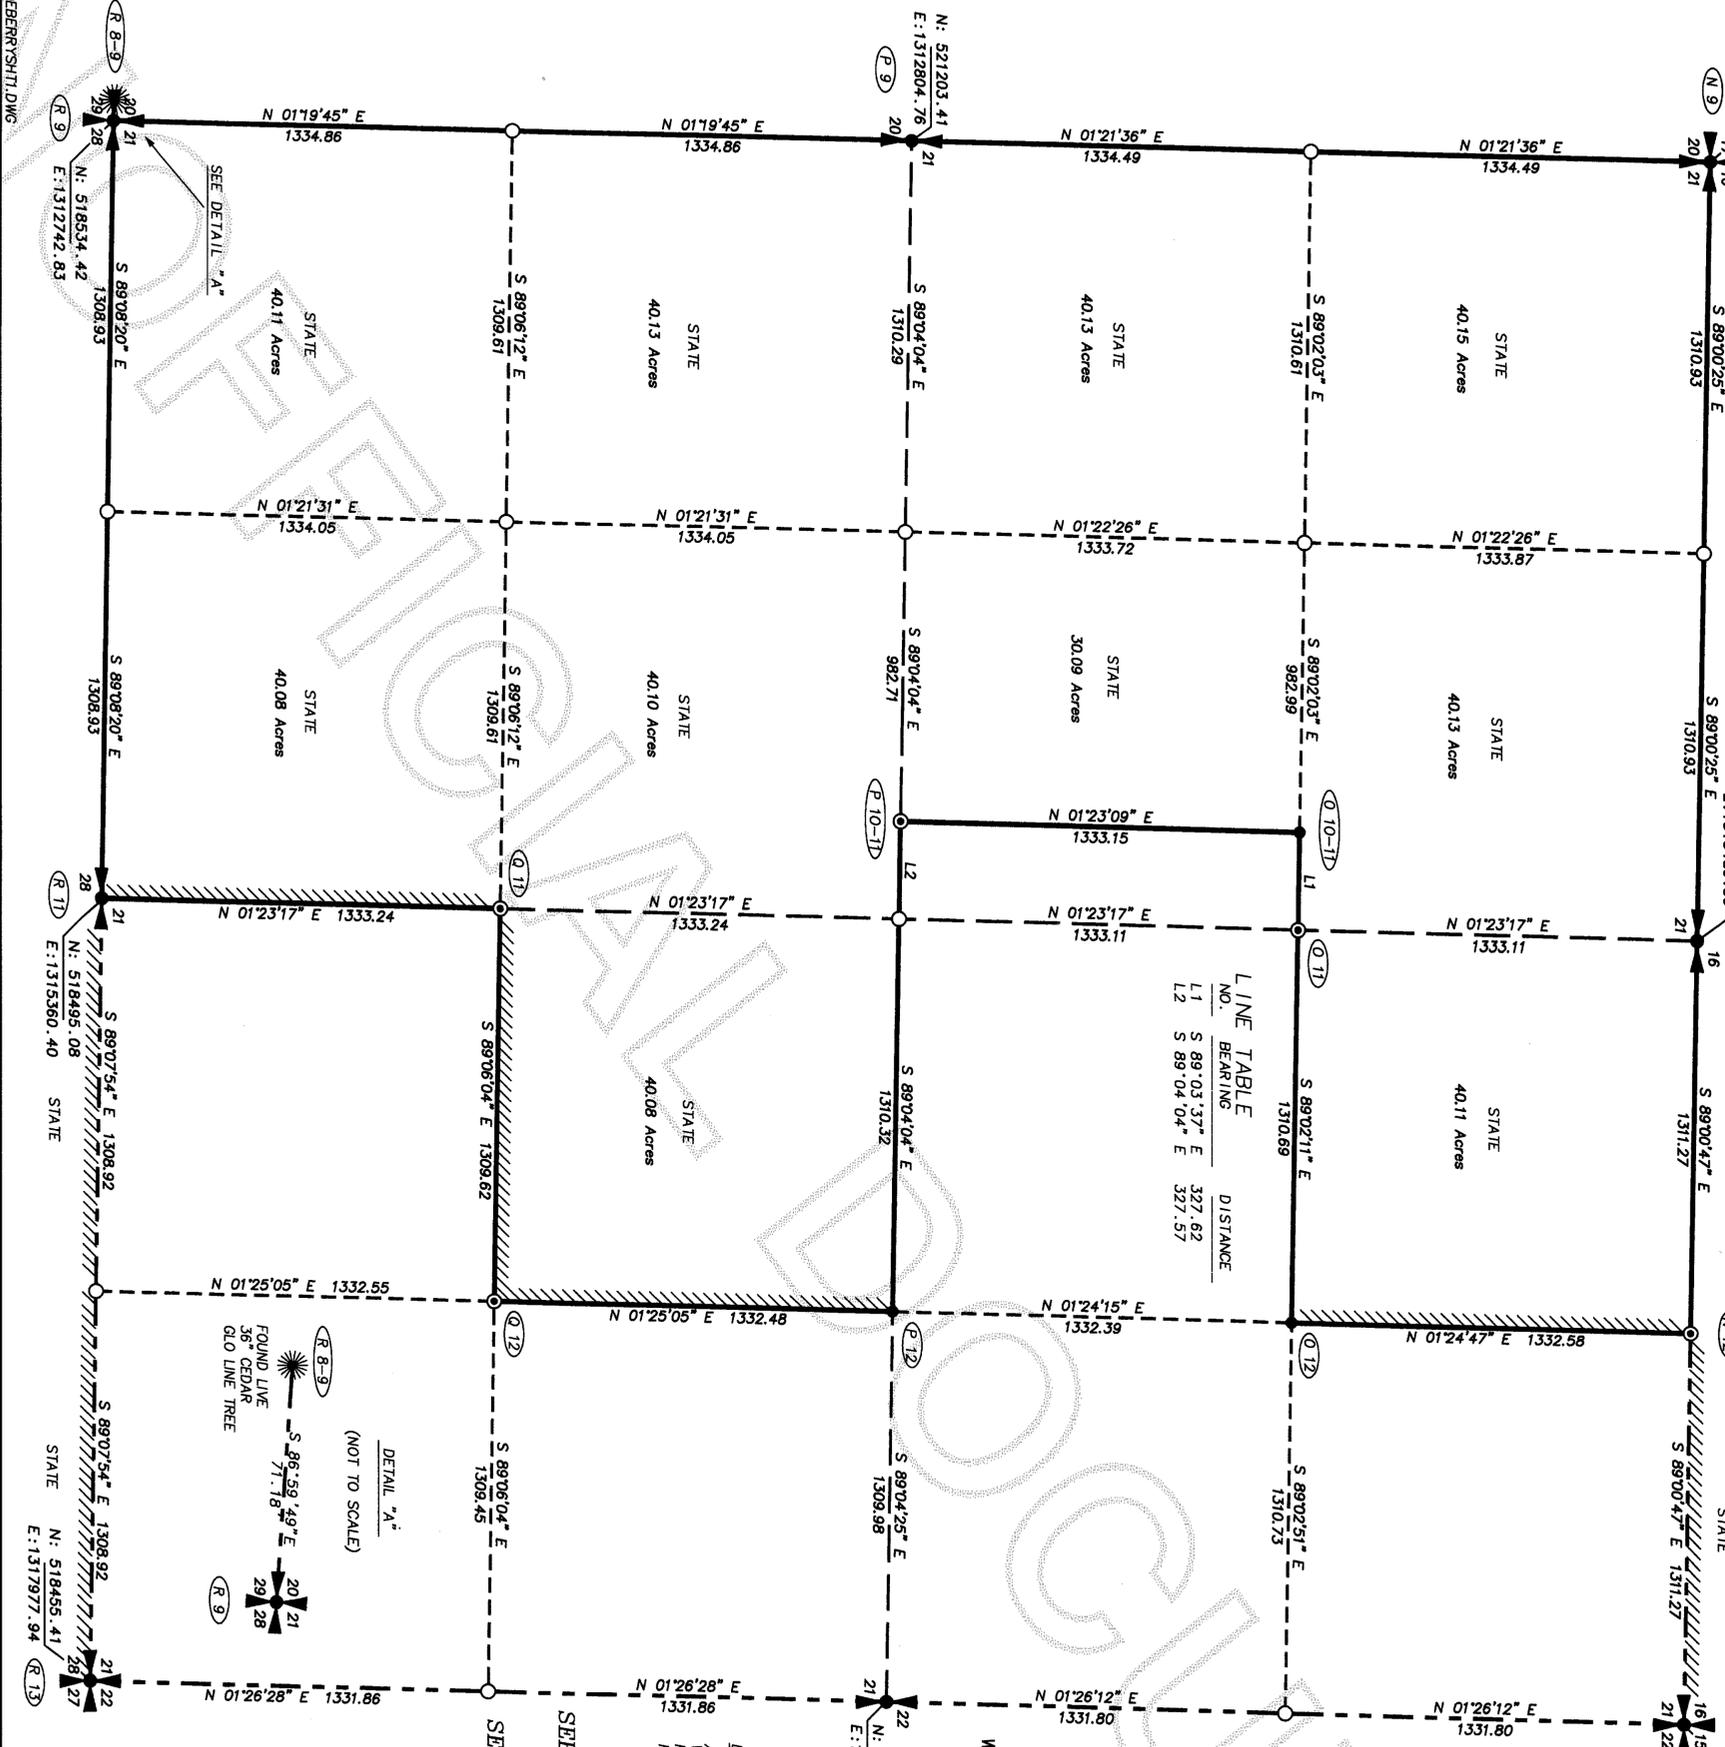

10/15/2002 Page 1 of 3 11:08AM
 Skagit County Auditor
 DESCRIPTION OF STATE TRUST LAND SURVEYED
 NW1/4 NE1/4, N1/2 NW1/4, SW1/4 NW1/4, W3/4 SE1/4 NW1/4, SW1/4, NW1/4 SE1/4, ALL IN SECTION 21, TOWNSHIP 34 NORTH, RANGE 5 EAST, WILLAMETTE MERIDIAN, SKAGIT COUNTY, WASHINGTON.
 SURVEYED BY GOVERNMENT RULES OF SUBDIVISION, THE ABOVE LEGAL DESCRIPTION IS FROM THAT CERTAIN DEED FROM THE COMMISSIONERS OF SKAGIT COUNTY TO THE STATE FOREST BOARD, DATED MARCH 9, 1936.
 BASIS OF BEARINGS
 WASHINGTON COORDINATE SYSTEM, NAD83/91, NORTH ZONE, DERIVED FROM GLOBAL POSITIONING SYSTEM TIES TO THE FOLLOWING CONTROL STATIONS:
 STATION DESIGNATION NORTHING EASTING
 DNR 7213 558,073.449 1,303,451.333
 K 61 559,233.724 1,343,316.064
 GP29009-68 499,924.308 1,306,873.309
 NEW POSITIONS ESTABLISHED DURING THIS SURVEY USING GPS METHODS:
 STATION DESIGNATION NORTHING EASTING
 DNR 7283 518,704.805 1,310,877.829
 DNR 7284 518,683.042 1,311,457.473
 DNR 7285 524,368.144 1,314,023.436
 DNR 7286 524,092.605 1,313,414.938
 DNR 7287 522,388.033 1,313,833.031
 DNR 7288 523,143.888 1,315,925.286
 DNR 7289 522,128.884 1,315,946.867
 DNR 7290 518,516.865 1,314,357.409
 CONVERGENCE = -00°59'47" AT THE C1/4 CORNER
 PROJECT DISTANCE FACTOR
 THE AREAS AND DISTANCES SHOWN ARE GRID. DIVIDE THE GRID DISTANCE BY 0.99987923 TO COMPUTE GROUND DISTANCE.
 LATITUDE FACTOR = 0.99986823
 ELEVATION FACTOR = 0.99992235
 COMBINED FACTOR = 0.99987923
 METHOD OF HORIZONTAL CONTROL
 CONTROL FOR THIS SURVEY IS IN COMPLIANCE WITH THE FEDERAL GEODETIC CONTROL COMMITTEE'S GEOMETRIC GEODETIC ACCURACY STANDARDS AND SPECIFICATIONS FOR USING GPS RELATIVE POSITIONING TECHNIQUES, VERSION 5.0, REPRINTED WITH CORRECTIONS AUGUST 1, 1999, FOR GROUP C, ORDER 1 SURVEYS. FIELD OBSERVATIONS WERE MADE USING FOUR TRIMBLE 4000SSI RECEIVERS.
 CORNER TIES WERE MADE BY FIELD TRAVERSE USING A LEICA TC801 ELECTRONIC THEODOLITE. TRAVERSES WERE EITHER CLOSED LOOPS OR BEGAN AND ENDED AT PREVIOUSLY ESTABLISHED CONTROL POINTS. TRAVERSE CLOSURES MEET OR EXCEED FIELD TRAVERSE STANDARDS FOR LAMBERT GRID TRAVERSES AS SPECIFIED IN WAC 352-50-090. CORNER MONUMENTS TIED AND MONUMENTS SET WERE CHECKED BY DOUBLE MEASURES OF BOTH DIRECTION AND DISTANCE.

"DOEBERRY" SURVEY
 SEE SHEET 2 FOR NARRATIVE, GENERAL NOTES, LIST OF SURVEY DOCUMENTS USED FOR REFERENCE & CORNER NOTES
 SEE SHEET 3 FOR REMAINING CORNER NOTES & GPS DIAGRAM

LEGEND

STANDARD DNR MONUMENTS ARE:
 2 3/8" O.D. ALUMINUM ALLOY PIPE WITH "BREAKAWAY" PLASTIC BASE.
 3 1/4" DIAMETER ALUMINUM ALLOY CAP STAMPED WITH PROPER CORNER IDENTIFICATION, PERMANENT, VERTICALLY ORIENTED MAGNETS ARE INCLUDED IN THE MONUMENT BASE AND CAP.
 STANDARD DNR CAPS ARE:
 3 1/4" DIAMETER ALUMINUM ALLOY DISKS WITH A VERTICALLY ORIENTED MAGNET AND STAMPED WITH PROPER CORNER IDENTIFICATION. SET AS NOTED.
 DNR CONCRETE MONUMENTS ARE 3" DIAMETER WITH BRASS CAP STAMPED WITH PROPER CORNER IDENTIFICATION.
 DNR IRON PIPES ARE 1" DIAMETER WITH BRASS CAP STAMPED WITH PROPER CORNER IDENTIFICATION.

CORNER SYMBOLS:
 ● FOUND OR ACCEPTED.
 ○ CALCULATED - SET.
 ○ CALCULATED - NOT SET.

INDEX GRAPH

SECTION	X	X	X	X
	X	X	X	X
	X	X	X	X
	X	X	X	X

AUDITOR'S CERTIFICATE
 FILED FOR RECORD THIS 15th DAY OF October, 2002
 AT 11:08 A.M. IN BOOK _____ OF SURVEYS AT PAGE _____
 AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES.
 200210150109
 AUDITOR'S FILE NUMBER

SURVEYOR'S CERTIFICATE
 THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES
 IN _____ MAY _____, 2002.
 GARY S. HERRICK, PLS
 CERTIFICATE NUMBER 31444

AUDITOR'S CERTIFICATE
 FILED FOR RECORD THIS 15th DAY OF October, 2002
 AT 11:08 A.M. IN BOOK _____ OF SURVEYS AT PAGE _____
 AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES.
 200210150109
 AUDITOR'S FILE NUMBER

SURVEYOR'S CERTIFICATE
 THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES
 IN _____ MAY _____, 2002.
 GARY S. HERRICK, PLS
 CERTIFICATE NUMBER 31444



SECTION 21, TOWNSHIP 34 NORTH, RANGE 5 EAST, W.M.
 A SURVEY IN
 STATE OF WASHINGTON
 DEPARTMENT OF NATURAL RESOURCES
 LAND SURVEY SECTION-P.O. BOX 47060
 OLYMPIA, WASHINGTON 98504-7060 (360)902/1206
 SURVEYED BY: ERIC OLSEN, PLS
 DRAWN BY: BRAD HALITT
 DATE: SEPTEMBER 26, 2002
 CHECKED BY: GARY HERRICK, PLS
 SHEET 1 OF 3
 F.M.# 1322

NARRATIVE

THE PURPOSE OF THIS SURVEY WAS TO MONUMENT THE CORNERS AND POST THE BOUNDARIES OF STATE TRUST LANDS. WE DID NOT LOCATE A CERTAIN WATER PIPELINE RIGHT OF WAY EASEMENT OVER AND ACROSS SECTION 21 SINCE THE EASEMENT DOCUMENT DOES NOT CONTAIN A METES AND BOUNDS LEGAL DESCRIPTION. NOR DO THE METES AND BOUNDS DESCRIBE THE PIPELINE LOCATION IN SECTION 21. SAID PIPELINE RIGHT OF WAY (#50-04616) WAS GRANTED IN 1915. PRIOR TO ACQUISITION BY THE STATE IN 1938, I DON'T KNOW IF THE EASEMENT IS STILL IN FORCE SINCE THE DOCUMENT CONTAINS A CONDITION WHEREBY ALL RIGHTS ARE FORFEITED IF THE GRANTEE FAILS TO SUPPLY WATER TO THE GRANTEE.

GENERAL NOTES

CORNER HISTORIES SHOWN ON THIS SURVEY DO NOT LIST THE ORIGINAL GENERAL LAND OFFICE (GLO) SURVEY INFORMATION OF SAID EVIDENCE IS NECESSARY TO JUSTIFY ACCEPTANCE OF CORNER POSITION.
CORNER HISTORIES ARE MADE BRIEF WHEN A MONUMENT HAS LONG BEEN ACCEPTED IN ITS CURRENT POSITION.
CORNER MONUMENTS WERE REFERENCED TO NEARBY OBJECTS. TYPICALLY LIVE TREES OR STUMPS; DISTANCES ARE HORIZONTAL AND WERE MEASURED WITH A STEEL TAPE STRETCHED BETWEEN THE CORNER AND AN ALUMINUM NAIL DRIVEN INTO THE SIDE OF A TREE. BEARINGS WERE TAKEN WITH A HAND COMPASS. IN MOST CASES, DNR ALUMINUM TAGS WERE PLACED ON REFERENCE TREES FACING THE CORNER.

LIST OF SURVEY DOCUMENTS USED FOR REFERENCE

RECORDING INFORMATION REFERS TO THE RECORDS OF THE SKAGIT COUNTY AUDITOR, UNLESS OTHERWISE NOTED.

NOTE: THE PARENTHETICAL ITEM NUMBERS BELOW ARE USED WITHIN THE HISTORY SECTION FOR EACH CORNER.

- (1) GENERAL LAND OFFICE SURVEY OF THE WEST 1/2 OF TOWNSHIP 34 NORTH RANGE 5 EAST UNDER CONTRACT NUMBER 286, DATED DECEMBER 15, 1892. JAMES T. BERRY, U.S. DEPUTY SURVEYOR.
- (2) GENERAL LAND OFFICE SURVEY OF THE EAST 1/2 OF TOWNSHIP 34 NORTH RANGE 5 EAST UNDER CONTRACT NUMBER 570, DATED APRIL 2, 1901. HENRY GAY, U.S. DEPUTY SURVEYOR.
- (3) CORNER RECORDS LOCATED AT THE DEPARTMENT OF NATURAL RESOURCES SEDRO-WOOLLEY OFFICE.
- (4) UNDATED RIGHT OF WAY PLAT IN SECTION 16 BY EDW. C. DOHM, STATE FIELD ENGINEER, ON FILE WITH THE DEPARTMENT OF NATURAL RESOURCES PUBLIC LAND SURVEY OFFICE, OLYMPIA WASHINGTON.
- (5) RIGHT OF WAY PLAT IN SECTION 16 BY CLEAR LAKE LUMBER COMPANY, ON FILE WITH THE DEPARTMENT OF NATURAL RESOURCES PUBLIC LAND SURVEY OFFICE, OLYMPIA WASHINGTON, DATED 2-18-1914.
- (6) RIGHT OF WAY PLAT IN SECTION 16 BY ROBT. E.L. KNAPP, ENG. FOR THE SKAGIT IMPROVEMENT COMPANY, ON FILE WITH THE DEPARTMENT OF NATURAL RESOURCES PUBLIC LAND SURVEY OFFICE, OLYMPIA WASHINGTON, DATED 8-1-1924.
- (7) FIELD BOOK NOTES FROM THE CCC, ON FILE WITH THE DEPARTMENT OF NATURAL RESOURCES PUBLIC LAND SURVEY OFFICE, OLYMPIA WASHINGTON, NOT DATED.
- (8) RIGHT OF WAY PLAT IN SECTION 29 BY THE BONNEVILLE POWER ADMINISTRATION, ON FILE WITH THE DEPARTMENT OF NATURAL RESOURCES PUBLIC LAND SURVEY OFFICE, OLYMPIA WASHINGTON, DATED 11-27-1972.
- (9) RECORD OF SURVEY IN SECTION 20, BY RADER AND LEONARD & ASSOC. INC. (JAMES E. KEYES, P.L.S.) RECORDED UNDER AFN 8448785, DATED 1-6-1977.
- (10) LAND CORNER RECORDS, BY AZIMUTH NORTHWEST, INC. (STUART B. VAN BUREN JR., P.L.S.) RECORDED UNDER AFN 981928003 THROUGH 981920008, DATED 10-28-1998.
- (11) RECORD OF SURVEY IN SECTION 21, BY AZIMUTH NORTHWEST, INC. (STUART B. VAN BUREN JR., P.L.S.) RECORDED UNDER AFN 981190084, DATED 11-19-1998.
- (12) RECORD OF SURVEY IN SECTION 20, BY SKAGIT SURVEYORS & ENGINEERS (JOHN L. ABERNETHY, P.L.S.) RECORDED UNDER AFN 199911230052, DATED 11-23-1999.

CORNER NOTES

(19) CORNER OF SECTIONS 16, 17, 20, 21

ACCEPTED CORNER
HISTORY: GLO SURVEY CALLED A BROOK AT 79 CHAINS AND SET A HEMLOCK POST AT 80 CHAINS AND MARKED FOUR BEARING TREES, ONE OF WHICH WAS A 14" CEDAR AT 575W 40 LINKS (1).
1914 - R/W MAP BY CLEAR LAKE LUMBER CO. SHOWS CORNER SYMBOL AND DISTANCE TO R/W (5).
NO DATE - R/W MAP BY EDW. C. DOHM (STATE FIELD ENGINEER) SHOWS DISTANCE TO R/W (4).
1924 - PIPE LINE R/W PLAT FOR SKAGIT IMPROVEMENT CO. SHOWS DISTANCE TO R/W (6).
1969 - DNR CORNER RECORDS SHOW CORNER WAS A POST WITH 1 POSSIBLE BIT AND 2 TAGS (3).
1976 - SURVEY BY RADER AND LEONARD & ASSOC. INC. SHOWS CORNER WAS FOUND IN 1968 AND REPLACED WITH A 3/4" IRON PIPE IN 1976 (9).

1998 - SURVEY AND LAND CORNER RECORD BY AZIMUTH NORTHWEST, INC. SHOWS FINDING THE 3/4" IRON PIPE AND ALSO NOTES THE CORNER FITS A GLO CALL 1.5 CHAINS SOUTH (10, 11).
FIELD SEARCH: ON 2-7-02, WE FOUND A 1" IRON PIPE WITH NYLON CAP MARKED 6702 (ACCEPTED) FROM WHICH 1 POSSIBLE GLO BEARING TREE (A 20" CEDAR STUMP, NO MARKS FOUND) BEARS 577W 42 LINKS (GLO NOTED A 14" CEDAR AT 575W 40 LINKS). PIPE ALSO FITS GLO BROOK CALL 1 CHAIN SOUTH.
CORNER PERPETUATION: WE REPLACED THE FOUND 1" IRON PIPE WITH A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 6" UP IN MOUND OF STONE. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 51" CEDAR STUMP WITH DNR ALUMINUM TAG AT N70E 30.52 FEET TO A STEEL NAIL 2 FEET UP ON NW SIDE.
A 30" FIR STUMP WITH DNR ALUMINUM TAG AT S81E 19.10 FEET TO A STEEL NAIL 2 FEET UP ON NORTH SIDE.
A 20" FIR STUMP WITH DNR ALUMINUM TAG AT SOUTH 11.92 FEET TO A STEEL NAIL 1 FOOT UP ON EAST SIDE.
A 22" FIR STUMP WITH DNR ALUMINUM TAG AT N37W 29.08 FEET TO A STEEL NAIL 2 FEET UP ON WEST SIDE.
SET ORANGE CARSONITE POST 2 FEET EAST.
FIELD BOOK 7037A, PAGE 77, DATED 2-7-02.

(11) 1/4 CORNER OF SECTIONS 16 & 21

ACCEPTED CORNER
HISTORY: NO DATE - R/W MAP BY EDW. C. DOHM (STATE FIELD ENGINEER) SHOWS CORNER SYMBOL (4).
1914 - R/W MAP BY CLEAR LAKE LUMBER CO. SHOWS CORNER SYMBOL (5).
1998 - SURVEY AND LAND CORNER RECORD BY AZIMUTH NORTHWEST, INC. SHOWS NOTHING WAS FOUND, THEN SET A REBAR AND ALUMINUM CAP AT SINGLE PROPORTION (10, 11).
FIELD SEARCH: ON 3-28-02, WE FOUND THE AZIMUTH NW REBAR AND ALUMINUM CAP (ACCEPTED) SET FLUSH WITH THE GROUND WITH PROPER IDENTIFICATION NEAR THE MIDPOINT POSITION. WE ALSO FOUND A 1" IRON PIPE WITH PLUG AND COPPER TACK (NOT ACCEPTED) FLUSH WITH GROUND AT S80E 2.60 FEET FROM THE ALUMINUM CAP. IT'S NOT KNOWN WHO SET THE PIPE, BUT SOME TREES AROUND THE CORNER (NOW ABOUT 2 YEAR-OLD STUMPS) HAVE OVERGROWN TRIPLE NOTCHES FACING THE PIPE WITH ABOUT 30 YEARS OF OVERGROWTH WHICH MAY INDICATE WHEN IT WAS SET. NO GLO EVIDENCE WAS FOUND FROM EITHER POSITION. WE ACCEPTED THE ALUMINUM CAP POSITION SINCE IT FITS THE CALCULATED POSITION AND WAS SET FOR A RECORDED SURVEY.
CORNER PERPETUATION: FROM THE ACCEPTED ALUMINUM CAP, REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 31" FIR STUMP WITH DNR ALUMINUM TAG AT S69E 13.88 FEET TO A STEEL NAIL 2 FEET UP ON SW SIDE.
A 65" CEDAR STUMP WITH DNR ALUMINUM TAG AT S29E 47.74 FEET TO A STEEL NAIL 2 FEET UP ON NE SIDE.
A 66" CEDAR STUMP WITH DNR ALUMINUM TAG AT N60E 30.06 FEET TO A STEEL NAIL 3 FEET UP ON NE SIDE.
A 96" CEDAR STUMP WITH DNR ALUMINUM TAG AT N22W 85.68 FEET TO A STEEL NAIL 4 FEET UP ON SW SIDE.
SET ORANGE CARSONITE POST 1 FOOT SOUTH.
FIELD BOOK 7037A, PAGE 24, DATED 3-28-02.

(12) EAST 1/16 CORNER OF SECTIONS 16 & 21

SET CALCULATED CORNER
HISTORY: NOTHING OF RECORD
FIELD SEARCH: NOTHING FOUND
CORNER PERPETUATION: ON 5-29-02 WE SET A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 4" UP IN MOUND OF STONE. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 15" FIR WITH DNR ALUMINUM TAG AT N40E 25.16 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON NW SIDE.
A 25" FIR WITH DNR ALUMINUM TAG AT S77E 17.96 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON SW SIDE.
A 17" FIR WITH DNR ALUMINUM TAG AT S57W 27.54 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON NW SIDE.
A 16" HEMLOCK WITH DNR ALUMINUM TAG AT N57W 23.19 FEET TO A STEEL NAIL 2 FEET UP ON SW SIDE.
SET ORANGE CARSONITE POST 1 FOOT EAST.
FIELD BOOK 7037A, PAGE 37, DATED 5-29-02.

(13) CORNER OF SECTIONS 15, 16, 21, 22

ACCEPTED CORNER
HISTORY: 1933 - CCC FIELD BOOK SHOWS CORNER WAS A STAKE WITH 2 BEARING TREES (7).
1947 - DNR CORNER RECORDS SHOW CORNER WAS A PIPE AND STAKE WITH A TAG (3).

1998 - SURVEY AND LAND CORNER RECORD BY AZIMUTH NORTHWEST, INC. SHOWS FINDING A 2" IRON PIPE, A DNR TAG ON THE GROUND, A 24" FIR STUMP 1.21 CHAINS NORTH OF PIPE FITTING GLO CALL AND A ROCK WALL GLO CALL 320 FEET EAST. THEY SET AN ALUMINUM CAP ON REBAR IN PLACE OF THE IRON PIPE (10, 11).
FIELD SEARCH: ON 2-25-02, WE FOUND THE AZIMUTH NORTHWEST REBAR AND ALUMINUM CAP (ACCEPTED) AND THE 2" IRON PIPE LYING BESIDE. A 36" FIR STUMP (PROBABLE GLO LINE TREE) WITH AN OLD OVERGROWN BLAZE (NOT A GLO NOTCH) BEARS NORTH 79 FEET (GLO CALLED AT 80 FEET). NO GLO BEARING TREE EVIDENCE WAS FOUND. A NORTHWEST SURVING CARSONITE POST WAS FOUND BESIDE THE ALUMINUM CAP AND FRESH LINE BLAZING RUNS NORTH.
CORNER PERPETUATION: FROM THE ACCEPTED ALUMINUM CAP, REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 13" HEMLOCK WITH DNR ALUMINUM TAG AT N17E 5.78 FEET TO A STEEL FINISH NAIL 1 FOOT UP ON SE SIDE.
A 32" FIR WITH DNR ALUMINUM TAG AT S13W 24.88 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON NW SIDE.
A 13" HEMLOCK WITH DNR ALUMINUM TAG AT S75W 7.17 FEET TO A STEEL FINISH NAIL 1 FOOT UP ON SE SIDE.
A 19" FIR WITH DNR ALUMINUM TAG AT N27W 26.40 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON WEST SIDE.
FIELD BOOK 7037A, PAGE 76, DATED 2-25-02.

(10-11) C-E-E-NW/256 CORNER SECTION 21

ACCEPTED CORNER
HISTORY: 1998 - SURVEY BY AZIMUTH NORTHWEST, INC. SHOWS REBAR AND YELLOW CAP SET (11).
FIELD SEARCH: ON 5-1-02, WE FOUND THE AZIMUTH NORTHWEST REBAR AND YELLOW CAP (ACCEPTED) NEAR THE CALCULATED POSITION.
CORNER PERPETUATION: WE REPLACED THE FOUND REBAR AND CAP WITH A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 3" UP IN MOUND OF STONE. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 38" CEDAR STUMP WITH DNR ALUMINUM TAG AT N33E 36.01 FEET TO A STEEL NAIL 4 FEET UP ON NW SIDE.
A 22" FIR WITH DNR ALUMINUM TAG AT S70W 32.21 FEET TO AN ALUMINUM NAIL 2 FEET UP ON WEST SIDE.
A 26" FIR WITH DNR ALUMINUM TAG AT S35W 36.62 FEET TO AN ALUMINUM NAIL 2 FEET UP ON NW SIDE.
A 19" FIR WITH DNR ALUMINUM TAG AT S55W 87.51 FEET TO AN ALUMINUM NAIL 2 FEET UP ON NW SIDE.
SET ORANGE CARSONITE POST 1 FOOT NORTH.
FIELD BOOK 7037A, PAGE 28, DATED 5-1-02.

(12) C-N/16 CORNER SECTION 21

SET CALCULATED CORNER
HISTORY: NOTHING OF RECORD
FIELD SEARCH: NOTHING FOUND
CORNER PERPETUATION: ON 5-29-02 WE SET A DNR ALUMINUM CAP MARKED WITH IDENTIFICATION, 4" UP IN MOUND OF STONE. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 32" FIR WITH DNR ALUMINUM TAG AT N65E 18.16 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON SE SIDE.
A 28" CEDAR STUMP WITH DNR ALUMINUM TAG AT S79E 22.62 FEET TO A STEEL NAIL 2 FEET UP ON SW SIDE.
A 78" CEDAR STUMP WITH DNR ALUMINUM TAG AT S26E 73.49 FEET TO A STEEL NAIL 3 FEET UP ON SW SIDE.
A 64" CEDAR STUMP WITH DNR ALUMINUM TAG AT S35W 89.54 FEET TO A STEEL NAIL 2 FEET UP ON NW SIDE.
SET ORANGE CARSONITE POST 1 FOOT EAST.
FIELD BOOK 7037A, PAGE 39, DATED 5-29-02.

(13) NE 1/16 CORNER SECTION 21

ACCEPTED CORNER
HISTORY: 1998 - SURVEY BY AZIMUTH NORTHWEST, INC. SHOWS REBAR AND YELLOW CAP SET (11).
FIELD SEARCH: ON 5-1-02 WE FOUND THE AZIMUTH NORTHWEST REBAR AND YELLOW CAP (ACCEPTED) NEAR THE CALCULATED POSITION.
CORNER PERPETUATION: FROM THE ACCEPTED ALUMINUM CAP AND CAP WITH A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, SET 2" UP. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 32" CEDAR STUMP WITH DNR ALUMINUM TAG AT N52E 4.86 FEET TO A STEEL NAIL 2 FEET UP ON WEST SIDE.
A 10" HEMLOCK WITH DNR ALUMINUM TAG AT S69E 18.03 FEET TO AN ALUMINUM NAIL 3 FEET UP ON SW SIDE.

A 24" FIR WITH DNR ALUMINUM TAG AT S55E 43.79 FEET TO AN ALUMINUM NAIL 2 FEET UP ON SW SIDE.
A 15" FIR WITH DNR ALUMINUM TAG AT N74W 50.42 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON NE SIDE.
SET ORANGE CARSONITE POST 2 FEET SOUTH.
FIELD BOOK 7037A, PAGE 27, DATED 5-1-02.

(19) 1/4 CORNER OF SECTIONS 20 & 21

ACCEPTED CORNER
HISTORY: 1976 - SURVEY BY RADER AND LEONARD & ASSOC. INC. SHOWS A TACK IN LEAD WAS SET ON A ROCK LEDGE AT A MID-POINT POSITION (9).
1998 - SURVEY BY AZIMUTH NORTHWEST, INC. SHOWS FINDING THE TACK IN LEAD AT N5537W 0.73 FEET FROM THEIR CALCULATED MIDPOINT POSITION. THE MIDPOINT POSITION WAS USED TO SUBDUDE SECTION 21 (11).
1999 - SURVEY IN SECTION 20 BY SKAGIT SURVEYORS & ENGINEERS SHOWS A POSITION CALCULATED FROM RADER AND LEONARD'S 1976 SURVEY (12).
FIELD SEARCH: ON 5-2-02, WE FOUND THE TACK IN LEAD ON A ROCK SLAB (ACCEPTED). FOUND SEVERAL AZIMUTH NORTHWEST REFERENCE TAGS AND A WHITE 1/2 X 2 STAKE REFERRING THE TACK IN LEAD AS THE 1/4 CORNER. NO GLO EVIDENCE WAS FOUND.
CORNER PERPETUATION: WE REPLACED THE FOUND TACK IN LEAD WITH A REBAR AND DNR ALUMINUM CAP MARKED WITH IDENTIFICATION, GLED IN A DRILL HOLE IN THE ROCK SLAB. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 34" FIR STUMP WITH DNR ALUMINUM TAG AT N19E 10.00 FEET TO A STEEL NAIL 1 FOOT UP ON NW SIDE AT S30E 5.08 FEET.
A STEEL NAIL GLED IN A DRILL HOLE IN ROCK AT S21W 6.06 FEET.
A STEEL NAIL GLED IN A DRILL HOLE IN ROCK AT N45W 39.28 FEET.
SET ORANGE CARSONITE POST 2 FEET WEST.
FIELD BOOK 7037A, PAGE 29, DATED 5-2-02.

(10-11) C-E-E-W/256 CORNER SECTION 21

SET CALCULATED CORNER
HISTORY: 1998 - SURVEY BY AZIMUTH NORTHWEST, INC. SHOWS REBAR AND YELLOW CAP SET (11).
FIELD SEARCH: ON 5-28-02, WE FOUND THE AZIMUTH NORTHWEST REBAR AND YELLOW CAP (NOT ACCEPTED) AT S18W 1.19 FEET FROM THE CALCULATED POSITION.
CORNER PERPETUATION: ON 5-28-02 WE SET A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 4" UP IN MOUND OF STONE. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 31" FIR WITH DNR ALUMINUM TAG AT S79E 24.30 FEET TO AN ALUMINUM NAIL 1 1/2 FEET UP ON NE SIDE.
A 25" FIR WITH DNR ALUMINUM TAG AT S26W 28.49 FEET TO AN ALUMINUM NAIL 2 FEET UP ON SE SIDE.
A 23" CEDAR WITH DNR ALUMINUM TAG AT N57W 14.76 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON WEST SIDE.
A 23" CEDAR WITH DNR ALUMINUM TAG AT N37W 17.24 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON WEST SIDE.
SET ORANGE CARSONITE POST 1 FOOT NORTH.
FIELD BOOK 7037A, PAGE 35, DATED 5-28-02.

(12) C-E/16 CORNER SECTION 21

ACCEPTED CORNER
HISTORY: 1998 - SURVEY BY AZIMUTH NORTHWEST, INC. SHOWS REBAR AND YELLOW CAP SET (11).
FIELD SEARCH: ON 5-1-02 WE FOUND THE AZIMUTH NORTHWEST REBAR AND YELLOW CAP (ACCEPTED) NEAR THE CALCULATED POSITION.
CORNER PERPETUATION: FROM THE FOUND REBAR AND CAP WITH A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 4" UP. REFERENCES WERE ESTABLISHED AS FOLLOWS:
AN 11" FIR WITH DNR ALUMINUM TAG AT N85E 2.03 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON SOUTH SIDE.
A 76" FIR STUMP WITH DNR ALUMINUM TAG AT S28W 73.66 FEET TO A STEEL NAIL 2 FEET UP ON SE SIDE.
A 13" FIR WITH DNR ALUMINUM TAG AT S81W 22.92 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON NORTH SIDE.
A 32" FIR STUMP WITH DNR ALUMINUM TAG AT N15W 21.47 FEET TO A STEEL NAIL 1 FOOT UP ON WEST SIDE.
SET ORANGE CARSONITE POST 1 FOOT SOUTH.
FIELD BOOK 7037A, PAGE 26, DATED 5-1-02.

(13) 1/4 CORNER OF SECTIONS 21 & 22
ACCEPTED CORNER
HISTORY: 1939 - CCC FIELD BOOK SHOWS CORNER WAS A NEW POST, MENTIONS A DECAYED BEARING TREE AND USES THE WORD "APPROX." (7).
1998 - SURVEY AND LAND CORNER RECORD BY AZIMUTH NORTHWEST, INC. SHOWS NOTHING WAS FOUND, THEN SET A REBAR AND ALUMINUM CAP AT SINGLE PROPORTION (10, 11).
FIELD SEARCH: ON 5-1-02, WE FOUND THE AZIMUTH NW REBAR AND ALUMINUM CAP (ACCEPTED) SET FLUSH WITH THE GROUND WITH PROPER IDENTIFICATION NEAR THE MIDPOINT POSITION. NO POST OR GLO EVIDENCE WAS FOUND.
CORNER PERPETUATION: FROM THE ACCEPTED ALUMINUM CAP REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 19" CEDAR STUMP WITH DNR ALUMINUM TAG AT N65E 6.41 FEET TO A STEEL NAIL 2 FEET UP ON NW SIDE.
A 20" FIR WITH DNR ALUMINUM TAG AT S83W 37.71 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON SE SIDE.
AN 18" ALDER WITH DNR ALUMINUM TAG AT N83W 14.61 FEET TO AN ALUMINUM NAIL FOOT UP ON SOUTH SIDE.
A 16" HEMLOCK WITH DNR ALUMINUM TAG AT N53W 72.33 FEET TO AN ALUMINUM NAIL FOOT UP ON SW SIDE.
SET ORANGE CARSONITE POST 1 FOOT NORTH.
FIELD BOOK 7037A, PAGE 25, DATED 5-1-02.

(12) C-S/16 CORNER SECTION 21

SET CALCULATED CORNER
HISTORY: NOTHING OF RECORD.
FIELD SEARCH: NOTHING FOUND.
CORNER PERPETUATION: ON 5-28-02 WE SET A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 4" UP IN MOUND OF STONE. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 31" CEDAR STUMP WITH DNR ALUMINUM TAG AT S64E 8.43 FEET TO A STEEL NAIL 4 FEET UP ON SW SIDE.
A 50" CEDAR STUMP WITH DNR ALUMINUM TAG AT S27E 55.66 FEET TO A STEEL NAIL 4 FEET UP ON SW SIDE.
A 28" FIR WITH DNR ALUMINUM TAG AT S45W 3.50 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON SE SIDE.
A 78" FIR STUMP WITH DNR ALUMINUM TAG AT N51W 58.79 FEET TO A STEEL NAIL 3 FEET UP ON SW SIDE.
SET ORANGE CARSONITE POST 2 FEET NORTH.
FIELD BOOK 7037A, PAGE 32, DATED 5-28-02.

(13) SE 1/16 CORNER SECTION 21

SET CALCULATED CORNER
HISTORY: NOTHING OF RECORD.
FIELD SEARCH: NOTHING FOUND.
CORNER PERPETUATION: ON 5-30-02 WE SET A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 6" UP. REFERENCES WERE ESTABLISHED AS FOLLOWS:
A 34" CEDAR WITH DNR ALUMINUM TAG AT N27E 18.27 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON SE SIDE.
A 96" FIR STUMP WITH DNR ALUMINUM TAG AT S36E 43.91 FEET TO A STEEL NAIL 3 FEET UP ON NE SIDE.
A 42" CEDAR STUMP WITH DNR ALUMINUM TAG AT S27W 63.08 FEET TO A STEEL NAIL 2 FEET UP ON WEST SIDE.
A 22" CEDAR WITH DNR ALUMINUM TAG AT N52W 17.24 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON NE SIDE.
SET ORANGE CARSONITE POST 1 FOOT SOUTH.
FIELD BOOK 7037A, PAGE 42, DATED 5-30-02.

(18-9) GLO LINE TREE

IDENTIFIED GLO LINE TREE
HISTORY: 1833 - GLO SURVEY CALLED AN 8" CEDAR AT 1.08 CHAINS WEST OF THE CORNER OF SECTIONS 20, 21, 28 & 29.
FIELD SEARCH: ON 12-12-01 WE FOUND A 36" LIVE CEDAR TREE WITH EVIDENCE OF 2 OVERGROWN NOTCHES ON BOTH THE EAST AND WEST SIDES. WE CUT OUT ONE OF THE NOTCHES ON THE WEST SIDE AND FOUND OVER 100 YEARS OF OVERGROWTH. THE RINGS WERE VERY TIGHT AND SO WE COULD NOT GET AN EXACT COUNT.
LINE TREE PERPETUATION: WE SET BEARING TREE TAGS ON EAST AND WEST SIDES.
FIELD BOOK 7037, PAGE 10, DATED 12-12-01.
(CORNER NOTES CONTINUED ON SHEET 3)

A SURVEY IN

SECTION 21, TOWNSHIP 34 NORTH, RANGE 5 EAST, W.M.
STATE OF WASHINGTON
DEPARTMENT OF NATURAL RESOURCES
LAND SURVEY SECTION-P.O. BOX 47060
OLYMPIA, WASHINGTON 98504-7060 (360)902/1206

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES
IN MAY 2002.
GARY S. HERRICK, PLS
CERTIFICATE NUMBER 31444

AUDITOR'S CERTIFICATE

FILED FOR RECORD THIS DAY OF 2002
AT M. IN BOOK OF SURVEYS AT PAGE
AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES.
AUDITOR'S FILE NUMBER SKAGIT COUNTY AUDITOR



SURVEYED BY: ERIC OLSEN, PLS
DRAWN BY: BRAD HAZLITT
DATE: SEPTEMBER 26, 2002

CHECKED BY: GARY HERRICK, PLS
SHEET 2 OF 3
F.M.# 1322

CORNER NOTES (CONTINUED FROM SHEET 2)
 (R19) CORNER OF SECTIONS 20, 21, 28, 29
 ACCEPTED CORNER

HISTORY:
 1947 - DNR CORNER RECORDS SHOW CORNER WAS A POST WITH TAGS AND 2 BEARING TREES (3).
 1972 - BPA R/W PLAT SHOWS CORNER WAS A 1" IRON PIPE (8).
 1976 - SURVEY BY RADER AND LEONARD & ASSOC. INC. SHOWS A 1" IRON PIPE WAS SET FROM 3 BEARING TREES (9).
 1998 - SURVEY BY AZIMUTH NORTHWEST, INC. SHOWS FINDING THE 1" IRON PIPE (11).

FIELD SEARCH:
 ON 12-5-01, WE FOUND THE 1" IRON PIPE WITH NYLON CAP MARKED 6702 (ACCEPTED). THE FOLLOWING GLO BEARING TREES WERE FOUND:
 A 30" LIVE HEMLOCK WITH VISIBLE SCORING AT N85E 18.5 LINKS - SET A BEARING TREE TAG (GLO CALLED 4" HEMLOCK N80E 18 LINKS).
 A 33" CEDAR STUMP WITH A LARGE NEWER "BT" (NOT GLO) SCRIBED ON IT AT S33W 14.5 LINKS - SET A BEARING TREE TAG (GLO CALLED 30" CEDAR S40W 16 LINKS).
 A 16" CEDAR SNAG WITH NO MARKS AT N57W 19 LINKS - SET A BT TAG (GLO CALLED 18" CEDAR N10W 18 LINKS).

CORNER PERPETUATION:
 WE REPLACED THE FOUND 1" IRON PIPE WITH A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 4" UP IN MOUND OF STONE. REFERENCES WERE ESTABLISHED AS FOLLOWS:
 A 25" FIR WITH DNR ALUMINUM TAG AT N40E 69.88 FEET TO AN ALUMINUM NAIL 2 FEET UP ON NW SIDE.
 A 36" CEDAR WITH DNR ALUMINUM TAG AT S21E 13.80 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON NE SIDE.
 A 21" CEDAR WITH DNR ALUMINUM TAG AT N75W 18.96 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON NE SIDE.
 A 23" CEDAR WITH DNR ALUMINUM TAG AT N22W 47.83 FEET TO AN ALUMINUM NAIL 2 1/2 FEET UP ON NE SIDE.
 SET ORANGE CARSONITE POST 1 FOOT EAST.
 FIELD BOOK 7037, PAGE 4, DATED 12-5-01.

(R11) 1/4 CORNER OF SECTIONS 21 & 28
 ACCEPTED CORNER

HISTORY:
 1947 - DNR CORNER RECORDS SHOW THE CORNER WAS A STAKE WITH A TAG AND 1 BEARING TREE. SAID CORNER RECORDS ALSO NOTE A LINE CROSSING POST 1 TALLY 65 PAGES SOUTH OF CORNER (3).
 1998 - SURVEY AND LAND CORNER RECORD BY AZIMUTH NORTHWEST, INC. SHOW FINDING A 2" IRON PIPE WITH NO BEARING TREES AT S46W 172.5 FEET FROM THEIR CALCULATED POSITION AND NOTE THAT IT DOESN'T FIT GLO CALLS TO THE EAST OR WEST. THEY REJECTED THE PIPE AND SET A REBAR AND ALUMINUM CAP AT THE CALCULATED MIDPOINT POSITION (10, 11).

FIELD SEARCH:
 ON 5-2-02 WE FOUND THE 2" IRON PIPE NOTED BY AZIMUTH NORTHWEST AND AGREE THAT IT DOESN'T FIT THE NEARBY GLO CALLS. A LINE CROSSING POST WAS FOUND ON THE ROAD, SOUTH OF THE MIDPOINT POSITION. NO TAG OR BEARING TREE EVIDENCE WAS FOUND AT EITHER THE PIPE POSITION OR AT 1 TALLY 65 PAGES NORTH OF THE LINE CROSSING POST. A PIPE WAS NOT NOTED ON THE 1947 DNR CORNER RECORDS. THIS SURVEY REJECTS THE PIPE POSITION AND ACCEPTS THE AZIMUTH NORTHWEST ALUMINUM CAP FOUND NEAR THE MIDPOINT POSITION.

CORNER PERPETUATION:
 FROM THE ACCEPTED ALUMINUM CAP, REFERENCES WERE ESTABLISHED AS FOLLOWS:
 A 59" FIR STUMP WITH DNR ALUMINUM TAG AT N17E 43.23 FEET TO A STEEL NAIL 1 FOOT UP ON NW SIDE.
 A 20" FIR WITH DNR ALUMINUM TAG AT S17E 22.08 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON SW SIDE.
 AN 8" HEMLOCK WITH DNR ALUMINUM TAG AT S89W 51.75 FEET TO AN ALUMINUM NAIL 1 FOOT UP ON SOUTH SIDE.
 A 46" CEDAR STUMP WITH DNR ALUMINUM TAG AT N33W 21.99 FEET TO A STEEL NAIL 2 FEET UP ON SW SIDE.
 SET ORANGE CARSONITE POST 1 FOOT SOUTH.
 FIELD BOOK 7037A, PAGE 30, DATED 5-2-02.

(R13) CORNER OF SECTIONS 21, 22, 27, 28
 ACCEPTED CORNER

HISTORY:
 1947 - DNR CORNER RECORDS SHOW THE CORNER WAS A PIPE WITH A TAG (3).
 1998 - SURVEY AND LAND CORNER RECORD BY AZIMUTH NORTHWEST, INC. SHOWS A 2" IRON PIPE AND A HEMLOCK STUMP ROTTED DOWN AT THE NW BEARING TREE POSITION. THEY ACCEPTED THE IRON PIPE (10, 11).

AUDITOR'S CERTIFICATE

FILED FOR RECORD THIS DAY OF 2002
 AT M. IN BOOK OF SURVEYS AT PAGE
 AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES.

AUDITOR'S FILE NUMBER SKAGIT COUNTY AUDITOR

FIELD SEARCH:
 ON 3-13-02 WE FOUND THE 2" IRON PIPE (ACCEPTED). THE HEMLOCK STUMP NOTED BY AZIMUTH NORTHWEST APPEARS TO BE A CEDAR STUMP WITH NO MARKS. WE ALSO FOUND A 20" CEDAR STUMP AT NORTH 42.9 FEET WITH OVERGROWN LINE BLAZES ON THE SOUTH AND NORTH SIDES (PROBABLY NOT GLO).

CORNER PERPETUATION:
 WE REPLACED THE FOUND 2" IRON PIPE WITH A DNR ALUMINUM MONUMENT MARKED WITH IDENTIFICATION, 8" UP IN MOUND OF STONE. REFERENCES WERE ESTABLISHED AS FOLLOWS:
 A 42" CEDAR STUMP WITH DNR ALUMINUM TAG AT N14E 57.99 FEET TO A STEEL NAIL 2 FEET UP ON NW SIDE.
 A 32" CEDAR STUMP WITH DNR ALUMINUM TAG AT S64E 80.39 FEET TO A STEEL NAIL 2 FEET UP ON SW SIDE.
 A 42" CEDAR STUMP WITH DNR ALUMINUM TAG AT S40W 26.59 FEET TO A STEEL NAIL 3 FEET UP ON SE SIDE.
 A 21" CEDAR STUMP WITH DNR ALUMINUM TAG AT N39W 24.26 FEET TO A STEEL NAIL 1 FOOT UP ON NE SIDE.
 SET ORANGE CARSONITE POST 1 FOOT EAST.
 FIELD BOOK 7037, PAGE 75, DATED 3-13-02.


SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES
 IN MAY 2002.

GARY S. HERRICK, PLS

CERTIFICATE NUMBER 31444

10-8-02

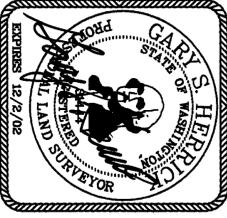

SURVEYED BY: ERIC OLSEN, PLS
 DRAWN BY: BRAD HAZLITT
 DATE: SEPTEMBER 26, 2002

SECTION 21, TOWNSHIP 34 NORTH, RANGE 5 EAST, W.M.
 STATE OF WASHINGTON
 DEPARTMENT OF NATURAL RESOURCES
 LAND SURVEY SECTION-P.O. BOX 47060
 OLYMPIA, WASHINGTON 98504-7060 (360)902/1206

CHECKED BY: GARY HERRICK, PLS
 SHEET 3 OF 3
 F.M.# 1322

"DOEBERRY" PROJECT GPS DIAGRAM

200210150109
 Skagit County Auditor
 10/15/2002 Page 3 of 3 11:08AM

HARR K 61

NOT TO SCALE

