


FOR
 RECORD OF SURVEY
 LONGVIEW FIBRE COMPANY
 IN THE NE 1/4 AND THE NW 1/4 OF
 SECTION 15, T 34 N, R 5 E, W.M.
 SKAGIT COUNTY, WASHINGTON
 SEPTEMBER 1, 2005

LONGVIEW FIBRE COMPANY
 AFN. 9411070066

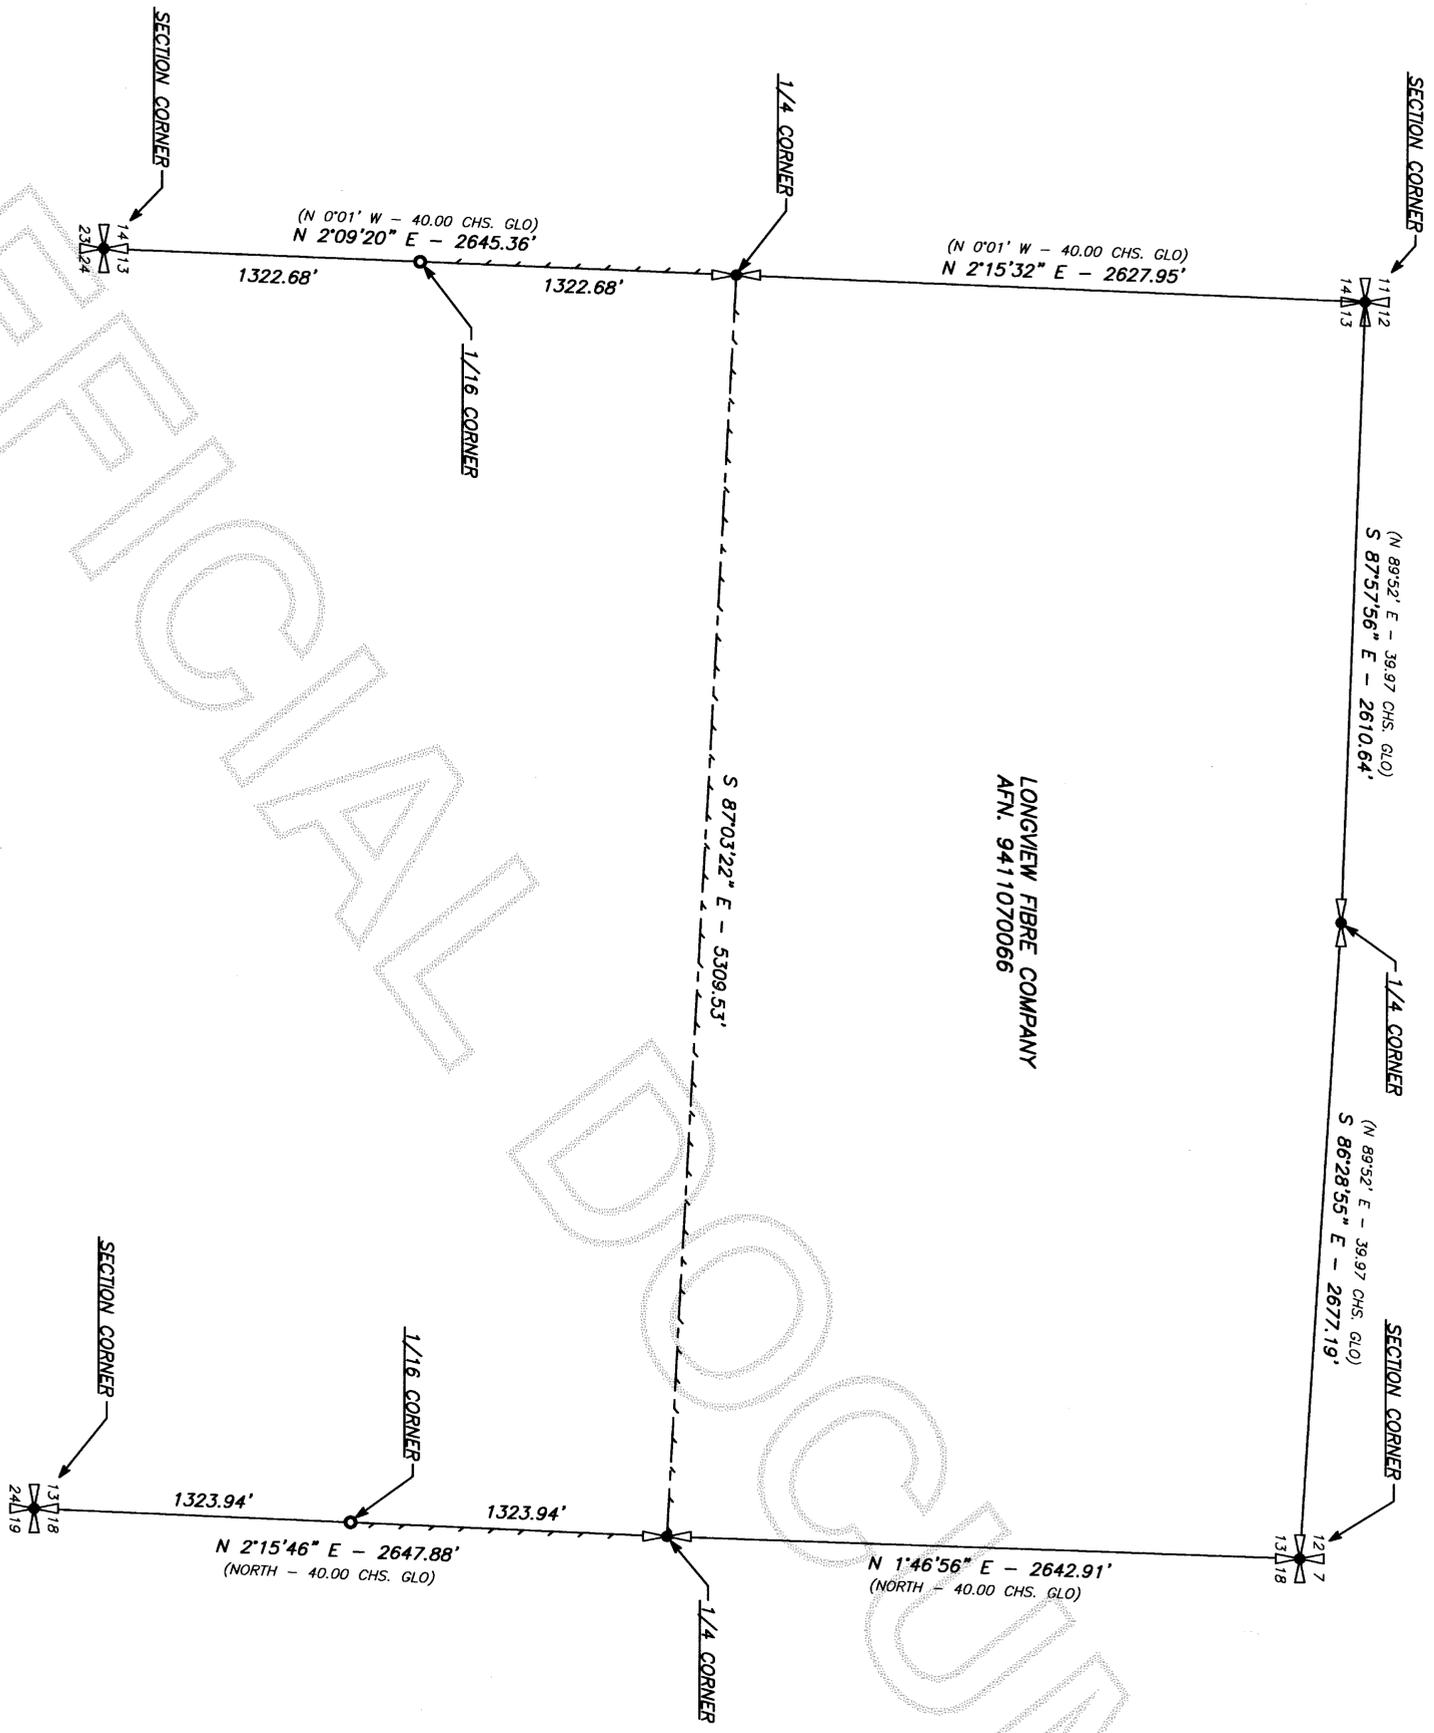

BASIS OF BEARING
 BEARINGS ARE STATE PLANE
 NAD 83(91) WASHINGTON NORTH,
 BASED ON GPS OBSERVATION AT
 LAT: 48°25'46"
 LONG: 122°07'03"
 CONVERGENCE: -0°57'22"

SCALE: 1 INCH = 500 FEET

DISTANCES SHOWN ARE GRID WITH
 A COMBINED SCALE FACTOR OF 0.9997898
 TO CONVERT TO GROUND DISTANCE SCALE
 MAP DISTANCE BY A FACTOR OF 1.0002102

AUDITOR'S CERTIFICATE
 FILED FOR RECORD THIS 14 DAY OF November 2005
 AT 11:34 AM IN BOOK _____ OF SURVEYS AT PAGE _____
 AT THE REQUEST OF LONGVIEW FIBRE COMPANY.

200511140233
 Auditor
 N Baunmett by
 COUNTY AUDITOR
 Gregory Swind

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR
 UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS
 OF THE SURVEY RECORDING ACT AT THE REQUEST OF LONGVIEW
 FIBRE COMPANY IN JUNE 2005.

GEORGE J. FORD, PLS
 CERTIFICATE NO. 22330





LONGVIEW FIBRE COMPANY
 LONGVIEW, WA 98632

LEGEND
 SECTION CORNER, 1/4 CORNER, AS NOTED
 FOUND MONUMENT, AS NOTED
 SET 3/4" X 3/6" PIPE WITH STAMPED 2" BRASS
 CAP AS SHOWN
 RECORD OF SURVEY
 AUDITOR'S FILE NUMBER
 RECORD BEARING AND/OR DISTANCE AS NOTED
 ()
 AFN
 ROS
 LINE MARKED WITH 1/2" X 60" FIBER GLASS RODS,
 RED AND WHITE FLAGGING ALONG LINE BETWEEN RODS,
 TREES ALONG LINE PAINTED WITH BLUE PAINT.

NOTE: NEW REFERENCES HAVE AN 8" SPIKE AT BASE OF SCRIBE WITH LONGVIEW
 FIBRE COMPANY LOCATION TAG ABOVE SCRIBE. ALL ORIENTED TOWARD MONUMENT.
 DISTANCES MEASURED TO SPIKE. BEARINGS TO REFERENCES TAKEN WITH HAND
 COMPASS HAVING A DECLINATION OF 21° EAST.

**LONGVIEW FIBRE COMPANY
 RECORD OF SURVEY
 FOR
 SECTION 15, T 34 N, R 5 E, W.M.
 SKAGIT COUNTY, WASHINGTON**



SEPTEMBER 1, 2005

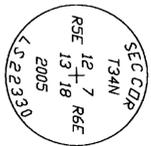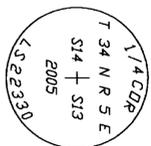

SECTION CORNER
 SET 3/4" PIPE WITH
 2" BRASS CAP
 FOUND REFERENCES:
 50' HEMLOCK STUMP N63E AT 21.1'
 GLO NOTES 50' HEMLOCK N60E AT 32 LKS
 24" STUMP S33E AT 36.9'
 VISIBLE SCRIBE, GLO NOTES
 24" LARCH S40E AT 71LKS
 BADLY DECAYED STUMP N39W AT 20.9'
 FOUND REMAINTS OF AXING AND SCRIBE
 IN DEBRIS, GLO NOTE
 20" HEMLOCK N40.3 AT 31 LKS
 NEW REFERENCES:
 9" HEMLOCK S8E AT 12.32'
 SCRIBED [T34N R5E S13 BT]
 6" HEMLOCK S68W AT 16.52'
 SCRIBED [T34N R5E S14 BT]
 18" HEMLOCK N32W AT 6.85'
 SCRIBED [T34N R5E S11 BT]
 11" HEMLOCK N30E AT 19.82'
 SCRIBED [T34N R12E S12 BT]


1/4 CORNER
 SET 3/4" PIPE WITH
 2" BRASS CAP
 FOUND REFERENCES:
 72" CEDAR STUMP S45E AT 11.2'
 VISIBLE AXING, NO SCRIBE, OLD RUSTED
 TAG, GLO NOTES
 72" CEDAR S45E AT 17 LKS
 BEARING TREE IN NORTH EAST QUADRANT
 TO BADLY DECAYED TO DETERMINE CENTER
 NEW REFERENCES:
 16" HEMLOCK S23E AT 19.50'
 SCRIBED [1/4 S13 BT]
 9" W. FIR N23E AT 9.54'
 SCRIBED [1/4 S12 BT]
 16" W. FIR N81W AT 21.35'
 SCRIBED [1/4 S12 BT]
 3"x3" CEDAR POST 5' TALL
 NORTH AT 1.0'

SECTION CORNER
 FOUND 1-1/2" PIPE
 SET 3/4" PIPE WITH
 2" BRASS CAP IN
 FOUND PIPE
 FOUND REFERENCES:
 50" HEMLOCK STUMP N20W AT 36.4'
 WITH VISIBLE SCRIBE, GLO NOTES
 50" HEMLOCK N19W AT 54 LKS (35.6')
 36" HEMLOCK SWIG S27E AT 40.6'
 WITH VISIBLE AXING AND SCRIBE, GLO NOTES
 50" HEMLOCK S33E AT 66 LKS (43.6')
 REMAINS OF STUMP S29W AT 64.1'
 GLO NOTES 44" LARCH S72W AT 100 LKS (66.0')
 NEW REFERENCES:
 23" T.FIR S47E AT 68.88'
 SCRIBED [T34N R6E S18 BT]
 29" DOUBLE T.FIR N32W AT 67.53'
 SCRIBED [T34N R5E S12 BT]
 STEEL FENCE POST
 NORTH AT 2.0'

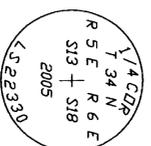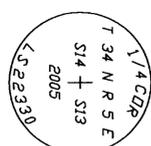

1/4 CORNER
 SET 3/4" PIPE WITH
 2" BRASS CAP
 FOUND REFERENCES:
 72" HEMLOCK S55W AT 12.9'
 VISIBLE SCRIBE, GLO NOTES
 72" HEMLOCK S50W AT 15 LKS
 BADLY DECAYED STUMP, NO MARKS FOUND
 N32E AT 15.1', GLO NOTES
 16" LARCH N30E AT 23 LKS
 NEW REFERENCES:
 12" W. FIR N45E AT 7.1'
 SCRIBED [1/4 S13 BT]
 13" W. FIR S4E AT 18.13'
 SCRIBED [1/4 S13 BT]
 10" W. FIR S48W AT 1.25'
 SCRIBED [1/4 S14 BT]
 STEEL FENCE POST
 SOUTH AT 1.0'

1/4 CORNER
 FOUND 1-1/2" PIPE
 SET 3/4" PIPE WITH
 2" BRASS CAP IN PIPE
 FOUND REFERENCES:
 18" STUMP S34W AT 12.8'
 GOVERNMENT SURVEY MARKER DATED 6/9/83
 TAG NOTES N45E AT 11.9', VISIBLE SCRIBE
 44" STUMP S53E AT 9.9'
 GLO NOTES 44" LARCH S59E AT 17 LKS (11.2')
 NEW REFERENCES:
 17" W. FIR N55W AT 11.36'
 SCRIBED [1/4 S13 BT]
 13" W. FIR N80E AT 16.37'
 SCRIBED [1/4 S18 BT]
 17" W. FIR N20E AT 13.35'
 SCRIBED [1/4 S18 BT]
 STEEL FENCE POST
 SOUTH AT 1.0'

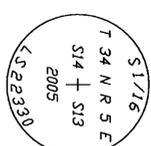

1/16 CORNER
 SET 3/4" PIPE WITH
 2" BRASS CAP
 NEW REFERENCES:
 12" HEMLOCK S58E AT 8.72'
 SCRIBED [1/16 S14 BT]
 19" W. FIR N32E AT 16.95'
 SCRIBED [1/16 S14 BT]
 STEEL FENCE POST
 EAST AT 1.0'

1/16 CORNER
 SET 3/4" PIPE WITH
 2" BRASS CAP
 NEW REFERENCES:
 9" HEMLOCK S66W AT 17.41'
 SCRIBED [1/16 S13 BT]
 21" W. FIR S68E AT 12.75'
 SCRIBED [1/16 S18 BT]
 STEEL FENCE POST
 EAST AT 5.0'



SECTION CORNER
 FOUND 4"x4" CONCRETE
 MONUMENT WITH 3" BRASS CAP
 FOUND REFERENCES:
 30" HEMLOCK STUMP N52E AT 12.62 TO FACE
 GLO NOTED 24" LARCH N52E AT 18 LKS (11.9)
 WITH VISIBLE SCRIBE
 26" HEMLOCK STUMP S71W AT 22.22 TO FACE
 GLO NOTES 20" LARCH S62W AT 34 LKS (22.4)
 WITH VISIBLE AXING
 NEW REFERENCES:
 9" T. FIR S20W AT 8.08'
 SCRIBED [T34N R5E S23 BT]
 9" T. FIR N38W AT 10.00'
 SCRIBED [T34N R5E S14 BT]
 13" T. FIR N4E AT 2.62'
 SCRIBED [T34N R5E S13 BT]
 9" T. FIR N80W AT 12.08'
 SCRIBED [T34N R5E S14 BT]

SECTION CORNER
 FOUND 4"x4" CONCRETE
 MONUMENT WITH 3" BRASS CAP
 FOUND REFERENCES:
 20" HEMLOCK N88E AT 20.7'
 GLO NOTES 14" HEMLOCK N65E AT 31 LKS (20.5)
 SCRIBE VISIBLE DNR TAG DATED 9-11-68
 22" HEMLOCK S57E AT 7.2'
 GLO NOTES 10" HEMLOCK S57E AT 11 LKS
 VISIBLE SCRIBE
 26" HEMLOCK S65W AT 11.2'
 GLO NOTES 14" HEMLOCK S65W AT 17 LKS
 HEALED SCAR
 12" HEMLOCK S44W AT 9.0'
 SCRIBE VISIBLE, DNR TAG DATED 9-11-68
 9" T. FIR S40E AT 12.6'
 SCRIBE VISIBLE, DNR TAG DATED 9-11-68

NARRATIVE

THE PURPOSE OF THIS SURVEY WAS TO MARK THE PROPERTY LINE OF LONGVIEW FIBRE COMPANY. THE CONTROLLING CORNERS WERE ALL BASED ON EXISTING MONUMENTS OR ORIGINAL GOVERNMENT LAND OFFICE REFERENCES. THE 1-1/2" PIPES FOUND AT THE NORTHEAST CORNER AND EAST 1/4 CORNER WERE ACCEPTED. THESE PIPES WERE NOTED ON DNR CORNER RECORDS IN 1958. THE BEARING TREES HAVE DECAYED TO THE EXTENT THAT IT IS DIFFICULT TO ASCERTAIN WHERE THE GLO DISTANCES WERE MEASURED FROM. I BELIEVE THE PIPES WERE BASED ON MORE RELIABLE STUMP PATTERNS. THE PROJECT CONTROL WAS ESTABLISHED WITH LEICA GPS 1200 RECEIVERS. TRAVERSING WAS DONE WITH A LEICA TC1105.

AUDITOR'S CERTIFICATE

FILED FOR RECORD THIS _____ DAY OF _____, 2005
 AT _____ M IN BOOK _____ OF SURVEYS AT PAGE _____
 AT THE REQUEST OF LONGVIEW FIBRE COMPANY.

AUDITOR'S FILE NUMBER _____ COUNTY AUDITOR _____

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF LONGVIEW FIBRE COMPANY IN JUNE 2005.

GEORGE J. FORD, PLS
 CERTIFICATE NO. 22330

LONGVIEW FIBRE COMPANY
 LONGVIEW, WA 98632

