



SHEET INDEX
 SHEET 1: SECTION 7
 SHEET 2: SECTION 8
 SHEET 3: NARRATIVE AND MONUMENT DESCRIPTIONS

BASIS OF BEARING: NAD 83/91, WASHINGTON STATE PLANE COORDINATE SYSTEM, NORTH ZONE, US SURVEY FEET, N00°46'44" E ALONG THE EAST LINE OF THE NE QUARTER OF SECTION 7 BETWEEN MONUMENTS FOUND AS NOTED.
 CONVERGENCE ANGLE: -00°55'22"
 DISTANCES SHOWN HEREON ARE GROUND
 COMBINED SCALE FACTOR=0.99981812733
 TO CONVERT TO GRID MULTIPLY BY THE COMBINED SCALE FACTOR (0.96 FEET PER MILE/0.018 FEET PER 100 FEET)

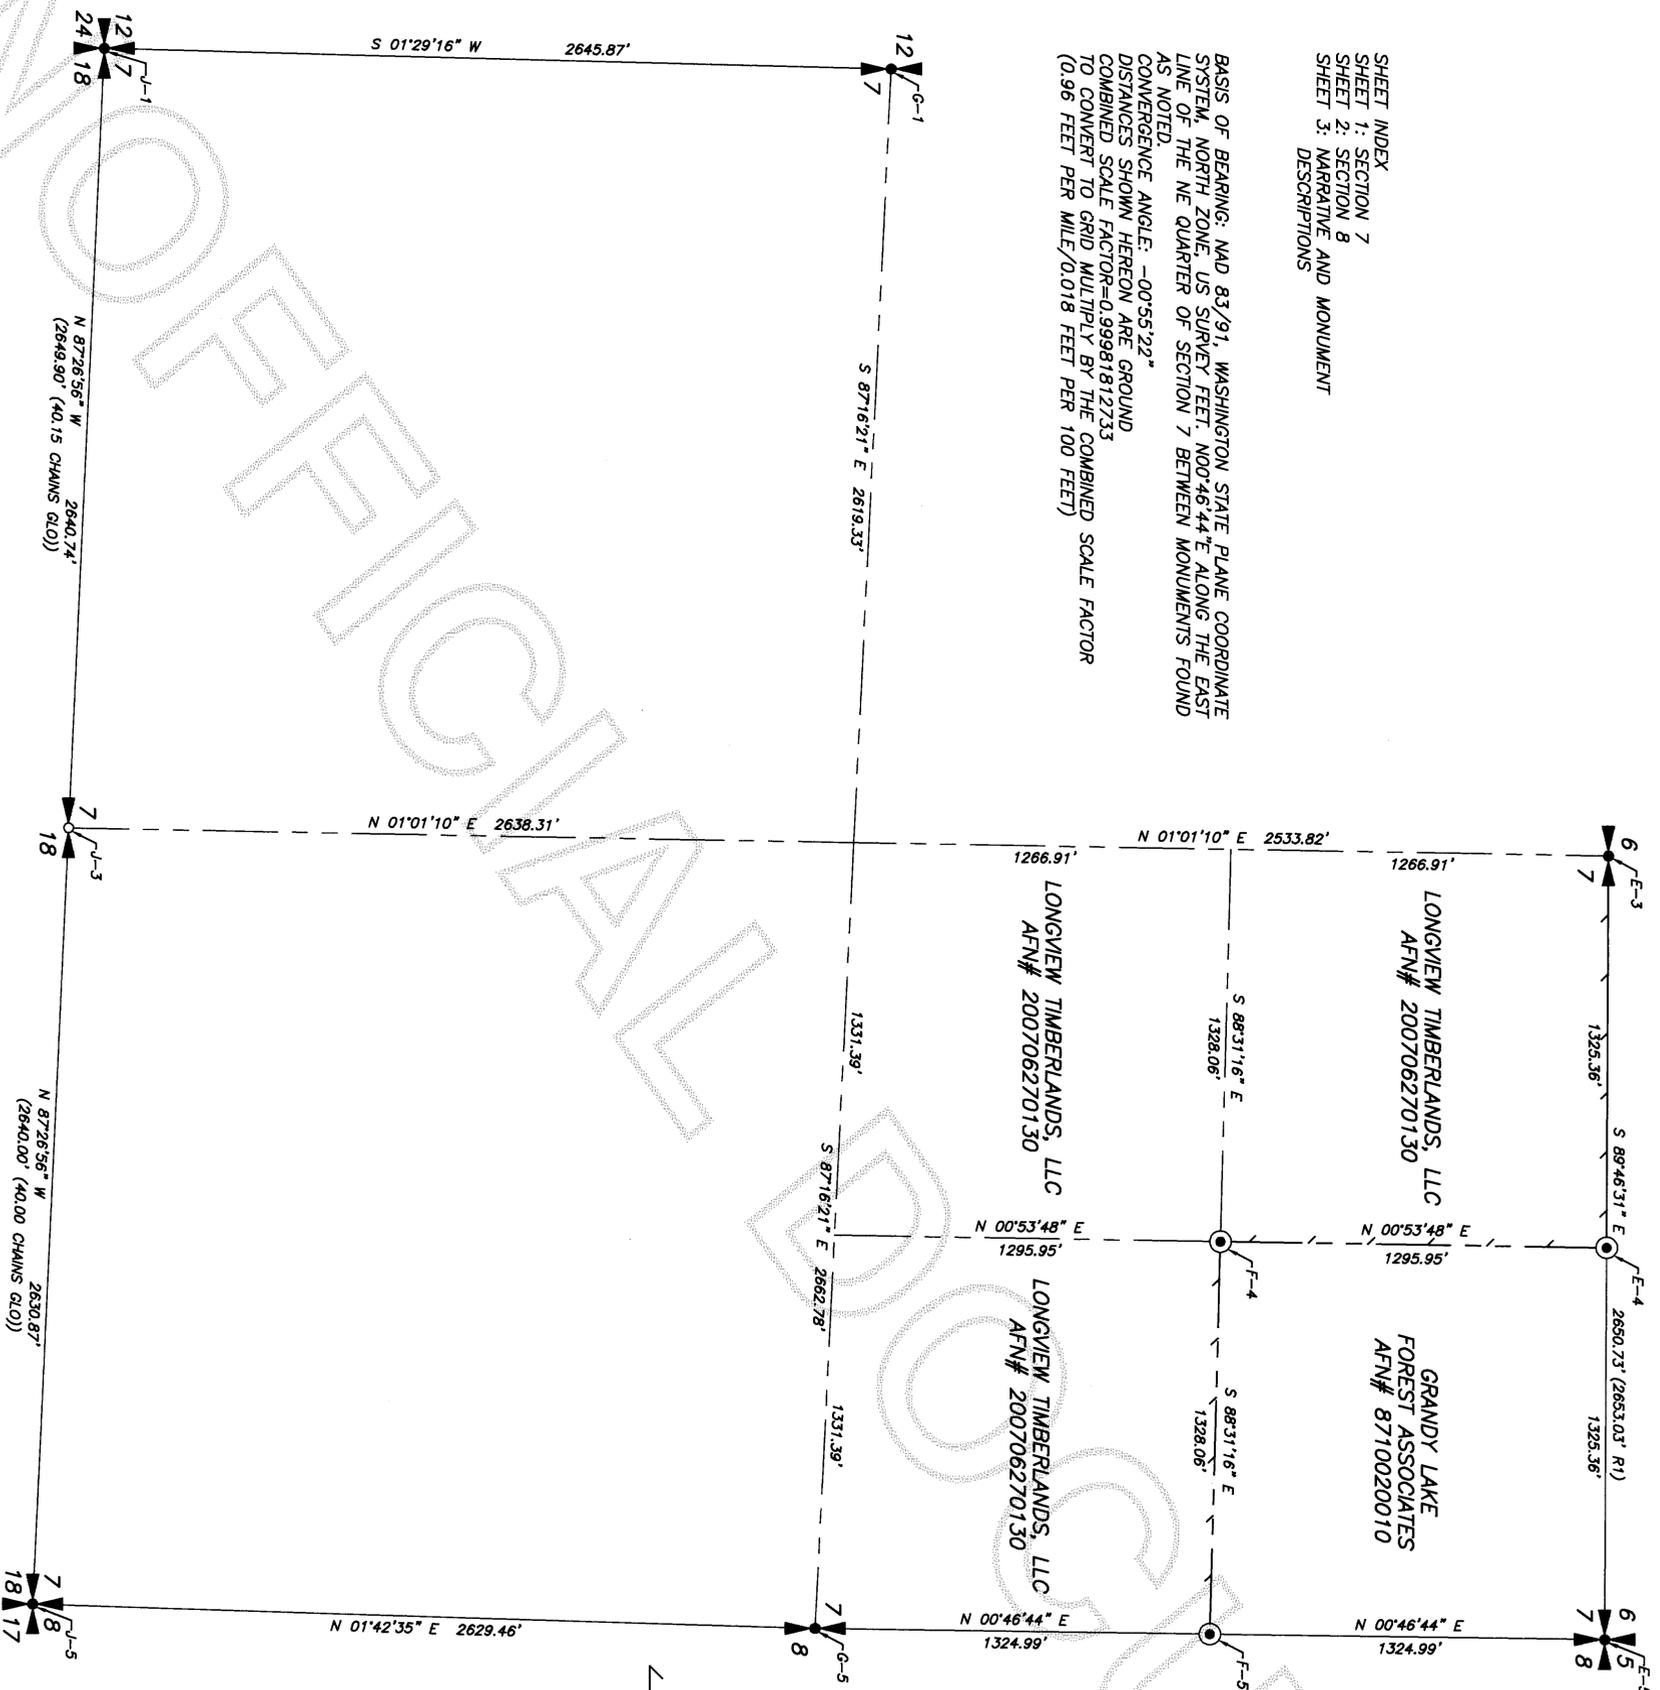

200909150038
 Skagit County Auditor
 9/15/2009 Page 1 of 3 3:10:16AM

RECORD OF SURVEY
 IN A PORTION OF THE
 NE 1/4 OF THE NE 1/4 OF
 SECTION 7 AND THE NW 1/4
 OF THE NW 1/4 OF SECTION 8,
 T34N, R6E, W.M.,
 SKAGIT COUNTY, WASHINGTON
 SHEET 1 OF 3

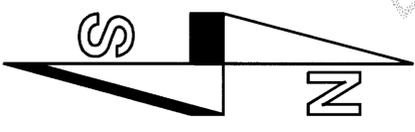

- LEGEND:**
- INDICATES MONUMENT FOUND AS NOTED
 - INDICATES 5/8" x 36" IRON REBAR WITH YELLOW PLASTIC CAP INSCRIBED "SIMES 44648" SET
 - (R1) INDICATES RECORD INFORMATION PER SURVEY REFERENCE NUMBER
 - INDICATES LINE MARKED WITH 1/2" x 72" FIBER GLASS RODS WITH RED AND WHITE RIBBON. TREES ALONG LINE PAINTED WITH BLUE PAINT.
 - J-1 INDICATES DEPARTMENT OF NATURAL RESOURCES CORNER CODE. SEE SHEET 3
 - AF NO. INDICATES AUDITOR'S FILE NUMBER

- SURVEY REFERENCE:**
- 1) DEMEYER SURVEY, AF NO. 9108020007
 - 2) DEMEYER SURVEY, AF NO. 9211180032
 - 3) FORD SURVEY, AF NO. 200511140233
 - 4) FORD SURVEY, AF NO. 200810310013
 - 5) PETERSON SURVEY, AF NO. 200808220074
 - 6) GLO PLAT AND NOTES FOR T34N, R6E, CONTRACT NO. 562, APPROVED 1901

DEED REFERENCE:
 GRANTOR: LONGVIEW FIBRE COMPANY
 GRANTEE: LONGVIEW TIMBERLANDS, LLC
 AF NO. 200706270130



SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF LONGVIEW TIMBERLANDS, LLC IN JUNE, 2009.

Jason L. Simes
 JASON L. SIMES, PROFESSIONAL LAND SURVEYOR, LS# 44648

AUDITOR'S CERTIFICATE
 FILED FOR RECORD THIS 15 DAY OF September 2009 AT
 15:16 P.M. IN BOOK OF SURVEYS AT PAGE
 AT THE REQUEST OF LONGVIEW TIMBER CORPORATION.
Shangquist
 DEPUTY COUNTY AUDITOR

LONGVIEW TIMBER CORP.
 10 INTERNATIONAL WAY
 LONGVIEW, WA 98632

200909150038
Skagit County Auditor


9/15/2009 Page 3 of 3 3:10:16AM

RECORD OF SURVEY


IN A PORTION OF THE
NE 1/4 OF THE NE 1/4 OF
SECTION 7 AND THE NW 1/4
OF THE NW 1/4 OF SECTION 8,
T34N, R6E, W.M.,
SKAGIT COUNTY, WASHINGTON
SHEET 3 OF 3

NARRATIVE:
THE PURPOSE OF THIS SURVEY WAS TO MONUMENT THE NE QUARTER OF SECTION 7, THE NW QUARTER OF THE NW QUARTER OF SECTION 8, MARK THE NORTH LINE OF THE NW QUARTER OF SECTION 7, THE WEST AND SOUTH LINES OF THE NE QUARTER OF SECTION 7 AND THE SOUTH LINE OF THE NW QUARTER OF SECTION 8. I USED LEICA 1200 GPS RECEIVERS FOR A STATIC CONTROL NETWORK USING CORPS DATA CONstrained TO POINTS "75E1", "5E1", "WH06" AND "R176". I SET POINTS NEAR THE EAST, WEST AND NORTH QUARTER CORNERS OF SECTION 7 AND NEAR THE NW 1/16 CORNER OF SECTION 8. I DIRECT TIED THE NE, SE AND SW CORNERS OF SECTION 7 WITH IRK. I THEN USED A LEICA TOR 1203 TOTAL STATION TO RUN A RANDOM CLOSED TRAVERSE LOOP FROM SAID STATIC CONTROL NEAR THE NORTH QUARTER CORNER OF SECTION 7, EAST ALONG THE NORTH LINE OF SECTION 7 TO THE EAST 1/16th CORNER OF SECTION 7, SOUTH TO THE NE 1/16th CORNER, EAST TO THE NORTH 1/16th CORNER BETWEEN SECTIONS 7 AND 8, CONTINUED EAST TO THE NW 1/16th CORNER OF SECTION 8 AND NORTH TO THE WEST 1/16th CORNER OF SECTION 8 AND CLOSED WITHIN THE REQUIREMENTS AS STATED IN WAC 352-130-090. THE WORK SHOWN HEREON WAS DONE BETWEEN JUNE AND AUGUST OF 2009.


FOUND AND SET MONUMENT DESCRIPTIONS:

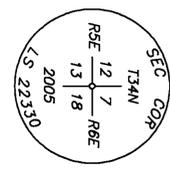


SECTION CORNER (4-1):
FOUND AND HELD 2" BRASS CAP INSIDE 1 1/2" IRON PIPE STAMPED AS SHOWN WITH THE FOLLOWING EXISTING REFERENCES:
-(OBJ) 50' HEMLOCK STUMP WITH VISIBLE SCRIBING N20W 38.4'
-(OBJ) 36' HEMLOCK SWAG WITH VISIBLE AXING AND SCRIBING S27E 40.6'
-(OBJ) REMAINS OF LARCH STUMP S79W 64.1'
-23' FIR SCRIBED [T34N R6E S18 BT] S47E 68.98'
-STEEL FENCE POST NORTH AT 2.0'
SEE SURVEY REFERENCES 3 & 4

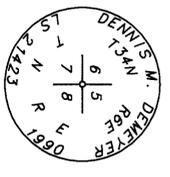


SECTION CORNER (4-2):
FOUND AND HELD 2 1/2" ALUMINUM CAP STAMPED AS SHOWN IN 1 1/4" IRON PIPE WITH THE FOLLOWING EXISTING REFERENCES:
-(OBJ) 24' CEDAR SWAG WITH VISIBLE SCRIBING N69W 22.2' (ADDED TAG)
-(OBJ) 12' HEMLOCK STUMP BADLY DECAYED W/ FACE AND TAG DATED 12-19-80 N74E 23.3'
-12-19-80 N74E 23.3'
-6' CEDAR W/3 NOTCHES AND SPIKE NOTE 15.09
-9' HEMLOCK SCRIBED [T34N R6E S5 BT] N63E 10.30'
-11' HEMLOCK SCRIBED [T34N R6E S8 BT] S65E 12.78'
-6' STEEL FENCE POST WEST AT 1.0'
SEE SURVEY REFERENCE NO. 1 & 2

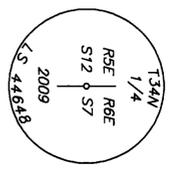


QUARTER CORNER (4-3):
FOUND AND HELD 1 1/2" IRON PIPE WITH REMAINS OF ORIGINAL GLO POST LAYING ALONG SIDE WITH THE FOLLOWING EXISTING REFERENCES:
-48' CEDAR STUMP S17E 32.2' TO FACE
-40' HEMLOCK STUMP N71E 17.6' TO FACE
REPLACED 1 1/2" IRON PIPE WITH 3/4" X 30" IRON PIPE WITH 2" BRASS CAP STAMPED AS SHOWN WITH THE FOLLOWING NEW REFERENCES:
-10' FIR SCRIBED [1/4 S12 BT] S49W 19.79'
-15' FIR SCRIBED [1/4 S12 BT] N41E 8.55'
-6' STEEL FENCE POST SOUTH AT 2.0'

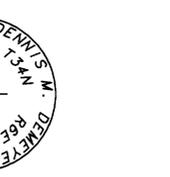


QUARTER CORNER (4-4):
FOUND AND HELD 1 1/2" IRON PIPE WITH 2" ALUMINUM CAP STAMPED AS SHOWN EXPOSED 1.8' WITH THE FOLLOWING EXISTING REFERENCES:
-36' HEMLOCK WITH VISIBLE SCRIBING AND TAG N36W 13.0' TO FACE
-24' HEMLOCK STUMP WITH OLD FACE AND TAG N66E 20.0'
-20' HEMLOCK WITH TAG S22E 19.7'
-DEMAYER CARSONITE POST ALONG WEST SIDE
SEE LAND CORNER RECORD UNDER AUDITOR'S FILE NO. 9210210006
SEE SURVEY REFERENCES 2 & 5

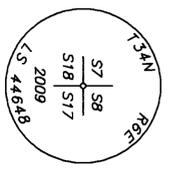

SECTION CORNER (4-5):
FOUND AND HELD 1 1/2" IRON PIPE WITH REMAINS OF ORIGINAL GLO POST LAYING ALONG SIDE WITH THE FOLLOWING EXISTING REFERENCES:
-(OBJ) 19' LARCH STUMP WITH VISIBLE SCRIBING AND TAG DATED 7-24-84 S21E 4.4' ON TAG, MEASURED 5.0' TO FACE
-(OBJ) 45' HEMLOCK STUMP W/ FACE AND TAG DATED 7-24-84 N64E 12.11' TO FACE
-(OBJ) 36' HEMLOCK STUMP WITH VISIBLE SCRIBING AND TAG DATED 10-3-86 N26W 9.20' TO FACE
-(OBJ) 13' HEMLOCK STUMP W/ FACE AND TAG DATED 10-3-86 S80.5W 11.20' TO FACE
DROVE 3/4" X 30" IRON PIPE WITH 2" BRASS CAP STAMPED AS SHOWN INSIDE 1 1/2" IRON PIPE.
ADDED 6" STEEL FENCE POST WEST AT 1.0'

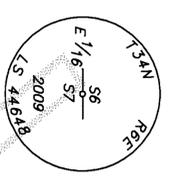


EAST 1/16th CORNER (4-6):
SET 5/8" X 30" IRON REBAR WITH 2" ALUMINUM CAP STAMPED AS SHOWN WITH THE FOLLOWING REFERENCES:
-12" HEMLOCK SCRIBED [1/16 S7 BT] S37W 9.76'
-12" FIR SCRIBED [1/16 S6 BT] N48E 6.20'
-6" STEEL FENCE POST SOUTH AT 1.0'
SEE SURVEY REFERENCE NO. 1

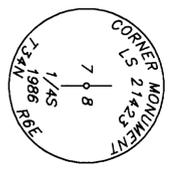


QUARTER CORNER (4-7):
FOUND AND HELD 1" IRON PIPE WITH 2 1/2" ALUMINUM CAP STAMPED AS SHOWN EXPOSED 0.4' WITH THE FOLLOWING EXISTING REFERENCES:
-(OBJ) 26' CEDAR WITH VISIBLE SCRIBING AND TAG DATED 5-13-86 S32W 24.4'
-16' FIR W/HEALED FACE AND TAG DATED 5-13-86 S52W 15.5'
-14' FIR WITH FACE AND TAG GROWN OVER N38W 8.3'
ADDED 6" STEEL FENCE POST NORTH AT 1.0'
SEE LAND CORNER RECORD UNDER AUDITOR'S FILE NO. 8606190034



NE 1/16th CORNER (4-8):
SET 5/8" X 30" IRON REBAR WITH 2" ALUMINUM CAP STAMPED AS SHOWN WITH THE FOLLOWING REFERENCES:
-15" HEMLOCK SCRIBED [1/16 S7 BT] N81W 7.76'
-17" HEMLOCK SCRIBED [1/16 S7 BT] N08W 8.00'
-6" STEEL FENCE POST NORTH AT 1.0'

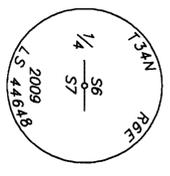


QUARTER CORNER (4-9):
FOUND AND HELD 1 1/2" IRON PIPE WITH FITTING EXPOSED 1.0' WITH THE FOLLOWING EXISTING REFERENCES:
-12" HEMLOCK W/TAG NO DATE N19E 7.3'
-12" HEMLOCK W/OLD TAG NO DATE S76E 3.2' TO FACE
-8' PINE W/TAG NO DATE S28W 5.2' TO FACE
REPLACED 1 1/2" IRON PIPE WITH 3/4" X 30" IRON PIPE WITH 2" BRASS CAP STAMPED AS SHOWN
ADDED 6" STEEL FENCE POST NORTH AT 1.0'
SEE SURVEY REFERENCE NO. 1

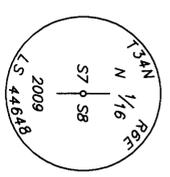

NORTH 1/16th CORNER (4-10):
SET 5/8" X 30" IRON REBAR WITH 2" ALUMINUM CAP STAMPED AS SHOWN WITH THE FOLLOWING REFERENCES:
-12" HEMLOCK SCRIBED [1/16 S7 BT] N03W 7.90'
-9' FIR SCRIBED [1/16 S8 BT] N71E 9.63'
-6" STEEL FENCE POST NORTH AT 1.0'



QUARTER CORNER (4-11):
FOUND AND HELD 1 1/2" IRON PIPE WITH 2 1/2" ALUMINUM CAP STAMPED AS SHOWN EXPOSED 0.4' WITH OLD 1 1/2" IRON PIPE LAYING ON SHOWN WITH THE FOLLOWING EXISTING REFERENCES:
-22" HEMLOCK W/NORTHWEST SURVEYING TAG DATED 3-26-81, N32E 27.8' TO FACE
-16" HEMLOCK W/NORTHWEST SURVEYING TAG DATED 3-26-81, N20E 32.25' TO FACE
-35" HEMLOCK W/OLD FACE, N12W 32.10' (ADDED NEW TAG)
-(OBJ) ROTTEN HEMLOCK SWAG W/OLD FACE N05E 21.80'
SEE LAND CORNER RECORD UNDER AUDITOR'S FILE NO. 9211180033
SEE SURVEY REFERENCE NO. 2

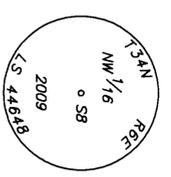


NW 1/16th CORNER (4-12):
SET 5/8" X 30" IRON REBAR WITH 2" ALUMINUM CAP STAMPED AS SHOWN WITH THE FOLLOWING REFERENCES:
-13" FIR SCRIBED [1/16 S8 BT] N10E 5.43'
-18" FIR SCRIBED [1/16 S8 BT] N80W 4.83'
-6" STEEL FENCE POST NORTH AT 1.0'

NOTE:
NEW REFERENCES HAVE AN 8" SPIKE AT THE BASE OF THE SCRIBE WITH A LOCATION TAG ABOVE THE SCRIBE ALL ORIENTED TOWARD THE MONUMENT, UNLESS OTHERWISE NOTED. BEARINGS TAKEN WITH A HAND COMPASS WITH THE DECLINATION SET TO 21'E. DISTANCES MEASURED TO THE SPIKE WITH A 75' BUCKERS TAPE. EXISTING REFERENCES WERE VERIFIED WITH A HAND COMPASS WITH THE DECLINATION SET TO 21'E MEASURED WITH A 75' BUCKERS TAPE.

AUDITOR'S CERTIFICATE

FILED FOR RECORD THIS _____ DAY OF _____ 20____ AT _____ M. IN BOOK _____ OF SURVEYS AT PAGE _____ AT THE REQUEST OF LONGVIEW TIMBER CORPORATION, _____ DEPUTY COUNTY AUDITOR

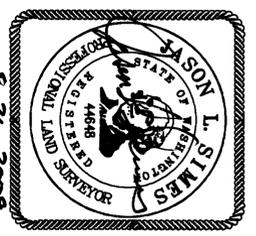

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF _____ IN _____ JUNE _____, 2009.

Jason L. Simms, Professional Land Surveyor, L# 44648

LONGVIEW TIMBER CORP.
10 INTERNATIONAL WAY
LONGVIEW, WA 98632

SCALE: N/A
JOB NO. 34N6E2
DATE: 8-24-09
CALC BY: JLS
DRAWN BY: JLS
CHECKED BY: WES
SHEET 3 OF 3