

AUDITOR'S CERTIFICATE

FILED FOR RECORD AT THE REQUEST OF THE WASHINGTON STATE D.N.R.

201303180052
Skagit County Auditor

3/19/2013 Page 1 of 1 9:24AM

James J. ...
SKAGIT COUNTY AUDITOR

Walter ...
DEPUTY

LEGAL DESCRIPTION

THE SE 1/4 OF THE NW 1/4, THE NE 1/4 OF THE SW 1/4 OF SECTION 2, TOWNSHIP 36 NORTH, RANGE 5 EAST, WILLAMETTE MERIDIAN, SKAGIT COUNTY, WASHINGTON

NARRATIVE

THE PURPOSE OF THIS SURVEY WAS TO POST ONE-HALF MILE OF STATE PROPERTY LINE BETWEEN MONUMENTS AT B18 AND D18. THE LINE POSTING WAS DONE WITH 6-FOOT-LONG ORANGE FIBERGLASS "THIN-LINE" POSTS SET AT IRREGULAR INTERVALS OF ABOUT 200 FEET. THIS WORK IS TO SERVE THE CHRISTIE CAMP/OUT TIMBER SALE.

BASIS OF BEARINGS AND DISTANCES

BASIS OF BEARINGS IS N00°09'47"E FOR THE NORTH-SOUTH CENTERLINE OF THE SOUTHWEST ONE-QUARTER SECTION. THIS IS IN HOLDING WITH THE RECORD OF SURVEY RECORDED UNDER AFN 9608290026 ON AUGUST 29, 1996 AT SKAGIT COUNTY, WASHINGTON AUDITOR'S OFFICE. CONVERGENCE IS SHOWN ON THE 1996 SURVEY AS -0° 57' 22" DISTANCES SHOWN ARE GRID DISTANCES. HORIZONTAL GROUND DISTANCES ARE OBTAINED BY DIVIDING GRID DISTANCES BY THE COMBINED SCALE FACTOR OF 0.999989991.

CONTROL SPECIFICATIONS, METHOD OF SURVEY, EQUIPMENT USED, AND ACCURACY

A TRAVERSE WAS RUN FROM A STEEL NAIL AT B18, THROUGH MONUMENTS AT LM1, LM2 AND G18 AND ENDING AT THE MONUMENT AT D18. THE INSTRUMENT USED WAS A LEICA TORA 1203+ ELECTRONIC THEODOLITE. THE TRAVERSE CLOSURE MEETS FIELD TRAVERSE STANDARDS FOR FOREST LANDS AS SPECIFIED IN WAC 332-130-090. TRAVERSE DATA WAS PROCESSED USING STARNET, STANDARD EDITION - VERSION 6.0. LINE POSTS WERE PLACED USING A HAND COMPASS AND STEEL TAPE TO MEASURE FROM TRAVERSE POINTS.

LIST OF SURVEY DOCUMENTS USED FOR REFERENCE

RECORDING INFORMATION REFERS TO THE RECORDS OF THE SKAGIT COUNTY AUDITOR, UNLESS OTHERWISE NOTED. THE PARENTHESES NUMBERS ARE REFERENCED WITHIN THE HISTORY SECTION OF THE VARIOUS CORNERS.

(1) RECORD OF SURVEY IN SECTIONS 2, 11, 13, AND 14, BY THE DEPARTMENT OF NATURAL RESOURCES (ERIC E. OLSEN, PLS 30439), RECORDED UNDER AFN 9608290026, DATED 8-29-1996.

[B18] NW 1/16 SEC. CORNER OF SEC. 2

ALUMINUM MONUMENT DESTROYED BY WINDFALL
HISTORY: IN 1994 THE DEPARTMENT OF NATURAL RESOURCES SET AN ALUMINUM MONUMENT (1).

FIELD SEARCH: THIS SURVEY DISCOVERED THAT THE 1994 ALUMINUM MONUMENT WAS DIRECTLY UNDERNEATH A 60" FIR WINDFALL AND IS PRESUMED DESTROYED. THE REFERENCE POINTS ARE IN GOOD CONDITION.

CORNER PERPETUATION: THIS SURVEY FOUND THE RP NAILS THAT WERE SET DURING THE 1994 DNR SURVEY AND USED THEM TO PLACE A STEEL NAIL IN THE TOP OF THE FIR WINDFALL. THE STEEL NAIL WAS LOCATED USING A DISTANCE-DISTANCE INTERSECTION FROM THE RP NAILS. THE STEEL NAIL IS INTENDED TO BE TEMPORARY, PROVIDING FORESTERS WITH A CORNER POSITION THEY CAN USE WHILE MARKING THE TIMBER SALE BOUNDARY. AT A FUTURE DATE, AFTER THE FIR WINDFALL IS REMOVED, A PERMANENT MONUMENT CAN BE SET FOR THE TIME BEING. THE STEEL NAIL WAS USED AS A STARTING POINT OF THE TRAVERSE AND THE TRAVERSE MEASUREMENTS ARE RECORDED IN DNR FIELD BOOK 7079. NO NEW REFERENCING WAS DONE.

[C18] CENTER W 1/16 SEC. COR. OF SEC. 2

FOUND DNR ALUMINUM MONUMENT
HISTORY: IN 1994 THE DEPARTMENT OF NATURAL RESOURCES SET AN ALUMINUM MONUMENT (1).

FIELD SEARCH: THIS SURVEY FOUND A DNR ALUMINUM MONUMENT ON 4-23-12. THIS SURVEY FOUND A DNR ALUMINUM MONUMENT AND ITS REFERENCES IN GOOD CONDITION. THE MEASUREMENTS TO THE MONUMENT ARE RECORDED IN DNR FIELD BOOK 7079. NO NEW REFERENCING WAS DONE.

[D18] SW 1/16 SEC. COR. OF SEC. 2

HISTORY: IN 1994 THE DEPARTMENT OF NATURAL RESOURCES SET AN ALUMINUM MONUMENT (1).

FIELD SEARCH: THIS SURVEY FOUND A DNR ALUMINUM MONUMENT ON 4-23-12. THIS SURVEY FOUND A DNR ALUMINUM MONUMENT AND ITS REFERENCES IN GOOD CONDITION. THE MEASUREMENTS TO THE MONUMENT ARE RECORDED IN DNR FIELD BOOK 7079. NO NEW REFERENCING WAS DONE.

[LM1] LINE MONUMENT 1

FOUND DNR 5/8" REBAR AND RED PLASTIC CAP

HISTORY: IN 1994 THE DEPARTMENT OF NATURAL RESOURCES SET A 5/8" REBAR AND RED PLASTIC CAP ON THE ONE-SIXTEENTH QUARTER SECTION LINE (1).


FIELD SEARCH: THIS SURVEY FOUND A 5/8" REBAR AND RED PLASTIC CAP. THE MEASUREMENTS TO THE MONUMENT ARE RECORDED IN DNR FIELD BOOK 7079. NO REFERENCING WAS DONE.

[LM2] LINE MONUMENT 2

FOUND DNR 5/8" REBAR AND RED PLASTIC CAP

HISTORY: IN 1994 THE DEPARTMENT OF NATURAL RESOURCES SET A 5/8" REBAR AND RED PLASTIC CAP ON THE ONE-SIXTEENTH QUARTER SECTION LINE (1).

FIELD SEARCH: THIS SURVEY FOUND A 5/8" REBAR AND RED PLASTIC CAP. THE MEASUREMENTS TO THE MONUMENT ARE RECORDED IN DNR FIELD BOOK 7079. NO REFERENCING WAS DONE.

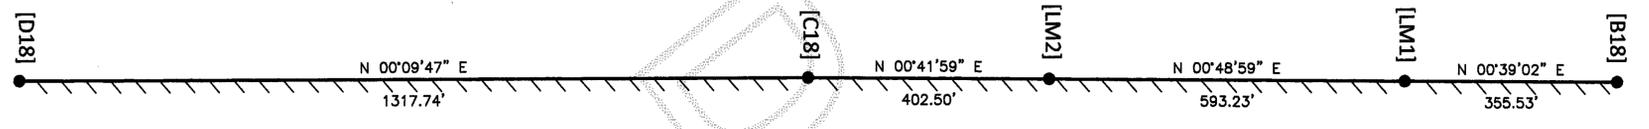

PRIVATE


STATE

CORNER SYMBOLS:

● FOUND MONUMENT

LINE POSTING:

////// INDICATES THAT ORANGE FIBERGLASS "BOUNDARY" POSTS WERE SET AT IRREGULAR INTERVALS ALONG THE INDICATED SUBDIVISION LINE AND ARE WITHIN ONE FOOT OF THE ACTUAL SUBDIVISION LINE.

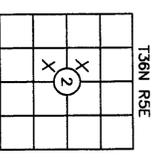

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES IN OCTOBER, 2012.

Gary S. Herrick
GARY S. HERRICK

31444
CERTIFICATE NUMBER



A SURVEY IN SECTION 2
TOWNSHIP 36 NORTH, RANGE 5 EAST, W.M.

STATE OF WASHINGTON
DEPARTMENT OF NATURAL RESOURCES

LAND SURVEY SECTION-P.O. BOX 47030
OLYMPIA, WASHINGTON 98504-7030 (360)902-1206

CHRISTIE CAMP/OUT

FIELD CREW: HERRICK, WILLIAMS
BECKETT

FIELD BOOK: 7079 FM1742.DWG 10/30/12

F.M.# 1742

SHEET 1 OF 1