


Dependent resurvey of the South Half of the Northwest Quarter and the North Half of the Southwest Quarter of Section 29, Township 34 North, Range 8 East, W.M. in Skagit County, Washington.

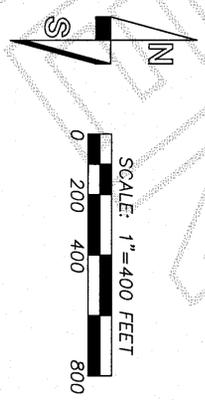

Basis of bearings: N89°51'58"E between the Center 1/4 corner and the West 1/4 corner of Section 29, Township 34 North, Range 8 East, W.M. as per Record of Survey recorded in Book 4 of Surveys at Page 12, Records of Skagit County, Washington.

- Found corner as noted
- ⊕ Calculated position
- () Record bearing or distance
- ==== Property line blazed, painted and posted
- ==== Approximate location USFS 1720 & 1722 Roads

Survey References:
 1) I.L. Orni PLS 10195, survey filed in Book 3, Page 175 (1982)
 2) D.L. Lund PLS 16213, survey filed in Book 4, Page 12 (1982)

Method of survey: Closed loop field traverses using a Topcon GTS-220 (000005") total station. This survey meets or exceeds precision requirements as set forth in WAC 332-130-090.

Record of Survey description: The North, East and West lines of the South Half of the Northwest Quarter and the South, East and West lines of the North Half of the Southwest Quarter of Section 29, Township 34 North, Range 8 East, W.M. in Skagit County, Washington.

Auditor's Certificate


Filed for record this 13 day of May, 2013
 at 10:14 AM in Book 4 of 10195 at Page 12
 under Auditor's File Number 201305130085 at the request
 of Butler Surveying Incorporated.
James Ferguson by Deputy Auditor

Surveyor's Certificate
 This map correctly represents a survey made by me or under my direction in conformance with the requirements of the Survey Recording Act at the request of Longview Timberlands, LLC in May of 2013.






Christopher M. Butler, PLS 36792
 date 5-10-13

BUTLER SURVEYING INC.
 476 NW CHEHALIS AVENUE
 P.O. BOX 149 CHEHALIS, WA 98532
 360/746-8803

Drawn C. Butler	Date 5-8-13
Checked <u>CB</u>	Job No. 12-70
Scale 1" = 400'	Sheet 1 of 1

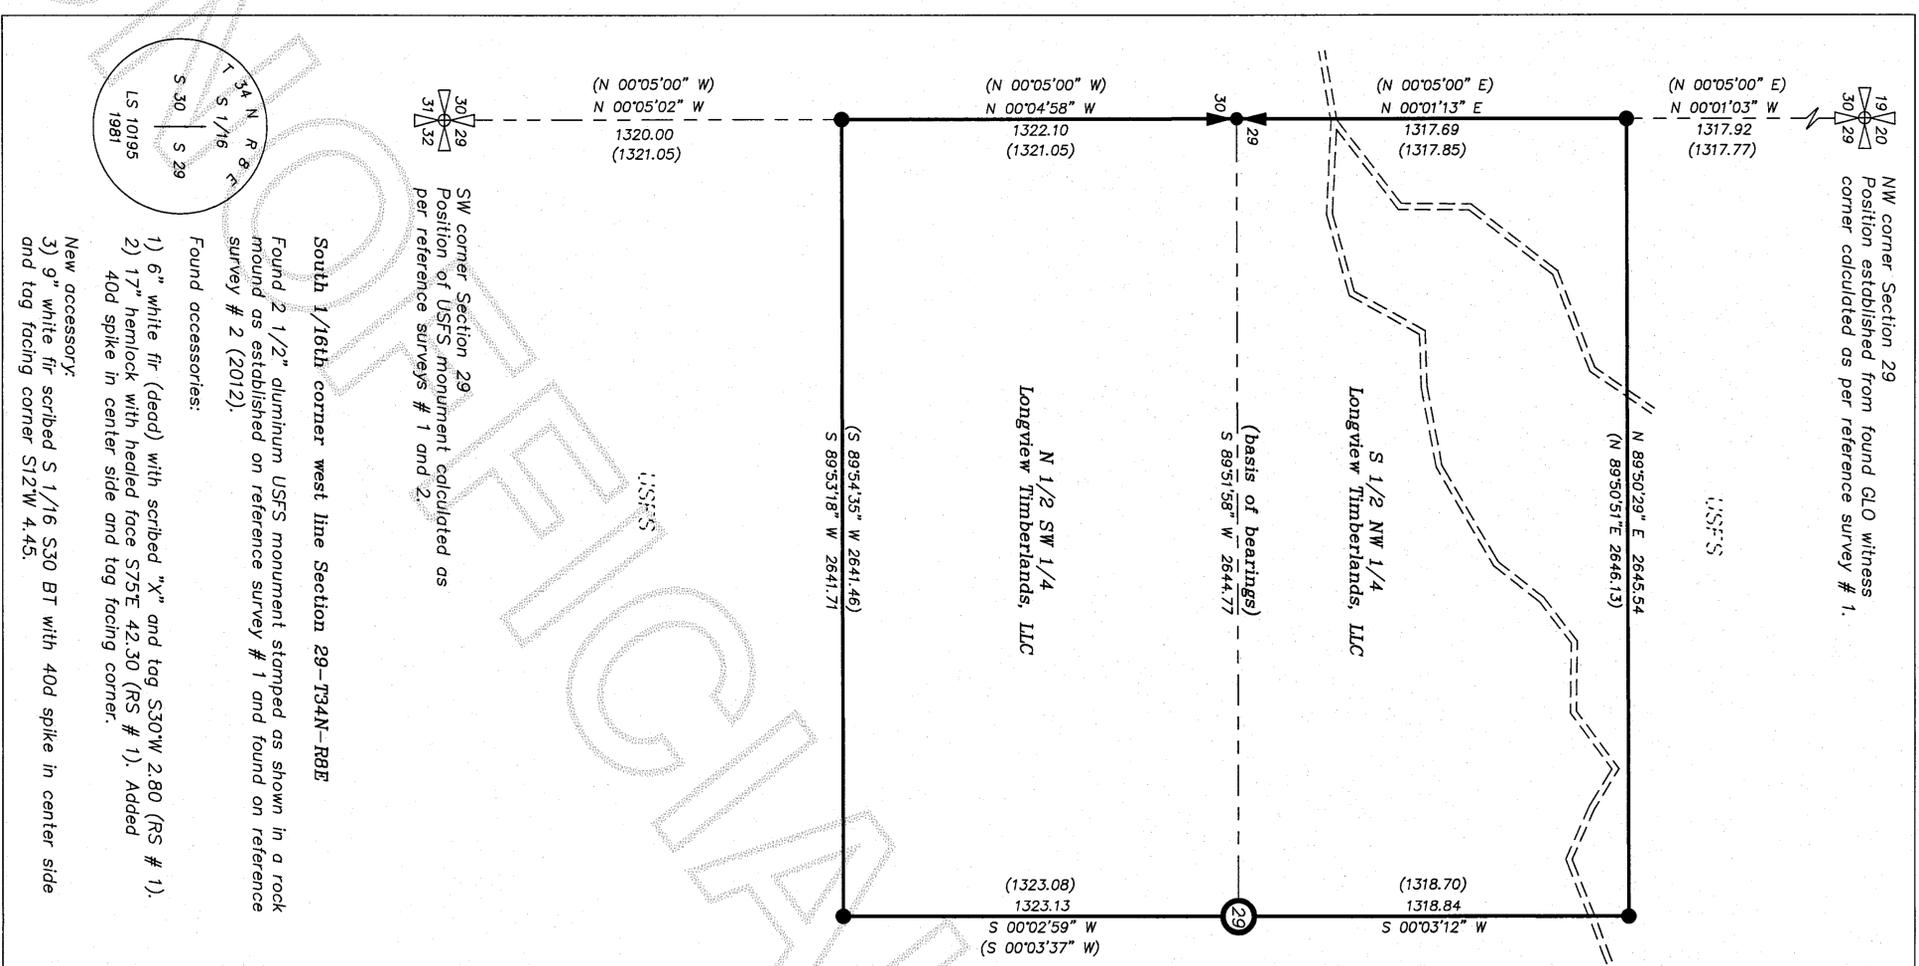

NW corner Section 29
 Position established from found GLO witness
 corner calculated as per reference survey # 1.

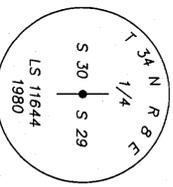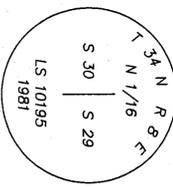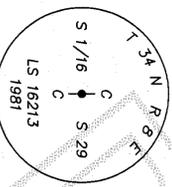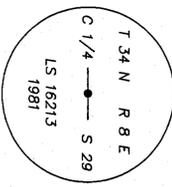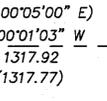

South 1/16th corner west line Section 29-T34N-R8E
 Found 2 1/2" aluminum USFS monument stamped as shown in a rock mound as established on reference surveys # 1 and found on reference survey # 2 (2012).
 Found accessories:
 1) 6" white fir (dead) with scribed "X" and tag S30W 2.80 (RS # 1).
 2) 17" hemlock with heeled face S75E 42.30 (RS # 1). Added 40d spike in center side and tag facing corner.
 New accessories:
 3) 9" white fir scribed S 1/16 S30 BT with 40d spike in center side and tag facing corner S12W 4.45.

SW corner Section 29
 Position of USFS monument calculated as per reference surveys # 1 and 2.

CN 1/16th corner Section 29-T34N-R8E

Found 2 1/2" aluminum USFS monument stamped as shown in a rock mound as established on reference survey # 2 (2012). Corner falls ± 130' North of USFS Road 1720.
 Found accessories (2012)
 1) 16" cedar with visible scribe N06E 4.80 (RS # 2).
 Added 40d spike in center side & tag facing corner.
 2) 12" cedar with heeled face S21E 9.60 (RS # 2).
 Added 40d spike in center side & tag facing corner.

Center 1/4 corner Section 29-T34N-R8E

Found 2 1/2" aluminum USFS monument stamped as shown in a rock mound as established on reference survey # 2 (2012).
 Found accessories (2012)
 1) 18" fir stump (rotten) N68W 23.5 (RS # 2)
 2) 7.5" cedar stump with visible scribe and nail with fasher in face S12W 18.10 (RS # 2).
 New accessories:
 3) 10" hemlock scribed C 1/4 S29 BT with 40d spike in center side and tag facing corner N85E 7.25.
 4) 21" cedar scribed C 1/4 S29 BT with 40d spike in center side and tag facing corner S08E 18.85.

CS 1/16 corner Section 29-T34N-R8E

Found 2 1/2" aluminum USFS monument stamped as shown as established on reference survey # 2 (2012). Corner was found bent and buried by the flooding of Finney Creek and was reset from found accessories.
 Found accessories (2012)
 1) 16" fir with heeled face S87E 50.54 (RS # 2).
 Added 40d spike in center side & tag facing corner.
 2) 14" cedar with heeled face S10E 41.10 (RS # 2).
 Added 40d spike in center side & tag facing corner.

North 1/16th corner west line Section 29-T34N-R8E

Found 2 1/2" aluminum USFS monument stamped as shown in a rock mound as per reference surveys # 1 and 2 (2012).
 Found accessories (2012)

1) 38" rotten fir stump N31W 26.1 (RS # 1)
 2) 34" cedar stump with visible scribe and nail & LS 10195 fasher in face S20W 47.50 (RS # 1)

W 1/4 corner Section 29-T34N-R8E

Found 2 1/2" aluminum USFS monument stamped as shown in a rock mound as per reference surveys # 1 and 2 (2012). Corner falls ± 330' South of FS Road 1720.
 Found accessories (2012)

1) 36" fir stump with visible scribe and tag N26W 28.38.
 2) 12" hemlock with visible scribe N82E 26.40.
 Added 40d spike in center side and tag facing corner.
 3) 14" hemlock with visible scribe S61W 46.09.
 Added 40d spike in center side and tag facing corner.