

NOTES  
 1 THESE LINES WERE RECOVERED AND REMARKED USING FOREST BOUNDARY POSTS AND MEASUREMENTS AS NOTED.

RECORD OF SURVEY OF THE SOUTHWEST QUARTER OF THE NORTHWEST QUARTER OF SECTION 28, AND THE SOUTHWEST QUARTER OF SECTION 36, TOWNSHIP 34 NORTH, RANGE 1 EAST, T1M IN SKAGIT COUNTY, WASHINGTON.  
 (SHEET 1 OF 2 SHEETS)



- BASIS OF BEARINGS: N 00°16'56" W BETWEEN THE SOUTHWEST AND NORTHEAST CORNERS OF SECTION 36, TOWNSHIP 34 NORTH, RANGE 1 EAST, T1M IN SKAGIT COUNTY, WASHINGTON.
- FOUND CORNER AS NOTED
  - SET 1/2" REBAR WITH ALUMINUM CAP PLS 36792
  - ⊕ CALCULATED POSITION
  - ▬▬▬ PROPERTY LINE BLAZED, PAINTED AND POSTED


METHOD OF SURVEY: CONVENTIONAL GROUND TRAVERSES USING A TOPCON PRECISION REQUIREMENTS AS SET FORTH IN WAC 322-120-020.  
 REFERENCE SURVEYS:  
 1) A MAP TITLED "TEER CREEK" IN SECTION 11-13N-07E BY PUGET SOUND PULP AND TIMBER COMPANY DATED AUGUST 1983, A COPY OF WHICH IS FILED IN THE PUBLIC RECORDS OF SKAGIT COUNTY, WASHINGTON.  
 2) A MAP TITLED "TEER CREEK" IN SECTION 35-37N-07E BY GEORGIA-PACIFIC CORPORATION DATED MAY 17, 1974, A COPY OF WHICH IS FILED IN THE PUBLIC RECORDS OF SKAGIT COUNTY, WASHINGTON.  
 3) FF. POWER, PLS 12718, VOLUME 4 OF SURVEYS, PAGES 49-51 (1992).

RECORD OF SURVEY DESCRIPTION

THE WEST, NORTH, AND EAST LINES OF THE SOUTHWEST QUARTER OF THE SOUTHWEST QUARTER OF SECTION 28, AND THE SOUTHWEST QUARTER OF SECTION 36, TOWNSHIP 34 NORTH, RANGE 1 EAST, T1M IN SKAGIT COUNTY, WASHINGTON, THE WEST LINE OF THE NORTHWEST QUARTER OF SECTION 28, AND THE SOUTHWEST QUARTER OF SECTION 36, TOWNSHIP 34 NORTH, RANGE 1 EAST, T1M IN SKAGIT COUNTY, WASHINGTON.

Auditor's Certificate  
 Filed for record this 28<sup>th</sup> day of August, 2018  
 at 10:02 A.M. in Book 201808210014 of Page 1  
 under Auditor's File Number 201808210014 at the request  
 of Butler Surveying, Incorporated  
 County Auditor James J. O'Connell by Christy Swartz  
 Deputy Auditor

Surveyor's Certificate  
 This map correctly represents a survey made by me or under my direction in conformance with the requirements of the Survey Recording Act of the request of Weyheuser Company in August of 2018.  
Christopher W. Butler 8-10-18  
 Christopher W. Butler, PLS 36792 date  
**BUTLER SURVEYING INC.**  
 478 NW CHEHALIS AVENUE  
 P.O. BOX 148, CHEHALIS, WA 98522  
 360/748-8803  
 Drawn R. Gregg Date 8-10-18  
 Checked CP Job No. 16-115  
 Scale 1" = 500' Sheet 1 of 2

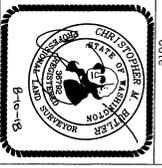

(Z - 21) SOUTHWEST CORNER SECTION 36-734N-87E

CORNER HISTORY:  
CORNER WAS ESTABLISHED BY GLO SURVEYOR E. HERMANS IN 1895 WORKING UNDER CONTRACT NO. 450. HERMANS ESTABLISHED THE CORNER TO BE A POST WITH FOUR BEARING TREES.  
CORNER RESTORATION: IN 1972 THE CORNER WAS RESTORED BY DNR EMPLOYEE JEFF BROWN. BROWN REPORTED FINDING THE CORNER TO BE A POST WITH FOUR BRASS CAP AND ESTABLISHED FOUR ACCESSORIES. RECORD OF BROWN'S CORNER RESTORATION IS ON FILE WITH THE F&D IN OLVNVA, VA.  
CORNER RECOVERY: IN 1985 THE CORNER WAS RECOVERED BY THE USFS WHO NOTED THE CORNER WAS A POST WITH FOUR BRASS CAP AND ESTABLISHED FOUR ACCESSORIES. RECORD OF THIS RECOVERY IS ON FILE WITH THE F&D IN OLVNVA, VA.  
FOUND CONCRETE MONUMENT WITH ONE BRASS CAP EXPOSED 0.4' ESTABLISHED BY WADON IN 1972 FROM 2 FOUND BEARING TREES.  
FOUND ACCESSORIES:  
- 36" HEALOCK STUMP 5335 28.82' TO TAG  
- 20" HEALOCK STUMP 5425 47.02' TO TAG  
- 10" HEALOCK STUMP 5425 47.02' TO TAG  
- 50" HEALOCK (HEAD) N85W 42.00' TO TAG  
NEW ACCESSORIES:  
- 14" ALDER N42E 30.48' TO NEW 400 SPIKE

(X - 21) WEST 1/4 CORNER SECTION 36-734N-87E


CORNER HISTORY:  
CORNER WAS ESTABLISHED BY GLO SURVEYOR A. RUTH IN 1902 WORKING UNDER CONTRACT NO. 587. RUTH ESTABLISHED THE CORNER TO BE A POST WITH TWO BEARING TREES.  
CORNER RECOVERY: A 1985 USFS CORNER CARD NOTES A CONCRETE MONUMENT WITH TWO BEARING TREES AT THIS CORNER. RECORD OF THIS RECOVERY IS ON FILE WITH THE F&D IN OLVNVA, VA.  
THIS SURVEY FOUND THAT THE LAYOUT POSITION FOR THIS CORNER FALLS IN THE INTERSECTION OF THE SECTION LINE AND THE SECTION LINE. BROWN'S RECOVERY OF THE CORNER WAS DECLARED LOST AND CALCULATED BY SINGLE PROPORTION. NO MONUMENT WAS SET.  
POSITION CALCULATED BY SINGLE PROPORTION. NOT SET. THIS CORNER WAS FOUND BY GLO SURVEYOR A. RUTH IN 1902. THE CORNER POSITION NOW FALLS IN AN EXTENSIVE LAND SLIDE AND IS LOST.

(Y - 21) NORTHWEST CORNER SECTION 36-734N-87E

CORNER HISTORY:  
CORNER WAS ESTABLISHED BY GLO SURVEYOR A. RUTH IN 1902 WORKING UNDER CONTRACT NO. 587. RUTH ESTABLISHED THE CORNER TO BE A POST WITH FOUR BEARING TREES.  
CORNER RESTORATION: THIS CORNER WAS RESTORED BY DNR SURVEYORS IN 1987. BROWN REPORTED FINDING THE CORNER TO BE A POST WITH FOUR BRASS CAP AND ESTABLISHED FOUR ACCESSORIES. RECORD OF BROWN'S CORNER RESTORATION IS ON FILE WITH THE F&D IN OLVNVA, VA.  
CORNER RECOVERY: A 1982 F. POYNER, P.L.S. 12716 NOTES FINDING A CONCRETE MONUMENT WITH PROSSER'S RECORDS OF SVADET COUNTY, WASHINGTON.  
THIS SURVEY DID NOT VISIT THE CORNER. THE POSITION REPORTED HEREON WAS CALCULATED AS PER VOLUME 4 OF SURVEYS AT PAGE 51 (REFERENCE SURVEY # 3).

(Z - 20) SOUTH QUARTER CORNER SECTION 36-734N-87E

FOUND ONE ALUMINUM CAP ON 1" IRON PIPE AS ESTABLISHED BY WADON IN 1973 FROM 1 FOUND BEARING TREE AGAINST AN 8" HEALOCK TO THE EAST (2016).  
FOUND ACCESSORIES:  
- 20" HEALOCK STUMP N27W 18.90'  
- 10" HEALOCK STUMP N27W 18.90'  
FOUND ACCESSORIES HAVE A NAIL AND TAG IN CENTER FACE.  
(X - 20) CENTER QUARTER CORNER OF SECTION 36 SET 1/2" X 30" REBAR WITH 2 1/2" ALUMINUM CAP STAMPED AS SHOWN (2016).  
NEW ACCESSORIES:  
- 24" FIR 532E 19.20' TO NEW 400 SPIKE  
- 14" FIR 532E 19.20' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.  
(W - 20) CENTER-NORTH 1/8TH CORNER OF SECTION 36 NOTHING SET. POSITION CALCULATED BY SINGLE PROPORTION AS DEPICTED HEREON.

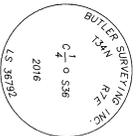

(V - 20) NORTH QUARTER CORNER SECTION 36-734N-87E

FOUND CONCRETE MONUMENT WITH ONE BRASS CAP AND RECOVERED ON REFERENCE SURVEY # 3 IN 1982 (2016).  
FOUND ACCESSORIES:  
- 15" HEALOCK N41W 10.65' TO NEW 400 SPIKE  
- 14" HEALOCK N41E 3.68' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.  
(U - 20) CENTER-SOUTH 1/8TH CORNER SECTION 36-734N-87E FOUND 3" ALUMINUM MONUMENT LS 12716 EXPOSED 0.3' IN A WADON OF STONES AS PER REFERENCE SURVEY # 3 (2016).  
NEW ACCESSORIES:  
- 7" FIR N45W 8.19' TO NEW 400 SPIKE  
- 10" HEALOCK S27W 11.17' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.  
(W - 20) NORTHWEST 1/8TH CORNER SECTION 36 SET 1/2" X 30" REBAR WITH 2 1/2" ALUMINUM CAP STAMPED AS SHOWN (2016).  
NEW ACCESSORIES:  
- 10" FIR N60W 5.76' TO NEW 400 SPIKE  
- 10" FIR N60W 11.60' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.

(X - 20) CENTER-EAST 1/8TH CORNER SECTION 36-734N-87E

SET 1/2" X 30" REBAR WITH 2 1/2" ALUMINUM CAP STAMPED AS SHOWN (2016).  
NEW ACCESSORIES:  
- 7" FIR N45W 8.19' TO NEW 400 SPIKE  
- 10" HEALOCK S27W 11.17' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.  
(W - 20) NORTHWEST 1/8TH CORNER SECTION 36 SET 1/2" X 30" REBAR WITH 2 1/2" ALUMINUM CAP STAMPED AS SHOWN (2016).  
NEW ACCESSORIES:  
- 10" FIR N60W 5.76' TO NEW 400 SPIKE  
- 10" FIR N60W 11.60' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.

(Y - 20) SOUTHWEST 1/8TH CORNER SECTION 36-734N-87E

FOUND 3" ALUMINUM MONUMENT LS 12716 EXPOSED 1.0' AS PER REFERENCE SURVEY # 3 (2016).  
NEW ACCESSORIES:  
- 14" FIR S27E 7.40' TO TAG  
- 14" FIR S27E 15.50' TO TAG  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.  
(U - 20) EAST 1/8TH CORNER SOUTH LINE SECTION 29-734-1N87E NOTHING FOUND. NOTHING SET. THE CALCULATED POSITION DEPICTED HEREON FALLS IN ROCK AND BROWN'S RECOVERY OF THE CORNER IS NOW MISSING. SETTING A NEW MONUMENT AT THIS POSITION IS IMPRACTICAL.

(Z - 20) SOUTHWEST CORNER SECTION 36-734N-87E

FOUND 4"x4" CONCRETE MONUMENT WITH ONE BRASS CAP AND FOREST SERVICE BOUNDARY SIGN (2016). CORNER WAS ESTABLISHED BY WADON IN 1977 FROM 3 FOUND BEARING TREES.  
FOUND ACCESSORIES:  
- 54" CEDAR STUMP N12E 12.21'  
- 44" FIR 532E 19.20' TO NEW 400 SPIKE  
- 41" FIR STUMP S07W 22.75'  
NEW ACCESSORIES:  
- 14" FIR N60W 13.10' TO NEW 400 SPIKE  
- 17" FIR N60W 13.10' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.



RECORD OF SURVEY OF THE SOUTHWEST QUARTER OF THE SOUTHEAST QUARTER OF SECTION 25, AND THE SOUTHWEST QUARTER NORTHWEST QUARTER AND NORTHEAST QUARTER OF SECTION 36, TOWNSHIP 34 NORTH, RANGE 7 EAST, W.M. IN SVADET COUNTY, WASHINGTON. (SHEET 2 OF 2 SHEETS)

(A - 1) NORTHWEST CORNER SECTION 36-734N-87E (C.C.)



FOUND 3" ALUMINUM FOREST SERVICE MONUMENT LS 12716, EXPOSED 0.4' IN ROCK FILE ESTABLISHED ON REFERENCE SURVEY # 3 (2016).  
NEW ACCESSORIES:  
- 10" FIR N42E 17.81' TO NEW 400 SPIKE  
- 12" FIR N60W 5.76' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.

(X - 20) EAST QUARTER CORNER SECTION 36-734N-87E

POSITION OF 3" ALUMINUM MONUMENT ESTABLISHED BY SINGLE PROPORTION CALCULATED AS PER REFERENCE SURVEY # 3.  
(W - 20) NORTH 1/8TH EAST LINE OF SECTION 36-734N-87E SET 1/2" X 30" REBAR WITH 2 1/2" ALUMINUM CAP STAMPED AS SHOWN (2016).  
NEW ACCESSORIES:  
- 10" FIR N42E 20.75' TO NEW 400 SPIKE  
- 12" FIR S27E 23.91' TO NEW 400 SPIKE  
NEW ACCESSORIES HAVE A 400 SPIKE IN CENTER SIDE, A SCRIBED X AND NEW TAG FACING THE CORNER AND A 6" FLUORESCENT BAND AT HEAD HEIGHT.

(Y - 20) NORTHWEST CORNER SECTION 36-734N-87E

CORNER RESTORATION: IN 1972 THE CORNER WAS RESTORED BY DNR EMPLOYEE JEFF BROWN WHO REPORTED FINDING TWO ORIGINAL BEARING TREES AT THE POSITION DERIVED FROM THE FOUND GLO BR'S BROWN'S RECOVERY OF THE CORNER WAS DECLARED LOST AND CALCULATED BY SINGLE PROPORTION. NO MONUMENT WAS SET.  
CORNER RESTORATION: THIS CORNER WAS RESTORED BY DNR SURVEYORS IN 1987. BROWN REPORTED FINDING THE CORNER TO BE A POST WITH FOUR BRASS CAP AND ESTABLISHED FOUR ACCESSORIES. RECORD OF BROWN'S CORNER RESTORATION IS ON FILE WITH THE F&D IN OLVNVA, VA.  
CORNER RECOVERY: A 1982 F. POYNER, P.L.S. 12716 NOTES FINDING A CONCRETE MONUMENT WITH PROSSER'S RECORDS OF SVADET COUNTY, WASHINGTON.  
THIS SURVEY DID NOT VISIT THE CORNER. THE POSITION REPORTED HEREON WAS CALCULATED AS PER VOLUME 4 OF SURVEYS AT PAGE 51 (REFERENCE SURVEY # 3).

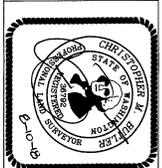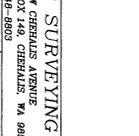

<b>BUTLER SURVEYING INC.</b>	
770 NW CHEROKEE AVENUE SVADET COUNTY, VIRGINIA 24162 380/748-8803	
Drawn R. Gregg	Date 8-10-18
Checked CB	Job No. 16-115
Scale none	Sheet 2 of 2