A DEPENDENT SURVEY for Weyerhaeuser Co., of the South & East lines of the W.1/2 of SECTION 13, T33N R7E and the West line of the NW.1/4 of SECTION 19, T33N R8E as situated within SKAGIT COUNTY, WASHINGTON

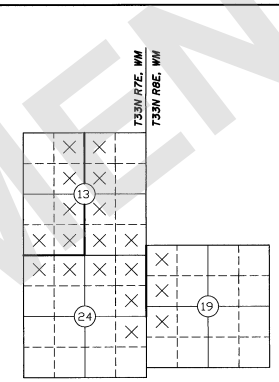

DNR INDEX

BASIS OF BEARING

THE EAST LINE OF THE NE.1/4 OF SECTION 24 T33N R7E AS PREVIOUSLY RECORDED (SEE SR-1)

SURVEY REFERENCES (SR)

1) 1982 SURVEY BY F. FOYNER, LS-12716, BK.4 PG.49
2) 1975 SURVEY BY GEORGIA-PACIFIC, ON FILE WITH THE DNR

*This survey was conducted by means of a closed traverse between existing corners and/or prior control, using a "LEICA TS06+" TOTAL STATION (least read 05"). The relative accuracy of this control exceeds 1:10,000.

**Each new corner BT was measured to the center of the tree, referenced by a 60d nail on the right side with a corner reference tag.

1/4 COR.
Fd. 3" DNR stamped brass cap in concrete. (See LCR #7909120010)

FOUND REFERENCES
-28" HEMLOCK W/FACE & TAG, N10°45'E-79.2'
-24" HEMLOCK W/TAG, N33°45'E-70.4'
-36" FIR SNAG W/TAG S40°30'E-98.3'
-30" HEMLOCK STUMP S30°30'W-149.9'
-T-POST, NORTH-3.0'

WASHINGTON T33N R7E S12 1/4 S13 1979 DEPT. NATURAL RESOURCES

S.12 S.13

2611.31'

APPROX. C.1/4 COR.
Fd. 3"x3" wood post 2.2' West of line. (No public record of this corner found.)

FOUND REFERENCES
-24" HEMLOCK STUMP W/1978 DNR TAG, S63°47'37"W-41.7' (TAG READS-N64-3/4°E-41.8')
-32" HEMLOCK STUMP W/1980 DNR TAG & NAIL, S29°32'E-58.4' (TAG READS-N28°W-59.38')

N.1/2 SW.1/4 WEYERHAEUSER CO.

1544.82'

N 01°25'33" W - 5217.12'

WC C S1/16 S13 C LS 37529

S.1/2 SW.1/4 DNR

1061.00'

WC TO CS.1/16 S.13
Set 1" IP w/stamped brass cap on 12/2/2019 for a point on the N-S C/L

NEW REFERENCES
-10" FIR, SCRIBED [X][BT], S08°W-30.3'
-8" FIR, SCRIBED [X][BT], S61°E-80.5'
-T-POST, SOUTH-3.0'

WEYERHAEUSER CO.

FOREST SERVICE CC S13 S16 R8E S19 LS 12716 U.S.D.A.

WC CLOS. SECTION COR.
Fd. 3" USDA stamped aluminum cap (See SR-1)

FOUND REFERENCES
-30" FIR SNAG, N41°E-11.2'
-13" FIR BLOW-DOWN, S11°E-21.1'

NEW REFERENCES
-6" FIR, SCRIBED [T33N R8E S18CCBT], N39°E-5.3'
-10" FIR, SCRIBED [T33N R8E S19CCBT], S30°E-22.2'
-T-POST, SOUTH-3.0'

2.67' (NTS) S.18 S.19

(S00°18'56"E SR-1) S 00°21'33" E - 559.86' (559.81' SR-1)

S.14 S.13 S.23 S.24

(S89°32'E-2675.8' SR-2) N 89°12'38" E - 2690.60'

(S89°29'E-2636.2' SR-2) N 89°54'11" E - 2614.45'

S.13 S.24

SECTION COR.
Fd. 3" DNR stamped brass cap in concrete. (See SR-2 & LCR #851199)

WASHINGTON T33N R7E S14 S13 S23 S24 1977 DEPT. NATURAL RESOURCES

FOUND REFERENCES
-30" FIR STUMP W/VIS SCRIBE [T33NR7ES24BT], S67°E-21.7'
-22" FIR STUMP, S0°30'W-22.0'
-24" FIR STUMP, S58°W-22.3'
-16" FIR STUMP, N74°W-18.3'
-15" FIR STUMP, N50°W-10.8'
-10" FIR STUMP, N30°30'E-24.5'

NEW REFERENCES
-5" FIR, SCRIBED [T33N R7E S13BT], N37°E-9.3'
-8" HEMLOCK, SCRIBED [T33NR7E S24BT], S50°E-3.2'
-8" HEMLOCK, SCRIBED [T33NR7E S23BT], S59°W-6.0'
-6" FIR, SCRIBED [T33NR7E S14BT], N64°W-11.4'
-T-POST, EAST-3.0'

1/4 COR.
Fd. 3" DNR stamped brass cap in concrete. (See SR-2 & LCR #851202)

WASHINGTON T33N R7E S13 1/4 S24 1977 DEPT. NATURAL RESOURCES

FOUND REFERENCES
-30" FIR STUMP S25°30'W-27.6'
-30" FIR STUMP S36°30'E-16.5'
-36" FIR STUMP S88°E-10.3'
-34" FIR STUMP N83°W-26.2'
-34" FIR STUMP N4°30'W-60.6'

NEW REFERENCES
-12" FIR, SCRIBED [1/4 S13BT], N40°E-3.8'
-14" FIR, SCRIBED [1/4 S24BT], S70°W-19.9'
-T-POST, WEST-3.0'

FOREST SERVICE 2861 CC S13 S24 R8E R7E T33N LS 12716 U.S.D.A.

STD. SECTION COR.
Fd. 3" USDA stamped aluminum cap (See SR's 1,2 & USDA corner card on file w/DNR)

FOUND REFERENCES
-27" FIR SNAG, N15°30'W-24.4'
-11" FIR BLOW-DOWN, S20°30'E-26.4'
-11" FIR BLOW-DOWN, S16°W-36.1'

NEW REFERENCES
-6" FIR, SCRIBED [T33N R7E S24BT], S70°W-6.2'
-5" FIR, SCRIBED [T33N R7E S13BT], N38°W-10.8'
-T-POST, SOUTH-3.0'

T.33N. R.7E. WEYERHAEUSER CO.

S 00°08'02" E - 2612.76' (S00°08'02"E-2613.72' SR-1) BASIS OF BEARING

U.S. FOREST SERVICE T.33N. R.8E.

FOREST SERVICE R8E E1/4 S24 R8E R7E T33N LS 12716 U.S.D.A.

1/4 COR. S.24
Fd. 3" USDA stamped aluminum cap w/8" PVC reference stake 3.0' North. (See SR-1 & USDA corner card on file w/DNR.

FOUND REFERENCES
-42" HEMLOCK SNAG, N58°30'E-14.5'
-30" FIR SNAG W/VIS SCRIBE [1/4S24BT], S11°W-27.3'
-19" HEMLOCK, N52°45'W-27.7'

NEW REFERENCES
-6" FIR, SCRIBED [1/4S BT], N83°E-9.5'
-8" FIR, SCRIBED [1/4S24BT], N59°W-8.6

S.24 S.19

LEGEND

- ✚ = A corner FOUND during this survey, as described
- ● = A new corner SET during this survey, on 12/02/2019, as described hereon
- ⊙ = A corner calculated only--not set this survey
- ( ) = A Bearing and/or Distance of record
- IP = An Iron Pipe
- WC = Witness Corner
- DNR = Washington State Department Natural Resources
- USDA = U.S. Department of Agriculture Forest Service
- T-POST = A 6' steel fence post w/location tag
- ||||||||||| = A line marked this survey with 1/2"x6' white fiberglass rods, painted blazes & flagging

400 300 200 100 0 400 800

SCALE: 1 inch = 400 feet

AUDITOR'S CERTIFICATE

Filed for record this 23rd day of Dec., 2019 at 11 : 11 A.M., in BOOK 1 of SURVEYS, at PAGE 1, at the request of HAMPSTUR CORPORATION.

COUNTY AUDITOR DEPUTY AUDITOR

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction, in conformance with the requirements of the Survey Recording Act, at the request of WEYERHAEUSER CO., in APRIL, 2019.

Phillip R. Gustin
Phillip R. Gustin PLS
Certificate no. 37529

Date signed: 12-18-2019

PHILLIP R. GUSTIN STATE OF WASHINGTON 37529 REGISTERED PROFESSIONAL LAND SURVEYOR

HAMPSTUR CORPORATION
P.O. Box 368
Kelso, Washington 98626
Phone: (360) 423-8166

Calculated by :	CJH
Checked by :	CJH/PRG
Drawn by :	TLG
Completion date :	12/02/2019
Field Book no. :	PS-869
Drawing No. :	19-626.DWG
HAMPSTUR JOB no. :	19-626
Sheet no.	1 of 1

Dec 16, 2019 - 3:12pm
C:\Carlson Projects\600 JOBS\19-626\19-626.dwg

20191223007 2
12/23/2019 11:11 AM Pages: 1 of 1 Fees: $137.50
Skagit County Auditor

UNOFFICIAL DOCUMENT