

N89°29'06"W 741.00
N89°29'06"W 741.01
N89°29'06"W 741.01

1482.01
1328.55
1328.55

DESCRIPTION & DEPARTURES OF FOUND MONUMENTS

CORNER, THIS SURVEY, BEARS

LINE	Direction	Length	Description
L1	S89°07'32"E	1.03	1/2" Rebar in Concrete, No L5#
L2	S89°07'32"E	0.36	Rebar & Cap, L5 75x48
L3	S77°43'59"W	0.04	Rebar & Cap, L5 49x08
L4	N81°36'53"W	1.71	3" Dia. Pipe, at grade, No L5#
L5	S02°20'53"E	1.58	Rebar & Cap, L5 218x1 (*notes)
L6	N46°10'17"W	2.02	3/4" Dia. Pipe in fence, No L5#
L7	S86°54'38"E	1.43	Rebar & Cap, L5 8702 (*notes)
L8	N72°58'24"E	0.97	3/4" Dia. Pipe, No L5#


BASE MERIDIAN THIS SURVEY

Monuments located on line "A-A" and the survey recorded under Auditor's File Number 893342 were found in substantial agreement with record dimensions.
S77°43'59"W 1481.86 course between monuments
1481.95 course per above record

*NOTE - The quarter section dimensions quoted in Short No. 91-64 and subsequent Boundary Line Adjustment, AFN 96080500048 falls to form a closed figure with an error of 2.54 feet.

Legend

- utility pole
- chain link fence
- x— barbed wire and electric fence
- iron pipe, as noted
- rebar, as noted
- ⊕ rebar & cap, L5 24535

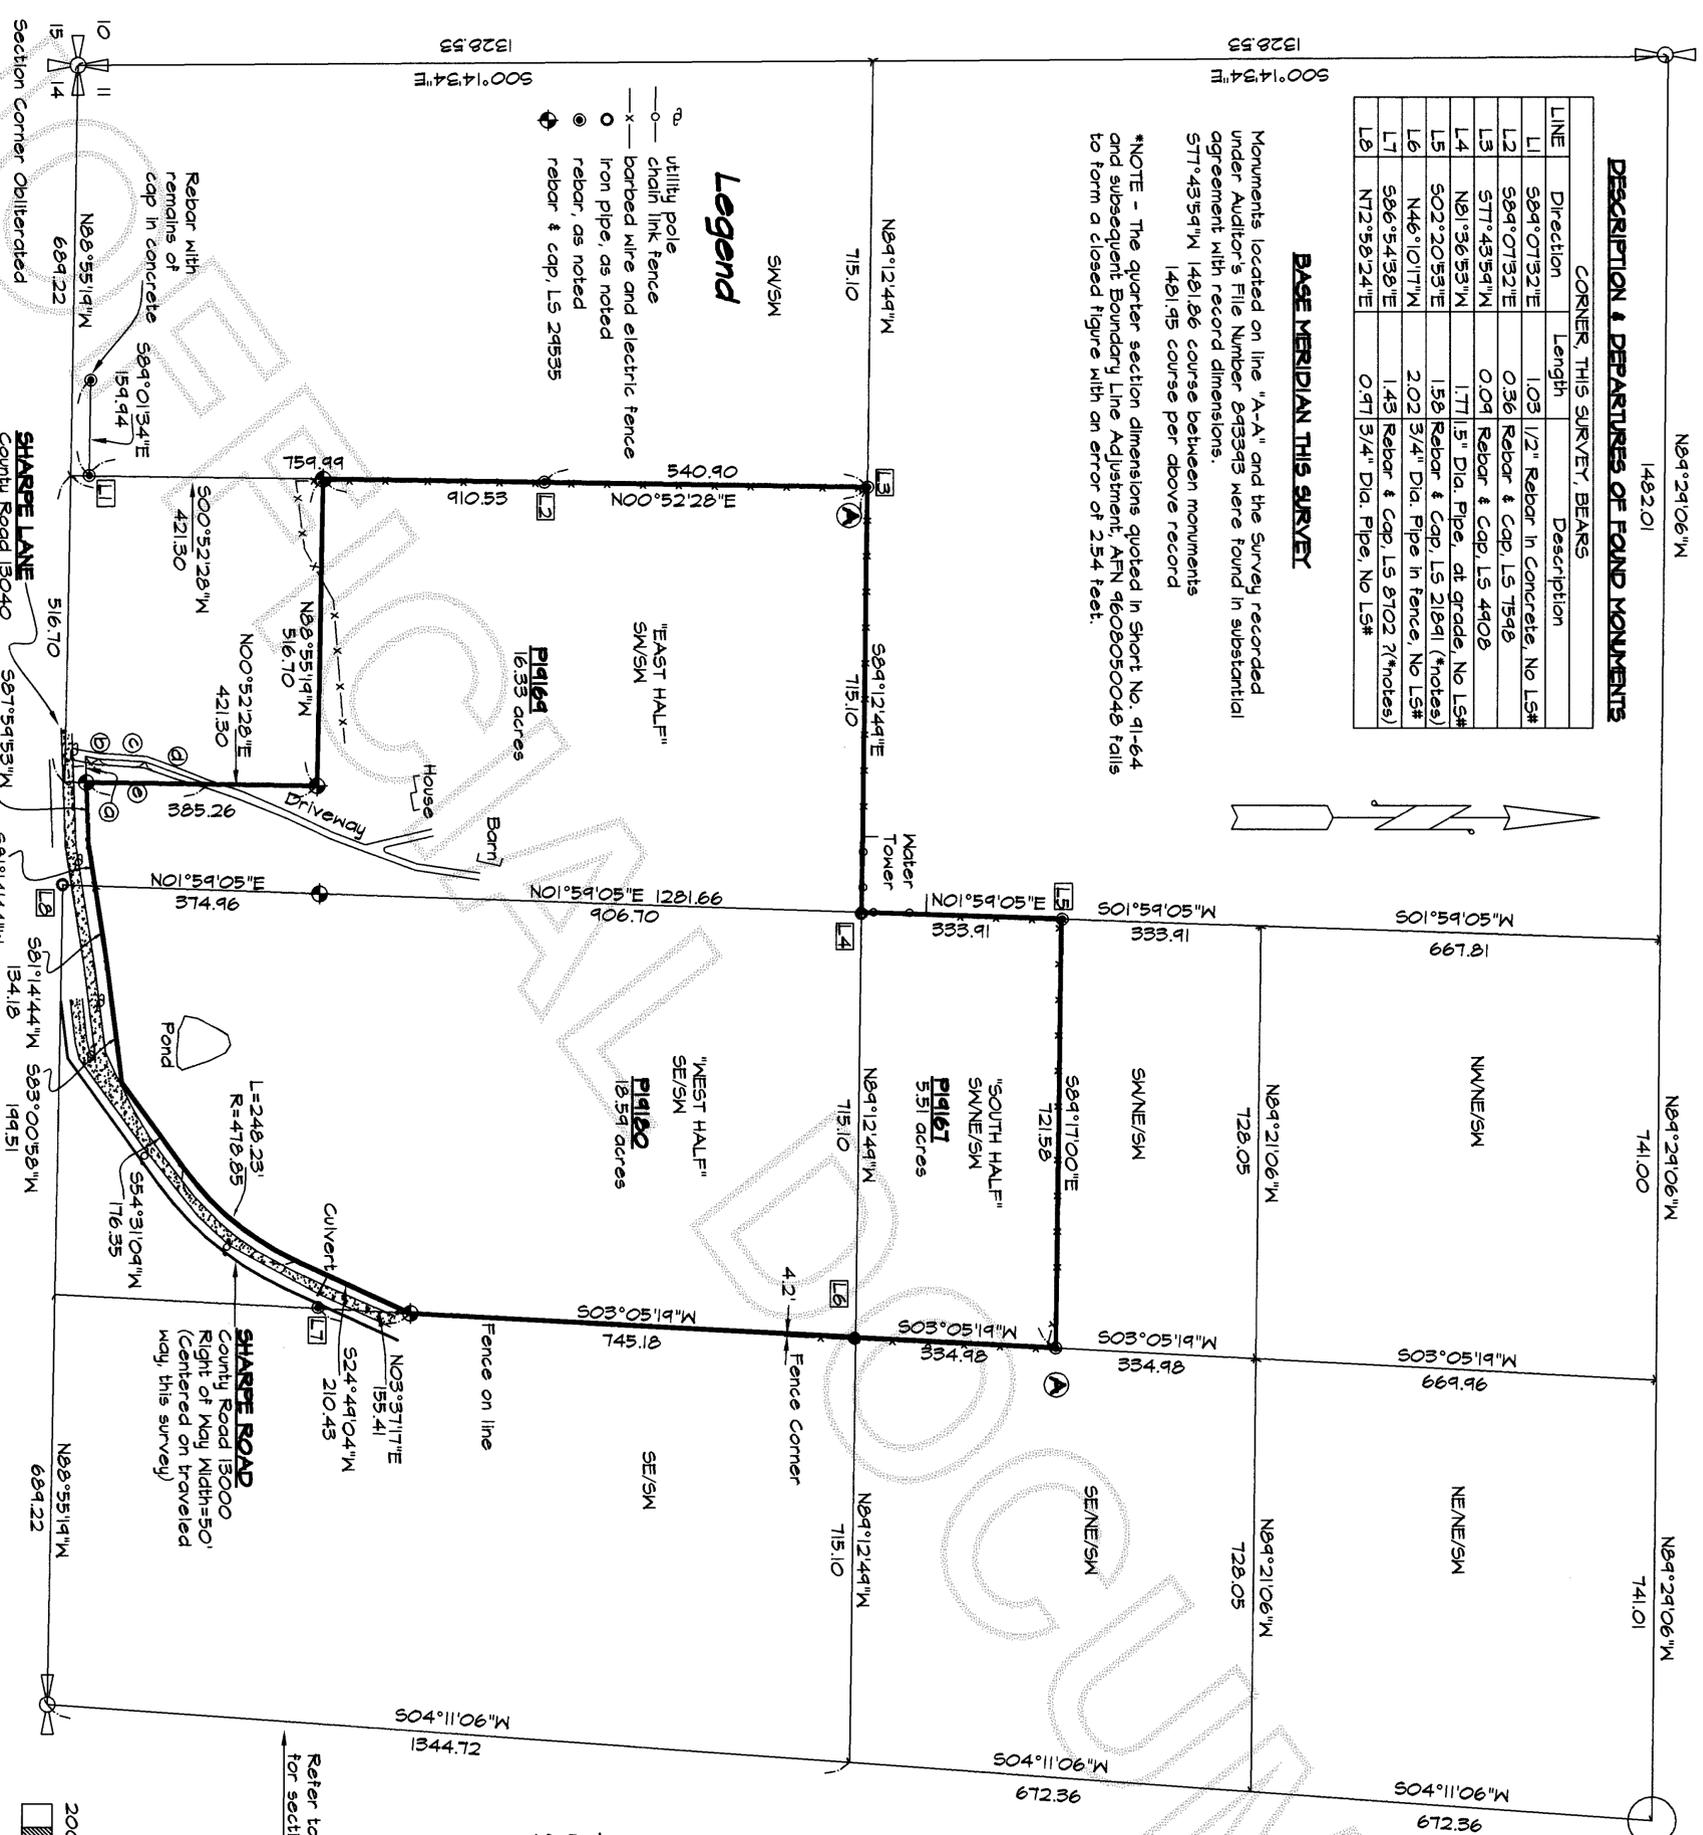

Auditor's Certificate

Filed for record this 4 day of February 2003 at 10:15 a.m. at the request of Parrish Land Surveying

Nana Bancroft
Auditor's File Number

Land Description

Auditor's File Number 9512140045
The west half of the southeast quarter of the southwest quarter, section 11, Township 34 north, Range 1 east, N.M., EXCEPT that portion thereof lying southeasterly of the county road.
AND, the south half of the southwest quarter of the northeast quarter of the southwest quarter, section 11, Township 34 north, Range 1 east, N.M.

AND the east half of the southwest quarter of the southwest quarter, section 11, Township 34 north, Range 1 east, N.M., LESS the south 421.5 feet of the west 516.7 feet

SUBJECT TO all contracts, covenants, easements, restrictions, reservations, rights of way, ingress and egress, and the like if record, if any.

Survey Notes

This survey has been prepared from a closed random traverse using a "Topcon AP1 JA" total station.

The purpose of this survey has been to locate, describe and set monuments as required to mark the principle corners of the above described property.

The word "half" in the above description lacking definition is a potent ambiguity. For the purposes of this survey "half" has been determined by bisection of the respective parent boundary.

The County Roads shown hereon are described along a line parallel with and distant from (30' for Sharpe Lane and 25' for Sharpe Road) the centerline of the current traveled way.


Given the magnitude of the differences between the prior surveys of record listed below, caution should be observed when placing improvements near these reported boundaries. Refer to the following prior records:

1. Survey - AFN 893342
2. Short Plat - Skagit County No. 91-64
3. Short Plat - Skagit County No. 25-74
4. Short Plat - Skagit County No. 2-85


Surveyor's Certificate

This map correctly represents a survey made by me or under my direction in conformance with the requirements of the survey recording act at the request of the The Merrifield Family Trust, of Skagit County, in January, 2003.

certificate no. L5 24535
Robert F. Parrish

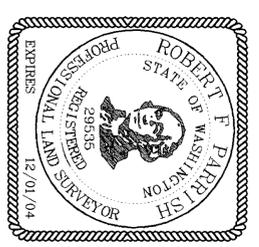

Refer to survey, AFN 893342 for section subdivision information

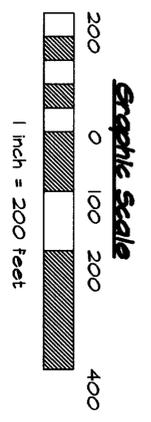

Record of Survey

Prepared at the request of

Merrifield Family Trust

Portions of the Southwest Quarter, Sect. 11, T. 34N., R. 1E., N.M., Fidalgo Island, Skagit County, Washington

Parrish Land Surveying

340 UNDER STREET, FRYDAY HARBOR, WASHINGTON 98280
(509) 588-1467 - parrishland.com

JOB NO.:	103-064
CADD BY:	RP
CHK BY:	RP
BK REF:	007
SCALE:	1" = 200'
DATE:	1-22-03