

**A DEPENDENT RE-SURVEY of the West Line
 of SECTION 25, T34N R6E, W.M.
 for the Longview Fibre Company
 as situated within
 SKAGIT COUNTY, WASHINGTON**

SECTION CORNER
 Fnd 2" Alum. pipe in mound of stone,
 w/3" Alum. cap stamped as shown,
 Tied 8/16/04. (See notes 1 and 2)

FOUND B.T.'S
 -7" WHITE FIR, N25°W-11.8'
 SCRIBED [T34N R6E S23RP],
 -29" HEMLOCK, S75°W-7.0'
 W/LOC. TAG AND
 FLASHER LS-24430 & LS-24423
 -6" HEMLOCK, S08°E-32.6'
 SCRIBED [X] AT CHEST HEIGHT AND [RP] IN LOW BLAZE
 -28" HEMLOCK STUMP, S12°E-17.1'
 W/LOC. TAG IN LOW BLAZE
 -12" HEMLOCK, N40°E-4.65'
 W/LOC. TAG IN LOW BLAZE



(GLO = N0°09'W-40.00 CHS)
 N 01°04'01" E - 2626.70'

LONGVIEW FIBRE CO.

GRANDY LAKE FOREST ASSOCIATES

BASIS OF BEARING
 (GLO = N0°09'W-40.00 CHS)
 N 00°09'00" W - 2631.82'

LONGVIEW FIBRE CO.

SECTION CORNER
 Fnd 3/4" GIP, 18" above ground,
 w/2" stamped brass cap as shown,
 Tied 8/20/04.

FOUND B.T.'S/RP'S
 -36" HEMLOCK STUMP,
 S89°W-10.0' (FACE & TAG)
 -26" HEMLOCK STUMP
 S75°E-22.9' (FACE & BLM TAG)
 -60" CEDAR STUMP
 S62°E-10.8' (TAG)


NEW B.T.'S
 -10" W. FIR, S89°E-3.1'
 SCRIBED [T34N R6E S36RP]
 -14" HEMLOCK, N52°E-10.7'
 SCRIBED [T34N R6E S26RP]
 -7" W. FIR, S28°E-10.9'
 SCRIBED [T34N R6E S35RP]
 -REF-POST, EAST 10'




BASIS OF BEARING
 THE WEST LINE OF THE
 SW 1/4 OF SEC. 25, T34N R6E
 AS DETERMINED BY THE GLO IN 1900.



DNR INDEX
 T34N R6E WM

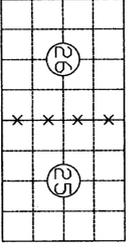

N.T.S.



- LEGEND**
- = A corner FOUND or SET during a previous survey, as described
 - = A corner calculated only--not set this survey
 - () = A Bearing and/or Distance of record
 - GIP = A Galvanized Iron Pipe
 - OBT = An Original Bearing Tree, scribbled by the GLO
 - RP = A Reference Point, usually a tree with scribing and/or a location tag
 - [] = Information scribbled on RP's or BT's
 - Ref-post = A 6 ft. steel fence post with location tag
 - = A line marked during this survey with 6 foot fiberglass rods, paint and flagging.

NOTES


- 1) Refer to the 2002 survey portions of Section 26, T34N R6E, by Northwest Surveying, under the direction of D. Demeyer, LS-21423, recorded under Auditor's file no. 200212200073, in the records of Skagit County, Washington.
- 2) Refer to the "Land Corner Records" (LCR's) on file in the records of Skagit County, Washington.
- 3) This survey was conducted by means of a closed traverse between existing corners and/or prior control, using a "LEICA TC1103" TOTAL STATION (least read 0.3"). The relative accuracy of this control exceeds 1:10,000.

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction, in conformance with the requirements of the Survey Recording Act of 1973, at the request of Longview Fibre Co., in September, 2004.

Phillip R. Gustin PLS
 Certificate no. 37,5229

Date signed: 10/13/04

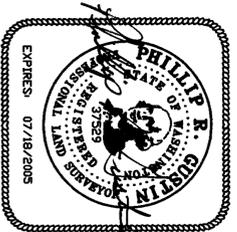

AUDITOR'S CERTIFICATE

Filed for record this 18 day of October, 2004
 at 11:24 A.M., in Book _____ of SURVEYS, at
 PAGE _____, of the request of HAMPSTUR CORPORATION,
 County Auditor

HAMPSTUR CORPORATION

P.O. Box 368
 Kelso, Washington 98626
 Phone: (360) 423-8166

Calculated by: DJG
 Checked by: CJH/PRG
 Drawn by: TJS
 Completion date: 9/20/04
 Field Book no.: PS-554
 Drawing No.: 04-626
 HAMPSTUR JOB no.: 04-626
 Sheet no. 1 of 1