

**A DEPENDENT SURVEY of the East Line of
SECTION 23, T34N R5E, W.M. for
LONGVIEW TIMBERLANDS, LLC,
as situated within
SKAGIT COUNTY, WASHINGTON**

200901150015
Skagit County Auditor
1/15/2009 Page 1 of 1 9:43AM

BASIS OF BEARING

BEARINGS ARE STATE PLANE
WASHINGTON NORTH ZONE NAD 83(9)
BASED ON GPS OBSERVATION AT
LAT: 48°25'46"
LONG: 122°07'03"

CONVERGENCE: -0°57'22"
Distances shown are grid with a combined scale factor of 0.9997898. To convert to ground distance, scale map distance by a factor of 1.0002102. (See Notes 1 & 2)



L/4 CORNER

Set 1" X 3/8" iron pipe w/2-1/2" stamped brass cap at single proportion position, with 6 foot steel reference post and location tag, North - 3.0' on 9/23/08

NEW BT'S

-11" Fir S63°45'E-46.3' scribed [1/4 S24 BT]
-14" Fir S38°W-51.5' scribed [1/4 S23 BT]

SECTION CORNER


Set 1" x 3/8" iron pipe with a 2-1/2" stamped brass cap, from original evidence, with 6" steel reference post 3.0' North, on 9/23/08.

901 Original BT's:

-60" Larch Line Tree, N01°W-7.26' (GL O)
Fnd, 48" Rotten stump, North-10.5'
-10" Larch, N27°E-29.7' (GL O)
Fnd, 26" Rotten Hemlock w/partially visible scribe, N27°E-29.7'
-24" Larch, S30°E-76.56' (GL O)
Fnd, 43" Rotten Hemlock w/partially visible scribe, S30°E-73.9'
-24" Hemlock, S45°W-56.10' (GL O)
Fnd, 66" D. Fir Blow-down w/tag & blaze, S61°W-50' (to root hole)
-40" Larch, N44°W-54.78' (GL O)
Fnd, 36" Rotten Hemlock stump w/partially visible scribe, N35°3'W-52.0'



NEW BT'S:

-19" Hemlock, N37°15'W-42.0' scribed [T34N R5E S23BT]
-7" White Fir, S37°30'W-43.9' scribed [T34N R5E S26BT]

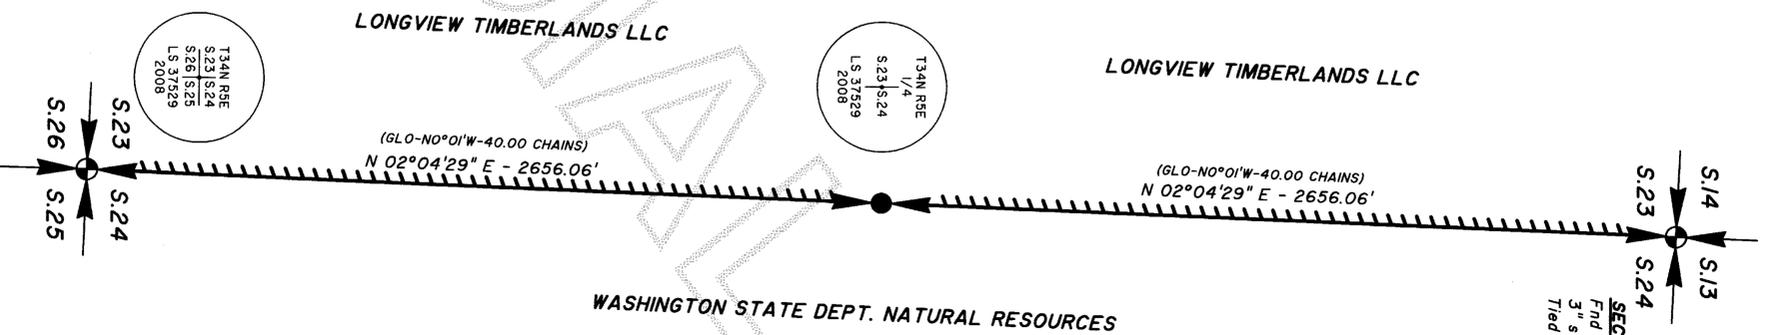

SECTION CORNER
Fnd 4x4 concrete DNR monument with 3" stamped brass cap as previously recorded. Tied 9/9/08 (See Notes 1 & 2)

WASHINGTON STATE DEPT. NATURAL RESOURCES

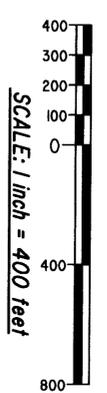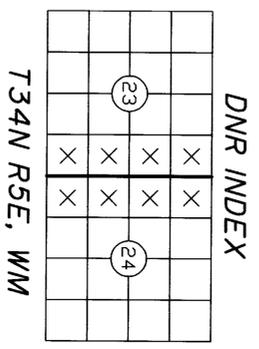

LEGEND

- = A corner FOUND or SET during a previous survey, as described
- = A new corner SET during this survey, on 09/23/08, LS-37,529, as described
- = A corner calculated only--not set this survey
- () = A Bearing and/or Distance of record
- AFN = Auditors File Number
- BT = Bearing Tree
- ||||| = A line marked with 1/2" x 6' fiber glass rods, red & white flagging, and blue paint on trees.

NOTES

- 1) Refer to the 2008 survey for Longview Timberlands LLC by G. Ford, LS-22,330, recorded under AFN 200810310013, in the records of Skagit County, Washington.
- 2) Refer to the 2005 survey for Longview Fibre Co. by G. Ford, LS-22,330, recorded under AFN 20051140233, in the records of Skagit County, Washington.
- 3) This survey was conducted by means of a closed traverse between existing corners and/or prior control, using a "LEICA TC1103" TOTAL STATION (least read 03"). The relative accuracy of this control exceeds 1:10,000.

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction, in conformance with the requirements of the Survey Recording Act of 1973, at the request of Longview Timberlands, in September, 2008.

Phillip R. Gustin, P.L.S.
Certificate no. 37,529

Date signed: 1/15/09



AUDITOR'S CERTIFICATE

Filed for record this 15 day of January, 2009

at 9:43 A.M., in BOOK _____ of SURVEYS, of PAGE _____, at the request of HAMPSTUR CORPORATION.

J. Youngquist
COUNTY AUDITOR

HAMPSTUR CORPORATION

<p>P.O. Box 368 Kelo, Washington 98626 Phone: (360) 423-8166</p>	<p>Calculated by: PRG</p> <p>Checked by: PRG/CH</p> <p>Drawn by: TLS</p> <p>Completion date: 9/23/08</p> <p>Field Book no.: PS-658</p> <p>Drawing No.: 08-631</p> <p>HAMPSTUR JOB no.: 08-631</p> <p>Sheet no. 1 of 1</p>
--	---