


AUDITOR'S CERTIFICATE
FILED FOR RECORD AT THE REQUEST
OF THE WASHINGTON STATE D.N.R.


 Skagit County Auditor
 10/21/2013 Page 1 of 3 8:44AM

 DEPUTY

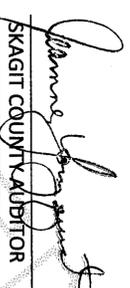

\$148.00

NARRATIVE

THE PURPOSE OF THIS SURVEY WAS TO POST THE NORTH LINE AND THE EAST LINE OF THE NW 1/4 OF THE NE 1/4 OF SECTION 18 TO SERVE THE ANGEL'S LAST TIMBER SALE.

STATE BOUNDARIES WERE POSTED WITH 6-FOOT LONG ORANGE FIBERGLASS THIN-LINE POSTS SET AT IRREGULAR INTERVALS OF ABOUT 190 FEET.

LEGAL DESCRIPTION

THE NW 1/4 OF THE NE 1/4 AND THE S 1/2 OF THE NE 1/4 OF SECTION 18, TOWNSHIP 33 NORTH, RANGE 5 EAST, WILLAMETTE MERIDIAN, SKAGIT COUNTY, WASHINGTON

AS DESCRIBED IN THE DEED RECORDED UNDER AFN 398383 AND DATED NOVEMBER 25, 1946

BASIS OF BEARINGS AND DISTANCES

WASHINGTON COORDINATE SYSTEM
 NAD 83(2011)(EPOCH:2010.00) NORTH ZONE, DERIVED FROM GLOBAL POSITIONING SYSTEM (GPS) TIES TO THE WASHINGTON STATE REFERENCE NETWORK USING THE REAL-TIME CAPABILITIES OF A TRIMBLE R8-2 RECEIVER AND TSC2 CONTROLLER

NEW POSITIONS DETERMINED THIS SURVEY USING GPS METHODS

STATION	U. S. SURVEY FEET	NORTHING	EASTING
GPS 7541	494680.312	1307363.090	
GPS 7542	497352.075	1307309.434	
GPS 7543	498464.271	1300490.490	
GPS 7544	497354.774	1304411.457	
GPS 7545	494644.670	1308319.203	
GPS 7546	497726.710	1301353.107	
GPS 7547	494645.080	1305625.093	

CONVERGENCE: - 1'01'44" AT THE 1/4 SECTION CORNER OF SECTIONS 7 AND 18

THE AREAS AND DISTANCES SHOWN ARE GRID. DIVIDE THE GRID DISTANCES BY THE COMBINED SCALE FACTOR OF 0.99992482 TO OBTAIN THE GROUND DISTANCES. THE COMBINED SCALE FACTOR IS DERIVED FROM AN ELEVATION SCALE FACTOR OF 0.99997463 AND A GRID SCALE FACTOR OF 0.99990529, BASED ON PROJECT AVERAGES.

CONTROL SPECIFICATIONS, METHOD OF SURVEY, EQUIPMENT USED, AND ACCURACY


CONTROL FOR THIS SURVEY IS IN COMPLIANCE WITH THE FEDERAL GEODETIC CONTROL COMMITTEE'S GEOMETRIC GEODETIC ACCURACY STANDARDS AND SPECIFICATIONS FOR USING GPS RELATIVE POSITIONING TECHNIQUES, VERSION 5.0, REPRINTED WITH CORRECTIONS AUGUST 1, 1999. FOR GROUP G, ORDER 1 SURVEYS, FIELD OBSERVATIONS WERE MADE USING ONE TRIMBLE R8-2 RECEIVER. EACH GPS STATION WAS OCCUPIED TWICE, WITH EACH OCCUPATION SEPARATED BY AT LEAST ONE HOUR. THIS SURVEY UTILIZED THE WASHINGTON STATE REFERENCE NETWORK TO OBTAIN GRID COORDINATES IN REAL TIME.

CORNER TIES WERE MADE BY FIELD TRAVERSE USING A LEICA TORA 1203+ TOTAL STATION. ALL TRAVERSES BEGAN AND ENDED AT PREVIOUSLY ESTABLISHED CONTROL POINTS. TRAVERSE CLOSURES MEET THE FIELD TRAVERSE STANDARDS FOR GRID TRAVERSES AS SPECIFIED IN WAC 332-130-090. CORNER MONUMENTS TIED WERE CHECKED BY DOUBLE MEASURES OF BOTH DIRECTION AND DISTANCE.

LINE POSTING:
 // // // // // INDICATES THAT ORANGE FIBERGLASS BOUNDARY POSTS WERE SET AT IRREGULAR INTERVALS ALONG THE INDICATED SUBDIVISION LINE AND ARE WITHIN ONE FOOT OF THE ACTUAL SUBDIVISION LINE.

CORNER SYMBOLS:

- FOUND MONUMENT
- ⊙ SET DNR MONUMENT
- CALCULATED FROM RECORD NOT VISITED THIS SURVEY
- + CALCULATED - NOT SET

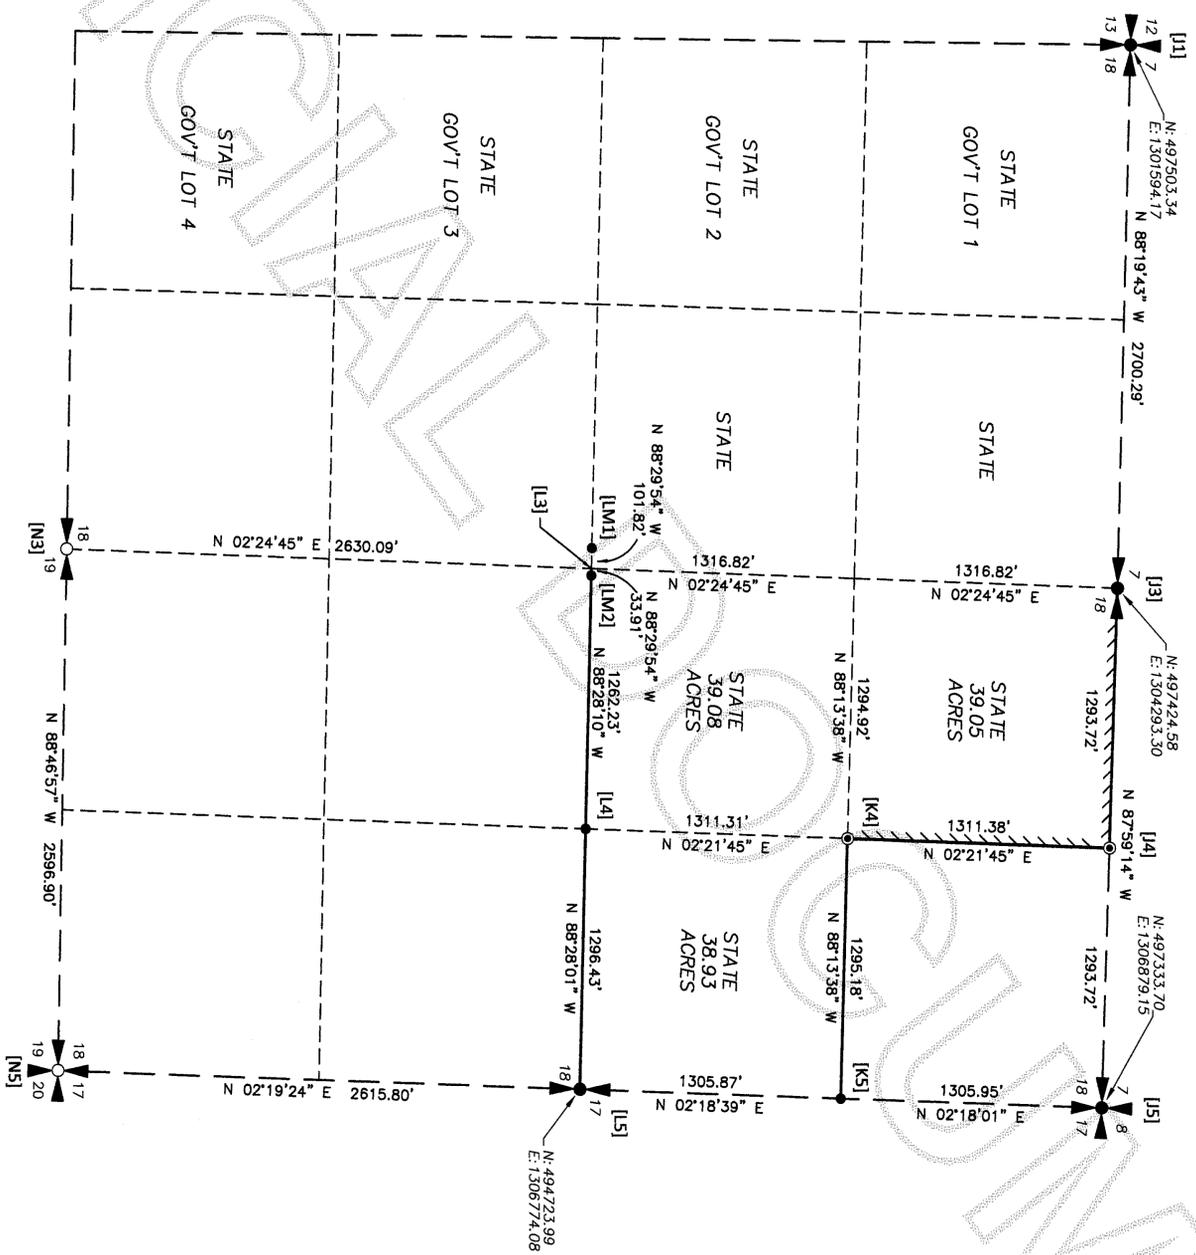

SURVEYOR'S CERTIFICATE

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING ACT AT THE REQUEST OF THE WASHINGTON STATE DEPARTMENT OF NATURAL RESOURCES IN JUNE, 2013.



 GARY S. HERRICK, PLS

CERTIFICATE NUMBER 31444



A SURVEY IN SECTION 18
 TOWNSHIP 33 NORTH, RANGE 5 EAST, W.M.

STATE OF WASHINGTON
 DEPARTMENT OF NATURAL RESOURCES
 LAND SURVEY SECTION - P.O. BOX 47030
 OLYMPIA, WASHINGTON 98504-7030 (360)902-1206

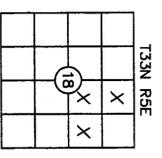

ANGEL'S LAST

FIELD CREW: HERRICK, WILLIAMS

FIELD BOOK: BECKETT

FIELD BOOK: FM1767.DWG 06/05/13

F.M.# 1767

SHEET 1 OF 3

CORNER HISTORY AND DESCRIPTIONS

201310210001 \$148.00 Skagit County Auditor 10/21/2013 Page 2 of 3 8:44AM

LIST OF SURVEY DOCUMENTS USED FOR REFERENCE

- RECORDING INFORMATION REFERS TO THE RECORDS OF THE SKAGIT COUNTY AUDITOR... (1) SHORT PLAT NUMBER 160-79, IN SECTION 7, BY SKAGIT SURVEYORS, INC. (JOHN ABENROTH, PLUS 17651), RECORDED UNDER AFN 8003070049 AND DATED 3-7-1980... (2) SHORT PLAT NUMBER 36-80, IN SECTION 17, BY DON SEMRAU AND ASSOCIATES (DONALD R. SEMRAU, PLUS 9622), RECORDED UNDER AFN 8005230014 AND DATED 5-23-1980... (3) SHORT PLAT NUMBER 88-80, IN SECTION 18, BY PARAGON LAND SURVEYING (MAX B. FORSGREN, PLUS), RECORDED UNDER AFN 8011180063 AND DATED 11-18-1980... (4) RECORD OF SURVEY IN SECTIONS 12 AND 13, BY THE SCOTT PAPER COMPANY (JOHN A. STANDISH, PLUS 12388), RECORDED UNDER AFN 8803240012 AND DATED 3-24-1985... (5) RECORD OF SURVEY IN SECTION 7, BY SKAGIT SURVEYORS, INC. (JOHN ABENROTH, PLUS 17651), RECORDED UNDER AFN 880410028 AND DATED 4-11-1986... (6) SHORT PLAT NUMBER 1-87, IN SECTION 18, BY DON SEMRAU & ASSOCIATES (DONALD R. SEMRAU, PLUS 9622), RECORDED UNDER AFN 8702170009 AND DATED 2-17-1987... (7) LAND CORNER RECORD FOR CORNER J1, BY JOHN A. STANDISH, PLUS 12388, RECORDED UNDER AFN 8705270074 AND DATED 3-27-1987... (8) SHORT PLAT NUMBER 93-018, IN SECTION 7, BY SKAGIT SURVEYORS, INC. (JOHN ABENROTH, PLUS 17651), RECORDED UNDER AFN 9408190034 AND DATED 8-19-1994... (9) SHORT PLAT NUMBER 95-027, IN SECTIONS 7 AND 8, BY SKAGIT SURVEYORS, INC. (JOHN ABENROTH, PLUS 17651), RECORDED UNDER AFN 9512140094 AND DATED 12-14-1995... (10) SHORT PLAT NUMBER 95-008, IN SECTION 17, BY SEMRAU & LISSER (BRUCE G. LISSER, PLUS 22960), RECORDED UNDER AFN 9707150040 AND DATED 7-15-1997... (11) RECORD OF SURVEY IN SECTIONS 17 & 18, BY PACIFIC SURVEYING & ENGINEERING, INC. (ADAM S. MORROW, PLUS 40525), RECORDED UNDER AFN 200601250073 AND DATED 1-25-2006... (12) RECORD OF SURVEY IN SECTION 18, BY LISSER & ASSOCIATES, PLLC (BRUCE G. LISSER, PLUS 22960), RECORDED UNDER AFN 200808290099 AND DATED 8-29-2002... (13) SURVEY IN SECTION 19, BY THE DEPARTMENT OF NATURAL RESOURCES (M. A. KINNAMAN, PLUS 11977), DATED AUGUST 1983 AND IS ON FILE WITH THE SKAGIT COUNTY ENGINEER'S OFFICE AND THE DNR PUBLIC LAND SURVEY OFFICE IN OLYMPIA... (14) UNRECORDED CORNER RECOVERY RECORD FOR SECTION 18, BY THE DEPARTMENT OF NATURAL RESOURCES, NORTHWEST REGION IN SEDRO-WOOLLEY. THE DOCUMENT IS A DIAGRAM OF SECTION 18 WITH NOTES ABOUT A NUMBER OF CORNER VISITS DATING BACK TO THE 1950S

[J1] CORNER OF SECTIONS 7, 12, 13 AND 18

FOUND AND ACCEPTED A 3/4" REBAR WITH 2" ALUMINUM CAP HISTORY: 1872 - U. S. GLO SURVEY SET A POST FROM WHICH BEARS: (1) A HEMLOCK 10" DIAM, N55E, 26 LINKS (2) A HEMLOCK 18" DIAM, N43 1/2 W, 80 LINKS (3) A CEDAR 10" DIAM, S26 1/2 W, 19 LINKS (4) A HEMLOCK 10" DIAM, S30E, 23 LINKS 1985 - SCOTT PAPER COMPANY SURVEY SHOWS THEY FOUND THE REMAINS OF TWO BEARING TREES AND SET A REBAR WITH ALUMINUM CAP (4) 1987 - JOHN STANDISH LAND CORNER RECORD DESCRIBES THE FOUND REMAINS OF TWO BEARING TREES AND THE SETTING OF A 3/4" REBAR WITH 2 1/2" ALUMINUM CAP (7) 2008 - LISSER & ASSOCIATES SURVEY SHOWS A POSITION CALCULATED PER PREVIOUS SURVEY (12)

FIELD SEARCH:

ON 4-8-13, THIS SURVEY FOUND AND ACCEPTED A 3/4" REBAR WITH STAMPED 2" DIAMETER ALUMINUM CAP AND ALSO FOUND: (1) AN UPRROOTED 9" OLD GROWTH CEDAR SNAG WITH A SCOTT PAPER TAG (NO SCRIBING VISIBLE) THAT BEARS S22W AT 19 LINKS (2) A VERY DECAYED STUMP WITH A SCOTT PAPER TAG (NO SCRIBING VISIBLE) THAT BEARS N40W AT 73 LINKS

CORNER PERPETUATION:

REFERENCES WERE ESTABLISHED AS FOLLOWS: A DNR VINYL RP TAG ON A 12" CEDAR BEARS N2E AT 20.05 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE EAST SIDE TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE SOUTH SIDE. A DNR VINYL RP TAG ON A 20" FIR BEARS N36E AT 9.74 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE SOUTH SIDE. A DNR VINYL RP TAG ON A 4 1/2" STUMP BEARS S38E AT 8.69 FEET TO A STEEL NAIL THAT IS 2 FEET UP ON THE NORTHWEST SIDE. A DNR VINYL RP TAG ON A 26" FIR BEARS S42W AT 13.21 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE NORTHWEST SIDE. AN ORANGE CARSONITE POST BEARS NORTH AT 1 FOOT.

FIELD BOOK 7088, PAGE 39, DATED 4-8-2013

[J3] 1/4 SECTION CORNER OF SECTIONS 7 AND 18

SET A 2" ALUMINUM CAP ON 5/8" REBAR FROM R.P.S HISTORY: 1980 AND 1994 - SKAGIT SURVEYORS SURVEY SHOWS A FOUND 2" FLU PIPE. A FIELD BOOK FROM THEIR OFFICES SHOWS THE 2" FLU PIPE AND MEASUREMENTS TO THREE REFERENCES (1, 8), 1987 - DON SEMRAU & ASSOCIATES SURVEY SHOWS A 2" IRON PIPE IN MOUND OF ROCKS (6) 2008 - LISSER & ASSOCIATES SURVEY SHOWS A 2" IRON PIPE PER PREVIOUS SURVEY (12)

FIELD SEARCH:

ON 3-27-13, THIS SURVEY FOUND: (1) AN OLD, PITTED 2" IRON PIPE LYING IN PIECES IN A LOOSE ROCK PILE A FOOT FROM A NEARBY UPRROOTED TREE THAT MAY HAVE DISTURBED THE 2" IRON PIPE AND ROCK PILE. (2) THE ROTTED REMAINS OF A 14" (NOW) FIR STUMP R.P. THAT WAS ESTABLISHED 1978 BY SKAGIT SURVEYORS. (3) SMALL RP NAIL INSIDE OF THE OVERGROWTH OF A 20" (NOW) LIVE CEDAR THAT WAS ESTABLISHED IN 1979 BY SKAGIT SURVEYORS

CORNER PERPETUATION:

THIS SURVEY LOCATED AND TIED THE CENTERS OF THE NORTHWESTERLY R.P. AS WELL AS THE SOUTHEASTERLY R.P. FROM THE 1979 SKAGIT SURVEYORS SURVEY FROM THE COORDINATED POSITIONS OF THE CENTERS OF THE REFERENCES. THE POSITION FOR THE CORNER WAS CALCULATED BY DISTANCE-DISTANCE INTERSECTION. ONCE THE EXACT POSITION FOR THE CORNER WAS LOCATED ON THE GROUND, A DRILL-HOLE WAS MADE IN SOLID ROCK AND A 5/8" REBAR AND STAMPED 2" DNR ALUMINUM CAP WAS GLOED INTO PLACE. REFERENCES WERE ESTABLISHED AS FOLLOWS: A DNR VINYL RP TAG ON AN 11" CEDAR BEARS N48E AT 38.73 FEET TO AN ALUMINUM NAIL THAT IS 2 FEET UP ON THE NORTHWEST SIDE. A PK NAIL IN ROCK BEARS N77E AT 11.73 FEET. A DNR VINYL RP TAG ON A 17" FIR BEARS N85E AT 69.72 FEET TO AN ALUMINUM NAIL THAT IS 2 FEET UP ON THE NORTH SIDE. A DNR VINYL RP TAG ON A 16" CEDAR BEARS SOUTH AT 10.50 FEET TO AN ALUMINUM NAIL THAT IS 2 FEET UP ON THE EAST SIDE. AN ORANGE CARSONITE POST BEARS NORTH AT 2 FEET. FIELD BOOK 7088, PAGE 38, DATED 3-27-2013

[J4] E 1/16 SECTION CORNER OF SECTIONS 7 AND 18

SET A 2" DNR ALUMINUM CAP AT CALCULATED POSITION HISTORY: 1958 - A CORNER VISIT BY COLLEN AND HENDRICKSON INDICATES THE EXISTENCE OF A 1 1/2" IRON PIPE IN A ROCK PILE. THE CORNER RECOVERY RECORD DOES NOT SAY WHETHER THE PIPE WAS SET AT THAT TIME OR WAS FOUND (8)

FIELD SEARCH:

ON 3-19-13, THIS SURVEY FOUND A 2" IRON PIPE IN A ROCK PILE (NOT ACCEPTED). THE 2" IRON PIPE BEARS N95+44E (GRID) AT 18.14 FEET FROM THE CALCULATED POSITION. THERE IS NO RECORD DOCUMENTING THE METHODS USED TO SET THE 2" IRON PIPE AND SO THERE IS NO WAY TO DISTINGUISH IT FROM AN APPROXIMATE CORNER.

CORNER PERPETUATION:

THIS SURVEY SET A STAMPED 2" DNR ALUMINUM CAP ON A 3/8" REBAR AT THE CALCULATED MIDPOINT. THE REBAR WAS GLOED INTO A DRILL HOLE IN SOLID ROCK. REFERENCES WERE ESTABLISHED AS FOLLOWS: A DNR VINYL RP TAG ON A 15" FIR BEARS N41E AT 23.15 FEET TO AN ALUMINUM NAIL THAT IS 1 1/2 FEET UP ON THE SOUTHEAST SIDE. A DNR VINYL RP TAG ON A 13" FIR BEARS N76E AT 5.11 FEET TO AN ALUMINUM NAIL THAT IS 1 1/2 FEET UP ON THE NORTHWEST SIDE. A DNR VINYL RP TAG ON A 19" FIR BEARS N34W AT 16.07 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE NORTHEAST SIDE. FIELD BOOK 7088, PAGE 34, DATED 3-19-2013

[J5] CORNER OF SECTIONS 7, 8, 17 AND 18

FOUND AND ACCEPTED A 3" IRON PIPE HISTORY: 1980, 1986, 1995 - SKAGIT SURVEYORS SURVEY FOUND A 3" IRON PIPE (1, 5, 9) 1980 AND 1987 - SEMRAU AND ASSOCIATES SURVEY FOUND A 3" PIPE AND TAG (2, 6) 1997 - SEMRAU & LISSER SURVEY REFERS TO SHORT PLAT NO. 36-80 (10) 2006 PACIFIC SURVEYING AND ENGINEERING SURVEY SHOWS A 3" IRON PIPE IN CONCRETE (11) 2008 - LISSER & ASSOCIATES SURVEY SHOWS A 3" IRON PIPE PER PREVIOUS SURVEY (12)

FIELD SEARCH:

ON 1-10-13, THIS SURVEY FOUND AND ACCEPTED A 3" IRON PIPE THAT EXTENDS 2' ABOVE GROUND. THE 3" IRON PIPE IS ON THE SOUTH SIDE OF WEST BIG LAKE ROAD AND IS AT A THREE-WAY FENCE INTERSECTION.

CORNER PERPETUATION:

NO REFERENCING WAS DONE FOR THIS MONUMENT. THE IN FIELD BOOK 7088, PAGE 5, DATED 1-10-2013

[K4] NE 1/16 SECTION CORNER OF SECTION 18

SET A DNR ALUMINUM MONUMENT AT CALCULATED POSITION

HISTORY:

NO EVIDENCE WAS FOUND IN SURVEY RECORDS OF THIS CORNER EVER HAVING BEEN SET.

FIELD SEARCH:

ON 3-19-13, THIS SURVEY FOUND A 1/2" REBAR WITH YELLOW PLASTIC CAP STAMPED 7019 (NOT ACCEPTED). THE REBAR AND CAP BEARS S77+38W (GRID) AT 11.38 FEET FROM THE CALCULATED POSITION. THE STATE BOARD OF REGISTRATION FOR ENGINEERS AND LAND SURVEYORS LISTS LAS 7019 AS THEODORE B. THOMPSON BUT NO RECORD OF SURVEY WAS FOUND TO HAVE BEEN FILED WITH THE COUNTY AUDITOR'S OFFICE. THE POSITION OF THE REBAR AND CAP WOULD SEEM TO INDICATE THAT IT WAS CALCULATED AND SET HAVING USED SECTION 18 DIVISION CONTROL THAT DIFFERS FROM ALL MEASUREMENTS OF RECORD.

CORNER PERPETUATION:

THIS SURVEY SET A STAMPED DNR ALUMINUM MONUMENT AT THE CALCULATED POSITION. REFERENCES WERE ESTABLISHED AS FOLLOWS: A DNR VINYL RP TAG ON A 14" FIR BEARS S66E AT 18.72 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE SOUTHWEST SIDE. A DNR VINYL RP TAG ON A 23" HEMLOCK BEARS S65W AT 20.72 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE SOUTHEAST SIDE. A PK NAIL, 4 FEET UP ON THE SOUTHEASTERLY SIDE OF AN 8X15X7" TAIL ROCK BEARS N84W AT 19.65 FEET. AN ORANGE CARSONITE POST BEARS SOUTH AT 2 FEET. FIELD BOOK 7088, PAGE 36, DATED 3-19-2013

[K5] N 1/16 SECTION CORNER OF SECTIONS 17 AND 18

FOUND AND ACCEPTED A 1/2" REBAR AND YELLOW PLASTIC CAP

HISTORY:

1980 - SEMRAU AND ASSOCIATES SURVEY SET AN IRON ROD MARKED D S 9622 (2)

FIELD SEARCH:

ON 3-14-13, THIS SURVEY FOUND AND ACCEPTED A 1/2" REBAR WITH YELLOW PLASTIC CAP STAMPED 1S & ROE 9622. CORNER PERPETUATION: THIS SURVEY ESTABLISHED REFERENCES AS FOLLOWS: A DNR VINYL RP TAG ON A 48" CEDAR STUMP BEARS S73E AT 18.20 FEET TO AN ALUMINUM NAIL THAT IS 2 FEET UP ON THE NORTHEAST SIDE. A DNR VINYL RP TAG ON A 23" MAPLE BEARS S7E AT 15.70 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE NORTHEAST SIDE. A DNR VINYL RP TAG ON A 36" CEDAR STUMP BEARS S51W AT 32.66 FEET TO AN ALUMINUM NAIL THAT IS 2 FEET UP ON THE SOUTHEAST SIDE. AN ORANGE CARSONITE POST BEARS WEST AT 1 FOOT. FIELD BOOK 7088, PAGE 31, DATED 3-14-2013

[L3] C 1/4 SECTION CORNER OF SECTION 18

CALCULATED POSITION, NO MONUMENT ESTABLISHED HISTORY: 1980 - PARAGON LAND SURVEYING SURVEY SHOWS CORNER SET FROM R. P. S (3) 2008 - LISSER & ASSOCIATES SURVEY CALCULATED A POSITION (12)

FIELD SEARCH:

ON 1-29-13, THIS SURVEY DID NOT FIND ANY MARKERS FOR THE C 1/4 SECTION CORNER. CORNER PERPETUATION: THIS SURVEY CALCULATED A POSITION FOR THIS CORNER USING A BEARING-BEARING INTERSECTION. MONUMENTS WERE TIED AT J1, J5, K5, K6, L1, L2, L4 AND L5. THE POSITIONS OF N3 AND N5 WERE CALCULATED USING CORNER TIES THIS SURVEY HAS IN COMMON WITH THE 2008 SURVEY BY LISSER & ASSOCIATES. THE CALCULATED POSITION OF N3 WAS USED AS THE SOUTHERLY TERMINUS OF THE NORTH-SOUTH CENTRLINE OF SECTION 18. THE TIE POSITIONS OF J5, L1 AND L2 WERE USED AS THE OTHER TERMINAL POINTS IN THE BEARING-BEARING INTERSECTION. NO MONUMENT WAS SET FOR THE C 1/4.

[L4] CENTER E 1/16 SECTION CORNER OF SECTION 18

FOUND AND ACCEPTED A 1/2" REBAR WITH YELLOW PLASTIC CAP HISTORY: 2008 - LISSER & ASSOCIATES SURVEY SET A REBAR WITH YELLOW CAP (12)

FIELD SEARCH:

ON 1-28-13, THIS SURVEY FOUND AND ACCEPTED A 1/2" REBAR WITH YELLOW PLASTIC CAP MARKED 'LISSER'. CORNER PERPETUATION: NO REFERENCING WAS DONE FOR THIS MONUMENT. THE IN FIELD BOOK 7088, PAGE 15, DATED 1-28-2013

10-14-13



A SURVEY IN SECTION 18 TOWNSHIP 33 NORTH, RANGE 5 EAST, W. M. STATE OF WASHINGTON DEPARTMENT OF NATURAL RESOURCES LAND SURVEY SECTION P.O. BOX 47030 OLYMPIA, WASHINGTON 98504-7030 (360)902-1206

ANGEL'S LAST FIELD CREW: HERRICK, WILLIAMS BECKETT FIELD BOOK: 7088 FM1767.DWG 06/05/13 F.M.# 1767 SHEET 2 OF 3

CORNER HISTORY AND DESCRIPTIONS

201310210001
 \$148.00
 Skagit County Auditor
 10/21/2013 Page 3 of 3 8:44AM

[L5] 1/4 SECTION CORNER OF SECTIONS 17 AND 18
 FOUND AND ACCEPTED A 1" IRON ROD IN ROCK MOUND

HISTORY:
 1980 AND 1987 - SEMRAU AND ASSOCIATES SURVEY SHOWS A 1" AXLE IN ROCK PILE (2, 6)
 1980 - PARAGON LAND SURVEYING SURVEY SHOWS A 3/4" I. P. (3)
 1997 - SEMRAU & USSER SURVEY REFERS TO SHORT PLAT NO. 36-80 (10)
 2006 - PACIFIC SURVEYING & ENGINEERING SURVEY SHOWS A 1" AXLE IN ROCK PILE (11)
 2008 - USSER & ASSOCIATES SURVEY SHOWS A 1" IRON PIN (12)

FIELD SEARCH:
 ON 1-10-13, THIS SURVEY FOUND AND ACCEPTED A 1" IRON ROD IN ROCK MOUND.

CORNER PERPETUATION:
 THIS SURVEY ESTABLISHED REFERENCES AS FOLLOWS:
 DNR VINYL RP TAG ON A 30" MARLE BEARS N40E AT 20.68 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE SOUTHEAST SIDE
 DNR VINYL RP TAG ON A 32" MARLE BEARS SOUTH AT 40.89 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE WEST SIDE
 DNR VINYL RP TAG ON A 29" CEDAR BEARS S84W AT 42.54 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE SOUTHEAST SIDE
 A DNR VINYL RP TAG ON A 20" CEDAR BEARS N89W AT 23.85 FEET TO AN ALUMINUM NAIL THAT IS 1 FOOT UP ON THE NORTHEAST SIDE
 AN ORANGE CARBONITE POST BEARS NORTH AT 1 FOOT.
 FIELD BOOK 7088, PAGE 2, DATED 1-10-2013

[LM1] LINE MONUMENT

FOUND AND ACCEPTED A 1/2" REBAR WITH YELLOW PLASTIC CAP

HISTORY:
 2008 - USSER & ASSOCIATES SURVEY SET A REBAR WITH YELLOW CAP (12)

FIELD SEARCH:
 ON 1-29-13, THIS SURVEY FOUND AND ACCEPTED A 1/2" REBAR WITH YELLOW PLASTIC CAP MARKED USSER AS MARKING THE EAST-WEST CENTERLINE OF SECTION 18 WEST OF THE C 1/4 SECTION CORNER.

CORNER PERPETUATION:
 NO REFERENCING WAS DONE FOR THIS MONUMENT.
 TIE IN FIELD BOOK 7088, PAGE 18, DATED 1-29-2013

[LM2] LINE MONUMENT

FOUND AND ACCEPTED A 1/2" REBAR WITH YELLOW PLASTIC CAP

HISTORY:
 2008 - USSER & ASSOCIATES SURVEY SET A REBAR WITH YELLOW CAP (12)

FIELD SEARCH:
 ON 1-29-13, THIS SURVEY FOUND AND ACCEPTED A 1/2" REBAR WITH YELLOW PLASTIC CAP MARKED USSER AS MARKING THE EAST-WEST CENTERLINE OF SECTION 18 EAST OF THE C 1/4 SECTION CORNER.

CORNER PERPETUATION:
 NO REFERENCING WAS DONE FOR THIS MONUMENT.
 TIE IN FIELD BOOK 7088, PAGE 17, DATED 1-29-2013

[N3] 1/4 SECTION CORNER OF SECTIONS 18 AND 19
 CONCRETE MONUMENT, POSITION CALCULATED PER SURVEY RECORDS

HISTORY:
 1980 - PARAGON LAND SURVEYING SURVEY SHOWS A CALCULATED POSITION (3)
 1983 - DEPARTMENT OF NATURAL RESOURCES SURVEY SET A CONCRETE MONUMENT AT A CALCULATED POSITION AND DID NOT ACCEPT A FOUND REBAR & CAP THAT IS 42 FEET TO THE SOUTHWEST (13)
 2006 - PACIFIC SURVEYING & ENGINEERING SURVEY CALCULATED A POSITION PER THE 1983 DNR SURVEY (11)
 2008 - USSER & ASSOCIATES SURVEY FOUND AND ACCEPTED A DNR MONUMENT AND DID NOT ACCEPT A 1" IRON PIPE THAT IS TO THE SOUTHWEST (12)

CORNER CALCULATION:
 THIS SURVEY HELD THE TIED POSITIONS FOR U5 AND U5 AND CALCULATED THE POSITION OF N3 USING THE MEASUREMENTS SHOWN ON THE 2008 SURVEY BY USSER & ASSOCIATES.

[N5] CORNER OF SECTIONS 17, 18, 19 AND 20

IRON PIPE WITH BRASS CAP, POSITION CALCULATED PER SURVEY RECORDS

HISTORY:
 1980 & 1987 - DON SEMRAU SURVEY SHOWS A 1" PIPE (2, 6)
 1980 - PARAGON LAND SURVEYING SURVEY SHOWS A 1" IRON PIPE (3)
 1983 - DEPARTMENT OF NATURAL RESOURCES SURVEY REPLACED A 1" IRON PIPE WITH A DNR IRON PIPE WITH BRASS CAP (13)
 1997 - SEMRAU & USSER SURVEY REFERS TO AN IRON PIPE PER SHORT PLAT 36-80 (10)
 2006 - PACIFIC SURVEYING & ENGINEERING SURVEY FOUND A 1 1/4" IRON PIPE WITH DNR BRASS CAP (11)
 2008 - USSER & ASSOCIATES SURVEY SHOWS A 1" IRON PIPE PER PREVIOUS SURVEY (12)

CORNER CALCULATION:
 THIS SURVEY HELD THE TIED POSITIONS FOR U5 AND U5 AND CALCULATED THE POSITION OF N5 USING THE MEASUREMENTS SHOWN ON THE 2008 SURVEY BY USSER & ASSOCIATES.



10-14-13

ANGEL'S LAST
 A SURVEY IN SECTION 18
 TOWNSHIP 33 NORTH, RANGE 5 EAST, W.M.
 STATE OF WASHINGTON
 DEPARTMENT OF NATURAL RESOURCES
 LAND SURVEY SECTION - P.O. BOX 47030
 OLYMPIA, WASHINGTON 98504-7030 (360)902-1206

FIELD CREW: HERRICK, WILLIAMS
 BECKETT
 FIELD BOOK: 7088
 FM1767.DWG 06/05/13

F.M.# 1767
 SHEET 3 OF 3