

**A DEPENDENT RE-SURVEY for
Weyerhaeuser Columbia Timberlands,
Indexed as being a portion of the:
East Line of SECTION 35, T35N R5E, W.M.
as situated within
SKAGIT COUNTY, WASHINGTON**

201704200048
Skagit County Auditor
4/20/2017 Page 1 of 1 1:11:23AM \$197.00

BASIS OF BEARING
BETWEEN FOUND MONUMENTS ON THE
EAST LINE OF SECTION 35, T35N R5E
AS PREVIOUSLY RECORDED.
(SEE NOTES 1,2)

PROPERTY CORNER
Fd. 1-1/4" GIP w/yellow
plastic cap stamped
LS-21423. (See Note 1)
Set steel fence post
South-1.0'

1/4 CORNER
Fd. 1-1/4" GIP
w/2" stamped
Aluminum cap in
mound of stone.
(See Notes 1,2)
N 01°57'43" E
410.57'
(NOI°56'55"E)
(410.01')
(NOTES 1,2)




FOUND REFERENCES
-30" ROTTED STUMP W/TAG
S43°W-4.45'
-18" ROTTED STUMP W/TAG
SG09°W-5.13'
NEW REFERENCES
-1/2" ALDER BARK SCRIBED (1/4536 BT1)
SB0°E-42.7'
-16" CEDAR SCRIBED (1/4535 BT1)
SB9°W-37.3'

**WEYERHAEUSER COLUMBIA TIMBERLANDS
(AKA LONGVIEW TIMBERLANDS, LLC)**

BASIS OF BEARING
(NOI°56'55"E-2646.35' NOTES 1,2)
N 01°56'55" E - 2645.83'

**WASHINGTON STATE
DEPARTMENT OF
NATURAL RESOURCES**

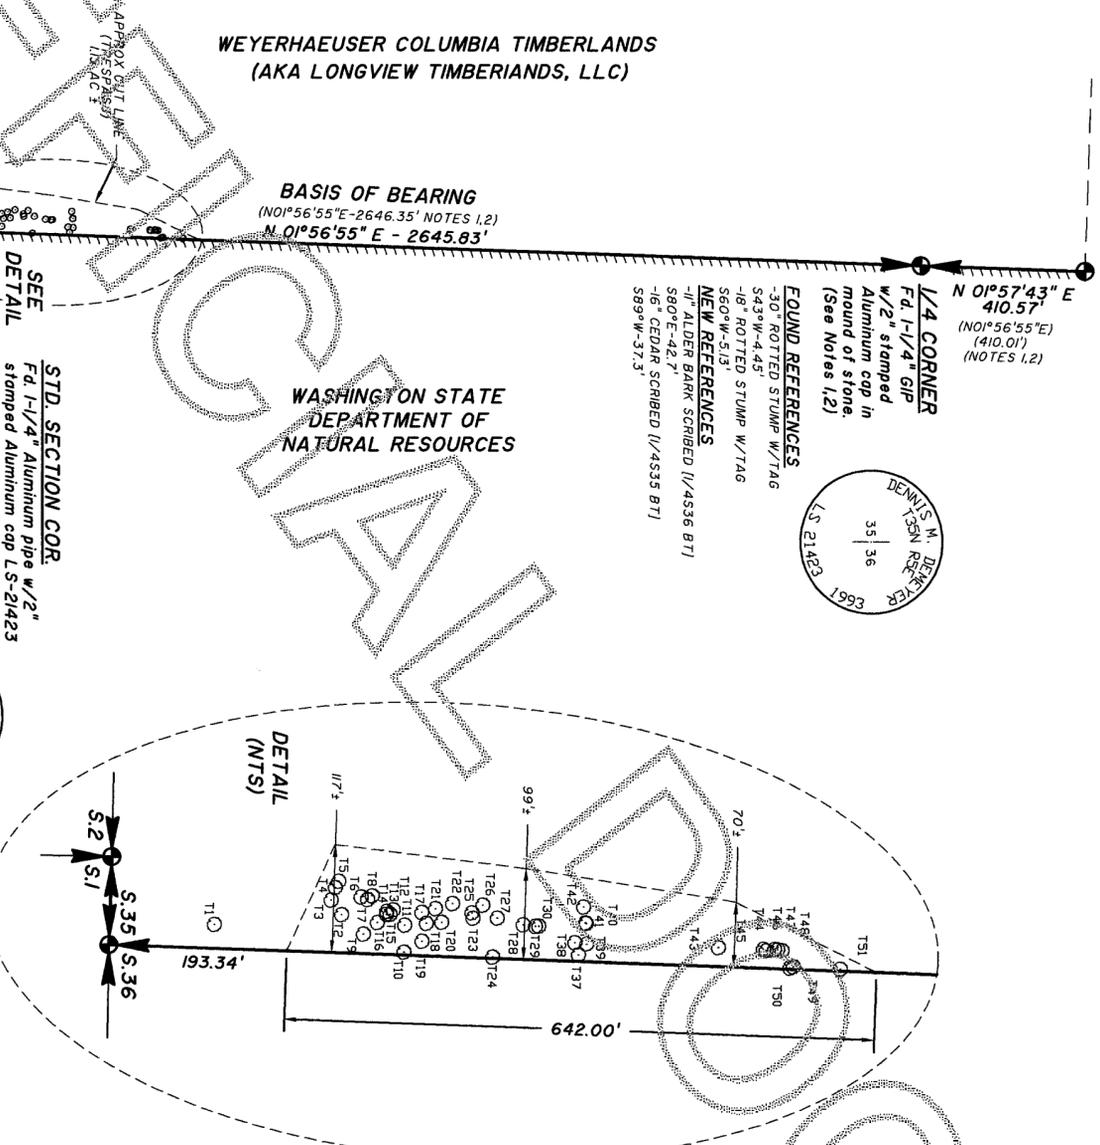

TREE #	SIZE / SPECIES
T1	38" HEM. STUMP
T2	29" CEDAR STUMP
T3	18" HEM. STUMP
T4	26" HEM. STUMP
T5	16" HEM. STUMP
T6	22" CEDAR STUMP
T7	36" HEM. STUMP
T8	13" HEM. STUMP
T9	60" MAPLE STUMP
T10	29" CEDAR STUMP
T11	32" CEDAR STUMP
T12	17" CEDAR STUMP
T13	10" ALDER STUMP
T14	36" HEM. STUMP
T15	12" CEDAR STUMP
T16	25" ALDER STUMP
T17	30" FIR STUMP
T18	26" HEM. STUMP
T19	40" FIR STUMP
T20	16" HEM. STUMP
T21	30" CEDAR STUMP
T22	28" CEDAR STUMP
T23	13" HEM. STUMP
T24	11" CEDAR STUMP
T25	53" MAPLE STUMP
T26	60" MAPLE STUMP
T27	15" HEM. STUMP
T28	43" MAPLE STUMP
T29	13" HEM. STUMP
T30	38" MAPLE STUMP
T31	8" ALDER STUMP
T32	17" MAPLE STUMP
T33	30" CEDAR STUMP
T34	13" MAPLE STUMP
T40	13" MAPLE STUMP
T42	40" HEM. STUMP
T43	21" HEM. STUMP
T44	10" MAPLE STUMP
T45	9" ALDER STUMP
T46	19" HEM. STUMP
T47	17" HEM. STUMP
T48	17" HEM. STUMP
T49	20" HEM. STUMP
T50	33" HEM. STUMP
T51	26" CEDAR STUMP

- NOTES**
- 1) 1993 Survey by D. Demeyer, LS-21423, AFN 9308R00024
 - 2) 1986 Survey by D. Demeyer, LS-21423, AFN 8602180005
 - 3) This survey was conducted by means of a closed traverse between existing corners and/or prior control, using a "LEICA TS06+" TOTAL STATION (least read 0.5"). The relative accuracy of this control exceeds 1:10,000.

- LEGEND**
- = A corner FOUND or SET during a previous survey, as described
 - () = A Bearing and/or Distance of record
 - GIP = A Galvanized iron Pipe
 - = A line marked this survey with 6" white fiberglass rods, paint and flagging.
 - ⊙ = A stump of a harvested tree (Treespass)
 - ⊙ = A stump of a harvested tree (Treespass) (See Table for species & stump size)

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction, in conformance with the requirements of the Survey Recording Act of 1973, at the request of Weyerhaeuser Columbia Timberlands.

In January, 2017.

Phillip R. Gustaf
Phillip R. Gustaf, PLS
Certificate no. 37,529

Date signed: 4/12/2017




AUDITOR'S CERTIFICATE

Filed for record this 20th day of April, 2017
at 11:23 A.M. in Book _____ of SURVEYS, of
PAGE _____ of the request of HAMPSTUR CORPORATION,
COUNTY Auditor

HAMPSTUR CORPORATION

Calculated by: BH/TLG
Checked by: PRG
Drawn by: TLG
Completion date: 1/25/2017
Field Book no.: PS-774
Drawing No.: 17-603.dwg
HAMPSTUR JOB no.: 17-603
Sheet no. 1 of 1

P.O. Box 368
Kelso, Washington 98626
Phone: (360) 423-8166



SCALE: 1 inch = 300 feet