A DEPENDENT SURVEY of the SE.1/4 and the EAST LINE of the NE.1/4 of SECTION 8, T34N R6E, W.M. for Weyerhaeuser Company as situated within SKAGIT COUNTY, WASHINGTON

BASIS OF BEARING

THE E-W CENTERLINE OF SECTION 8 PER SR-1

500 0 500 1500

SCALE: 1 inch = 500 feet

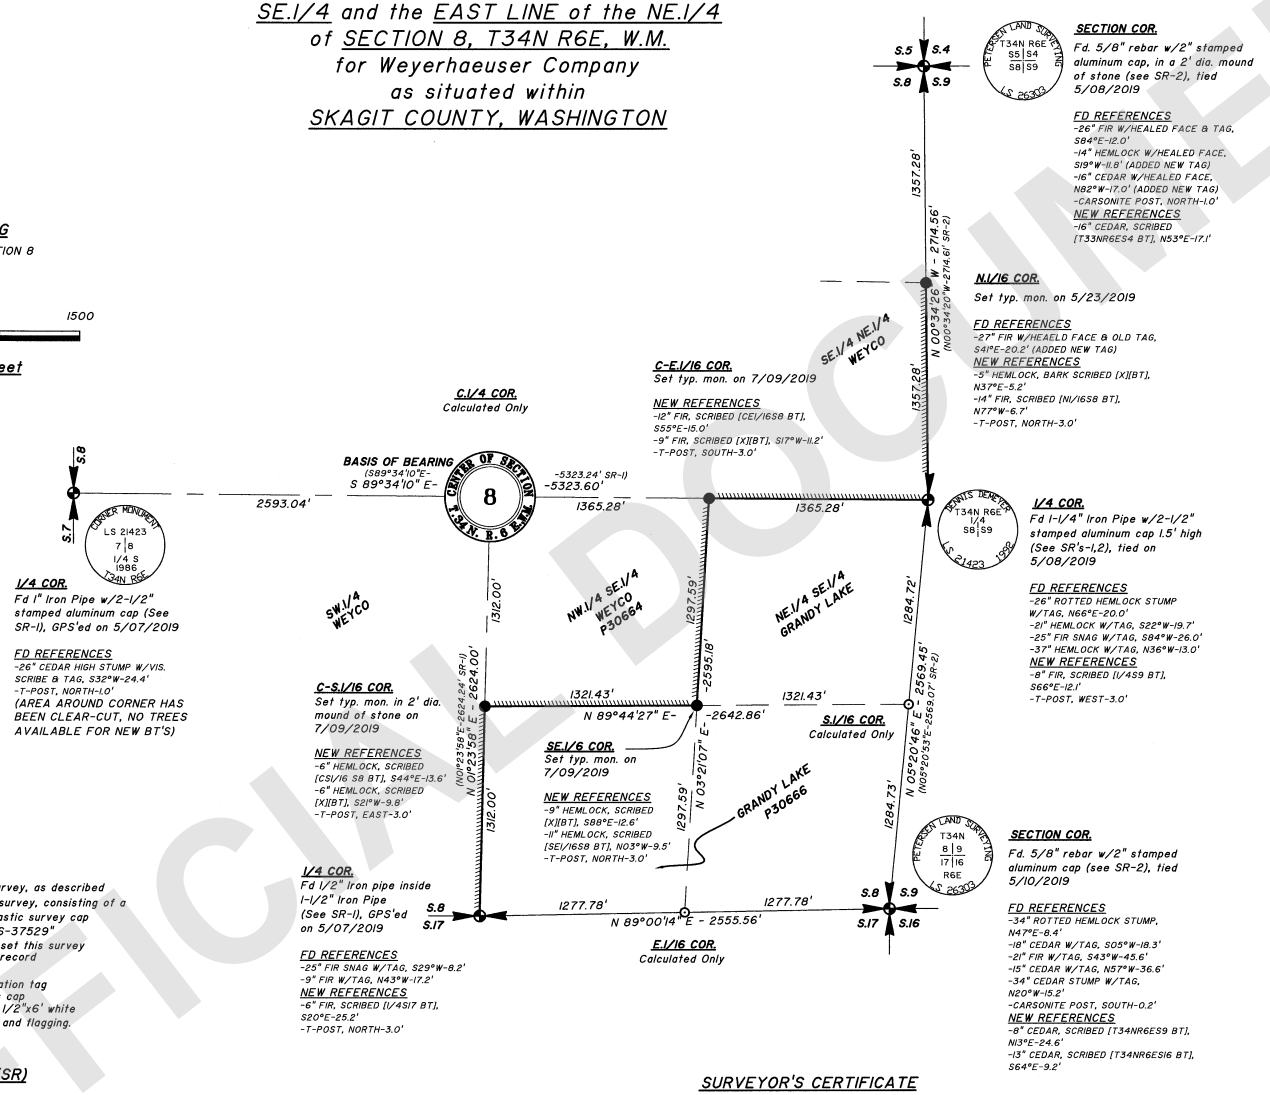

SECTION COR.

Fd. 5/8" rebar w/2" stamped aluminum cap, in a 2' dia. mound of stone (see SR-2), tied 5/08/2019

FD REFERENCES
-26" FIR W/HEALED FACE & TAG, S84°E-12.0'
-14" HEMLOCK W/HEALED FACE, S19°W-11.8' (ADDED NEW TAG)
-16" CEDAR W/HEALED FACE, N82°W-17.0' (ADDED NEW TAG)
-CARSONITE POST, NORTH-1.0'
NEW REFERENCES
-16" CEDAR, SCRIBED [T33NR6ES4 BT], N53°E-17.1'

N.1/16 COR.

Set typ. mon. on 5/23/2019

FD REFERENCES
-27" FIR W/HEAELD FACE & OLD TAG, S41°E-20.2' (ADDED NEW TAG)
NEW REFERENCES
-5" HEMLOCK, BARK SCRIBED [X][BT], N37°E-5.2'
-14" FIR, SCRIBED [N1/16S8 BT], N77°W-6.1'
-T-POST, NORTH-3.0'

1/4 COR.

Fd 1-1/4" Iron Pipe w/2-1/2" stamped aluminum cap 1.5' high (See SR's-1,2), tied on 5/08/2019

FD REFERENCES
-26" ROTTED HEMLOCK STUMP W/TAG, N66°E-20.0'
-21" HEMLOCK W/TAG, S22°W-19.7'
-25" FIR SNAG W/TAG, S84°W-26.0'
-37" HEMLOCK W/TAG, N36°W-13.0'
NEW REFERENCES
-8" FIR, SCRIBED [1/4S9 BT], S66°E-12.1'
-T-POST, WEST-3.0'

SECTION COR.

Fd. 5/8" rebar w/2" stamped aluminum cap (see SR-2), tied 5/10/2019

FD REFERENCES
-34" ROTTED HEMLOCK STUMP, N47°E-8.4'
-18" CEDAR W/TAG, S05°W-18.3'
-21" FIR W/TAG, S43°W-45.6'
-15" CEDAR W/TAG, N57°W-36.6'
-34" CEDAR STUMP W/TAG, N20°W-15.2'
-CARSONITE POST, SOUTH-0.2'
NEW REFERENCES
-8" CEDAR, SCRIBED [T34NR6ES9 BT], N13°E-24.6'
-13" CEDAR, SCRIBED [T34NR6ES16 BT], S64°E-9.2'

LEGEND

- = A corner FOUND during this survey, as described
- = A new corner SET during this survey, consisting of a 5/8"x30" rebar with yellow plastic survey cap stamped "HAMPSTUR CORP LS-37529"
- = A corner calculated only--not set this survey
- ( ) = A Bearing and/or Distance of record
- WEYCO = Weyerhaeuser Company
- T-POST = A 6' steel fence post with location tag
- R/C = A rebar with plastic surveyor's cap
- = A line marked this survey with 1/2"x6' white fiberglass rods, painted blazes and flagging.

SURVEY REFERENCES (SR)

1) 2009 SURVEY BY J. SIMES, LS-44648, AFN 200909150038
2) 2008 SURVEY BY F. PETERSEN, LS-26303, AFN 200808270074

*This survey was conducted using a "LEICA GPS system & TS06+" TOTAL STATION, obtaining a relative accuracy exceeding 1:10,000.

**Each new corner BT was measured to the center of the tree, referenced by a 60d nail on the right side and a reference tag referring to the corner.

AUDITOR'S CERTIFICATE

Filed for record this 14th day of August, 2019

under AFN 201908140027

at the request of HAMPSTUR CORPORATION

Sandra Perkins
COUNTY AUDITOR

DEPUTY AUDITOR

SURVEYOR'S CERTIFICATE

This map correctly represents a survey made by me or under my direction, in conformance with the requirements of the Survey Recording Act, at the request of WEYERHAEUSER CO, in APRIL, 2019.

Phillip R. Gustin
Phillip R. Gustin PLS
Certificate no. 37529

Date signed: 8/12/2019

PHILLIP R. GUSTIN STATE OF WASHINGTON 37529 REGISTERED PROFESSIONAL LAND SURVEYOR

HAMPSTUR CORPORATION

HAMPSTUR CORPORATION SURVEYORS & ENGINEERS

P.O. Box 368
Kelso, Washington 98626
Phone: (360) 423-8166

Calculated by :	CJH
Checked by :	CJH/PRG
Drawn by :	TLG
Completion date :	7/09/2019
Field Book no. :	19-622
Drawing No. :	19-622.DWG
HAMPSTUR JOB no. :	19-622
Sheet no.	1 of 1

Aug 09, 2019 - 1:26pm
C:\Carlson Projects\600 JOBS\19-622\19-622.dwg

201908140027
08/14/2019 10:15 AM Pages: 1 of 1 Fees: $187.50
Skagit County Auditor

UNOFFICIAL DOCUMENT