

RECORD OF SURVEY

HOSKINS PARCEL

SITUATE IN A PORTION OF THE SOUTHWEST QUARTER OF THE NORTHEAST QUARTER OF SECTION 35,
TOWNSHIP 34 NORTH, RANGE 2 EAST, T14N, R24E, SKAGIT COUNTY, WASHINGTON.

④ QUARTER CORNER SECTIONS 35 & 36

OCTOBER 3, 1917, GEORGE R. CAMPBELL, U.S. SURVEYOR UNDER GOVERNMENT CONTRACT NUMBER 35, APPROVED JANUARY 21, 1919, NO EVIDENCE OF THE ORIGINAL CORNER SET WITH BRASS CAP MARKED "N 1/2 1/2 INCH DIAMETER CONCRETE" (SCRAMBLER ERROR - A GRANITE ROCK IN PLACE, 1623X50 INCHES ABOVE THE GROUND BEANS N 2° 15' W, 65.1 LIMS (10.10 FEET) MARKED "X 80 35" BEARS ABOVE THE GROUND BEANS 100 LIMS (66.0 FEET) MARKED "X 80 35" BEARS ABOVE THE GROUND BEANS 109 FEET ABOVE THE SWINOMISH SLough.

JUNE 28, 2008 TO AUGUST 21, 2007, JOHN D. MCCALLEY, CONSULTING SURVEYOR, UNDER BRASS CAP MARKED "N 1/2 1/2 INCH DIAMETER CONCRETE" (SCRAMBLER ERROR - PROJECTING ROCK, 492X318 INCHES ABOVE THE GROUND BEANS N 3° W, 101.1 FEET MARKED "X 80 28 ON TOP" (RECORD IN 1/4" W/3) (SCRAMBLER ERROR - SHOULD READ "X 80 35") A NEW BEARING TREE, 7 INCH NOBEL FR. BEANS S 14° 12' E, 53.7 FEET, MARKED "1/4 A STEEL FENCE POST IS ALONGSIDE NORTHEAST OF THE CORNER.

AUGUST 4, 2010, AUDITOR'S FILE NUMBER 20100904005, FOUND 2 1/2 INCH G.L.O. BRASS CAP ON 2 1/2 INCH IRON PIPE, 1977 LS 15690, ON 2 1/2 INCH G.L.O. BRASS CAP MARKED "N 1/2 1/2 INCH DIAMETER CONCRETE" (SCRAMBLER ERROR - MONUMENT IS NOT A G.L.O. BRASS CAP), BEARING ORIENT MARKED BY CAMPBELL, 1917, A 49X318 INCHES DIAMETER GRANITE BOLDER WITH X 80 35 BEANS NORTH 3 DEGREES 04 MINUTES WEST, 101.10 FEET G.L.O. 1917, AS WEST QUARTER CORNER SECTION 35.

JANUARY 23, 2012, AUDITOR'S FILE NUMBER 20120420209, FOUND 2 1/2 INCH BRASS DISK MARKED "N 1/2 1/2 INCH DIAMETER CONCRETE" (SCRAMBLER ERROR - MONUMENT IS NOT A G.L.O. BRASS CAP), BEARING ORIENT MARKED BY CAMPBELL, 1917, A 49X318 INCHES DIAMETER GRANITE BOLDER WITH X 80 35 BEANS NORTH 3 DEGREES 04 MINUTES WEST, 101.10 FEET G.L.O. 1917, AS WEST QUARTER CORNER SECTION 35.

③ NORTHEAST SIXTEENTH CORNER

FEBRUARY 2, 1924, GENERAL LAND OFFICE DEPUTY SURVEYOR LEWIS VAN VLEET, UNDER GOVERNMENT CONTRACT NUMBER 35, APPROVED JANUARY 21, 1919, NO EVIDENCE OF THE ORIGINAL CORNER FOR 1/16 CORNER FROM WHICH: 1 3/4 INCH CEDAR BEANS N 25° E, 19 LIMS (12.2 FEET), 1 3/4 INCH CEDAR BEANS S 20° W, 13 LIMS (8.6 FEET).

④ CENTER EAST SIXTEENTH CORNER

JANUARY 23, 1978, AUDITOR'S FILE NUMBER 872428, FOUND BROKEN CONCRETE MONUMENT, LOCATED CENTER OF 3/4 INCH SOLID IRON BAR.

JANUARY 20, 2000, FOUND 1 INCH DIAMETER CONCRETE FILLED IRON PIPE, FINELY SET, 0.2 FEET ABOVE GRADE, IN A HANG OF STONES, THE 1917 BRASS CAP WAS NOT FOUND. THE EXPRESSED CONCRETE SET A 2 INCH ALUMINUM CAP MARKED "E 1/16 S 4° 0' 20.00 PSE 35147" ON THE 1917 PIPE.

APRIL 23, 2012, AUDITOR'S FILE NUMBER 20120420209, FOUND BROKEN CONCRETE MONUMENT, LOCATED CENTER OF 3/4 INCH SOLID IRON BAR.

JANUARY 20, 2000, FOUND 1 INCH DIAMETER CONCRETE FILLED IRON PIPE, FINELY SET, 0.2 FEET ABOVE GRADE, IN A HANG OF STONES, THE 1917 BRASS CAP WAS NOT FOUND. THE EXPRESSED CONCRETE SET A 2 INCH ALUMINUM CAP MARKED "E 1/16 S 4° 0' 20.00 PSE 35147" ON THE 1917 PIPE.

③ NORTH SIXTEENTH CORNER SECTIONS 35 & 36

OCTOBER 3, 1917, U.S. DEPUTY SURVEYOR GEORGE R. CAMPBELL, UNDER SPECIAL INSTRUCTIONS NUMBER 35, APPROVED JANUARY 21, 1919, 133 FEET ABOVE THE GROUND BEANS N 1° 16' 04" W FROM FOUND G.L.O. BRASS CAP MARKED "N 1/16 S 3° 53' 25" E, 57'-1/2 LIMS (24.2 FEET) ABOVE THE GROUND BEANS S 63° 25' E, 57'-1/2 LIMS (24.2 FEET) ABOVE THE GROUND BEANS 151 INCH (12.5 FEET) ABOVE THE GROUND BEANS N 12° W, 28 LIMS (17.2 FEET) MARKED "N 1/16 S 35 151".


JUNE 5, 1998, AUDITOR'S FILE NUMBER 898940054, FOUND HORTON DENNIS 2"-1/2 INCH BRASS CAP IRON PIPE AT N 16° 04' W FROM FOUND G.L.O. BRASS CAP MARKED "N 101° 19' 17" W, 49 W, 0.45 FEET FROM G.L.O. CORNER, FALLS 0.5 FEET NORTH AND 0.7 FEET WEST OF THE CORNER.

MARCH 17, 2005, AUDITOR'S FILE NUMBER 20050317098, POSITION CALCULATED BY A 1 INCH IRON PIPE BEANS N 89° 45' W, 14.3 FEET BEANS N 89° 32' W, 12.08 FEET BEANS N 89° 45' W, 14.3 FEET BEANS S 10° 28' W, 31.9 FEET.


FEBRUARY 2, 2009, AUDITOR'S FILE NUMBER 20090202012, SET 5/8 INCH REBAR WITH YELLOW CAP, BEARING ORIENT MARKED BY CAMPBELL, 1917, A 49X318 INCHES DIAMETER GRANITE BOLDER WITH X 80 35 BEANS NORTH 3 DEGREES 04 MINUTES WEST, 101.10 FEET G.L.O. 1917, AS WEST QUARTER CORNER SECTION 35.

RECORD OF SURVEY
SWINOMISH INDIAN TRIBAL COMMUNITY
11430 MOORPARGE WAY
LACONNER, WA 98257

DRAWN BY: HLU CHECKED BY: PHB F.B.# 11714 DATE: 6/27/2025 JOB NO. 2020004 SHEET NO. 2 OF 5 DWS NO. 2020004-DWK-RDS-049

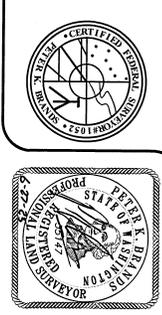


PACIFIC SURVEY & ENGINEERING INC EMAIL: info@psurvey.com
909 SQUALICUM WAY SUITE 111 BELLINGHAM, WA 98225 PHONE: 360.671.7387 FAX: 360.671.4685 www.psurvey.com

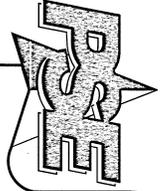

RECORD OF SURVEY

SITUATE IN A PORTION OF THE SOUTHEAST QUARTER OF THE NORTHEAST QUARTER OF SECTION 35,
TOWNSHIP 34 NORTH, RANGE 2 EAST, T.M., SKAGIT COUNTY, WASHINGTON.

HOSKINS PARCEL

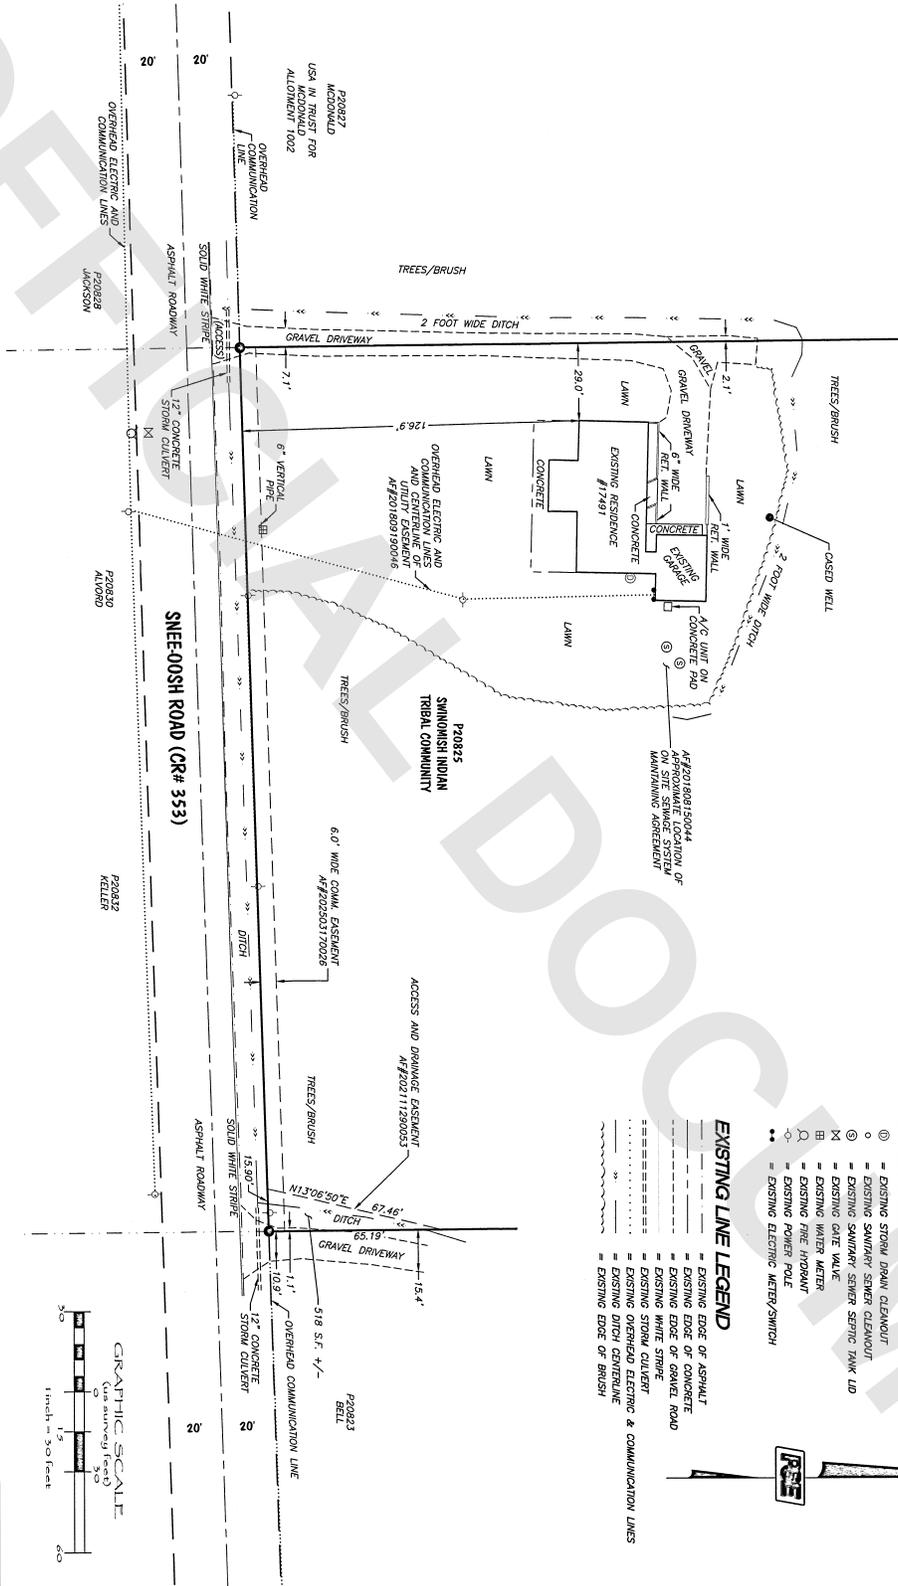


SYMBOL LEGEND

- ⊙ = EXISTING STORM DRAIN CLEANOUT
- = EXISTING SWIMMER SEWER CLEANOUT
- ⊗ = EXISTING SWIMMER SEWER SEPTIC TANK LD
- ⊗ = EXISTING GATE VALVE
- ⊗ = EXISTING WATER METER
- ⊗ = EXISTING FIRE HYDRANT
- ⊗ = EXISTING POWER POLE
- ⊗ = EXISTING ELECTRIC METER SWITCH

EXISTING LINE LEGEND

- = EXISTING EDGE OF ASPHALT
- = EXISTING EDGE OF CONCRETE
- = EXISTING EDGE OF BARREL ROAD
- = EXISTING STORM CULVERT
- = EXISTING OVERHEAD ELECTRIC & COMMUNICATION LINES
- = EXISTING DITCH CENTERLINE
- = EXISTING EDGE OF BRUSH



DRAWN BY: HLU CHECKED BY: RWG F.B.# 117114 DATE: 6/27/2025 JOB NO. 2020004 SHEET NO. 5 OF 5 DWG. NO. 2020004-54K-R05-AWG

RECORD OF SURVEY
SWINOMISH INDIAN TRIBAL COMMUNITY
11430 MOORAGE WAY
LACONNER, WA 98257

